

SECOND EDITION

# ENGINEERING MATERIALS 1

AN INTRODUCTION TO THEIR  
PROPERTIES & APPLICATIONS



Michael F Ashby • David R H Jones



# **Engineering Materials 1**

*An Introduction to their Properties and Applications*

### Other titles of interest

<i>Ashby</i>	Materials Selection in Mechanical Design
<i>Ashby and Jones</i>	Engineering Materials 2
<i>Brydson</i>	Plastics Materials, 6th Edition
<i>Charles and Crane</i>	Selection and Use of Engineering Materials, 2nd Edition
<i>Crawford</i>	Plastics Engineering, 2nd Edition
<i>Hull and Bacon</i>	Introduction to Dislocations, 3rd Edition
<i>Jones</i>	Engineering Materials 3
<i>Neale</i>	Tribology Handbook, 2nd Edition
<i>Shreir et al.</i>	Corrosion, 3rd Edition
<i>Smallman and Bishop</i>	Metals and Materials
<i>Smith</i>	The Language of Rubber

# **Engineering Materials 1**

*An Introduction to their Properties and Applications*

Second Edition

by

**Michael F. Ashby**

and

**David R. H. Jones**

*Department of Engineering, University of Cambridge, UK*

**B**UTTERWORTH  
**H**EINEMANN

OXFORD AMSTERDAM BOSTON LONDON NEW YORK PARIS  
SAN DIEGO SAN FRANCISCO SINGAPORE SYDNEY TOKYO

Butterworth-Heinemann  
An imprint of Elsevier Science  
Linacre House, Jordan Hill, Oxford OX2 8DP  
225 Wildwood Avenue, Woburn, MA 01801-2041

First published 1980  
Second edition 1996  
Reprinted 1997, 1998 (twice), 2000, 2001, 2002

© 1980, 1996. Michael F. Ashby and David R. H. Jones. All rights reserved.

The right of Author name to be identified as the author of this work has been asserted in accordance with the Copyright, Designs and Patents Act 1988

No part of this publication may be reproduced in any material form (including photocopying or storing in any medium by electronic means and whether or not transiently or incidentally to some other use of this publication) without the written permission of the copyright holder except in accordance with the provisions of the Copyright, Designs and Patents Act 1988 or under the terms of a licence issued by the Copyright Licensing Agency Ltd, 90 Tottenham Court Road, London, England W1T 4LP. Applications for the copyright holder's written permission to reproduce any part of this publication should be addressed to the publishers

**British Library Cataloguing in Publication Data**

Ashby, Michael F.

Engineering materials. 1. an introduction to their properties and applications. - 2nd. ed.

1. Materials 2. Mechanics

I. Title II. Jones, David R. H. (David Rayner Hunkin), 1945-620.1'1

ISBN 0 7506 3081 7

**Library of Congress Cataloguing in Publication Data**

Ashby, Michael F.

Engineering materials. 1. an introduction to their properties and applications/by Michael F. Ashby and David R. H. Jones - 2nd. ed.  
p. cm.

Rev.ed of Engineering materials. 1980.

Includes bibliographical references and index.

ISBN 0 7506 3081 7

1. Materials. I. Jones, David R. H. (David Rayner Hunkin),

1945-. II. Ashby, M.F. Engineering materials III. Title

TA403.A69

620.1'1-dc20

96-1677

CIP

For information on all Butterworth-Heinemann publications  
visit our website at [www.bh.com](http://www.bh.com)

Typeset by Genesis Typesetting, Rochester, Kent  
Printed and bound in Great Britain by MPG Books Ltd, Bodmin, Cornwall

# Contents

---

## General introduction

1. **Engineering Materials and their Properties** 3  
examples of structures and devices showing how we select the right material for the job
  
- A. Price and availability
2. **The Price and Availability of Materials** 15  
what governs the prices of engineering materials, how long will supplies last, and how can we make the most of the resources that we have?
  
- B. The elastic moduli
3. **The Elastic Moduli** 27  
stress and strain; Hooke's Law; measuring Young's modulus; data for design
4. **Bonding Between Atoms** 36  
the types of bonds that hold materials together; why some bonds are stiff and others floppy
5. **Packing of Atoms in Solids** 45  
how atoms are packed in crystals – crystal structures, plane (Miller) indices, direction indices; how atoms are packed in polymers, ceramics and glasses
6. **The Physical Basis of Young's Modulus** 58  
how the modulus is governed by bond stiffness and atomic packing; the glass transition temperature in rubbers; designing stiff materials – man-made composites
7. **Case Studies of Modulus-limited Design** 66  
the mirror for a big telescope; a stiff beam of minimum weight; a stiff beam of minimum cost

<b>C. Yield strength, tensile strength, hardness and ductility</b>	
8. <b>The Yield Strength, Tensile Strength, Hardness and Ductility</b>	77
definitions, stress–strain curves (true and nominal), testing methods, data	
9. <b>Dislocations and Yielding in Crystals</b>	93
the ideal strength; dislocations (screw and edge) and how they move to give plastic flow	
10. <b>Strengthening Methods and Plasticity of Polycrystals</b>	104
solid solution hardening; precipitate and dispersion strengthening; work-hardening; yield in polycrystals	
11. <b>Continuum Aspects of Plastic Flow</b>	111
the shear yield strength; plastic instability; the formability of metals and polymers	
12. <b>Case Studies in Yield-limited Design</b>	119
materials for springs; a pressure vessel of minimum weight; a pressure vessel of minimum cost; how metals are rolled into sheet	
<b>D. Fast fracture, toughness and fatigue</b>	
13. <b>Fast Fracture and Toughness</b>	131
where the energy comes from for catastrophic crack growth; the condition for fast fracture; data for toughness and fracture toughness	
14. <b>Micromechanisms of Fast Fracture</b>	140
ductile tearing, cleavage; composites, alloys – and why structures are more likely to fail in the winter	
15. <b>Fatigue Failure</b>	146
fatigue testing, Basquin’s Law, Coffin–Manson Law; crack growth rates for pre-cracked materials; mechanisms of fatigue	
16. <b>Case Studies in Fast Fracture and Fatigue Failure</b>	155
fast fracture of an ammonia tank; how to stop a pressure vessel blowing up; is cracked cast iron safe?	
<b>E. Creep deformation and fracture</b>	
17. <b>Creep and Creep Fracture</b>	169
high-temperature behaviour of materials; creep testing and creep curves; consequences of creep; creep damage and creep fracture	

<b>18. Kinetic Theory of Diffusion</b>	179
Arrhenius's Law; Fick's first law derived from statistical mechanics of thermally activated atoms; how diffusion takes place in solids	
<b>19. Mechanisms of Creep, and Creep-resistant Materials</b>	187
metals and ceramics – dislocation creep, diffusion creep; creep in polymers; designing creep-resistant materials	
<b>20. The Turbine Blade – A Case Study in Creep-limited Design</b>	197
requirements of a turbine-blade material; nickel-based super-alloys, blade cooling; a new generation of materials? – metal-matrix composites, ceramics, cost effectiveness	
 <b>F. Oxidation and corrosion</b>	
<b>21. Oxidation of Materials</b>	211
the driving force for oxidation; rates of oxidation, mechanisms of oxidation; data	
<b>22. Case Studies in Dry Oxidation</b>	219
making stainless alloys; protecting turbine blades	
<b>23. Wet Corrosion of Materials</b>	225
voltages as driving forces; rates of corrosion; why selective attack is especially dangerous	
<b>24. Case Studies in Wet Corrosion</b>	232
how to protect an underground pipeline; materials for a light-weight factory roof; how to make motor-car exhausts last longer	
 <b>G. Friction, abrasion and wear</b>	
<b>25. Friction and Wear</b>	241
surfaces in contact; how the laws of friction are explained by the asperity-contact model; coefficients of friction; lubrication; the adhesive and abrasive wear of materials	
<b>26. Case Studies in Friction and Wear</b>	250
the design of a journal bearing; materials for skis and sledge runners; 'non-skid' tyres	

Final case study

27. <b>Materials and Energy in Car Design</b>	261
the selection and economics of materials for automobiles	
Appendix 1 <b>Examples</b>	273
Appendix 2 <b>Aids and Demonstrations</b>	290
Appendix 3 <b>Symbols and Formulae</b>	297
Index	303

# General introduction

---

## *To the student*

Innovation in engineering often means the clever use of a new material – new to a particular application, but not necessarily (although sometimes) new in the sense of ‘recently developed’. Plastic paper clips and ceramic turbine-blades both represent attempts to do better with polymers and ceramics what had previously been done well with metals. And engineering disasters are frequently caused by the misuse of materials. When the plastic tea-spoon buckles as you stir your tea, and when a fleet of aircraft is grounded because cracks have appeared in the tailplane, it is because the engineer who designed them used the wrong materials or did not understand the properties of those used. So it is vital that the professional engineer should know how to select materials which best fit the demands of the design – economic and aesthetic demands, as well as demands of strength and durability. The designer must understand the properties of materials, and their limitations.

This book gives a broad introduction to these properties and limitations. It cannot make you a materials expert, but it can teach you how to make a sensible choice of material, how to avoid the mistakes that have led to embarrassment or tragedy in the past, and where to turn for further, more detailed, help.

You will notice from the Contents list that the chapters are arranged in *groups*, each group describing a particular class of properties: the elastic modulus; the fracture toughness; resistance to corrosion; and so forth. Each such group of chapters starts by *defining the property*, describing how it is *measured*, and giving a table of *data* that we use to solve problems involving the selection and use of materials. We then move on to the *basic science* that underlies each property, and show how we can use this fundamental knowledge to design materials with better properties. Each group ends with a chapter of *case studies* in which the basic understanding and the data for each property are applied to practical engineering problems involving materials. Each chapter has a list of books for *further reading*, ranked so that the more elementary come first.

At the end of the book you will find sets of examples; each example is meant to consolidate or develop a particular point covered in the text. Try to do the examples that derive from a particular chapter while this is still fresh in your mind. In this way you will gain confidence that you are on top of the subject.

No engineer attempts to learn or remember tables or lists of data for material properties. But you *should* try to remember the broad orders-of-magnitude of these quantities. All grocers know that ‘a kg of apples is about 10 apples’ – they still weigh them, but their knowledge prevents them making silly mistakes which might cost them money. In the same way, an engineer should know that ‘most elastic moduli lie between 1 and  $10^3 \text{ GN m}^{-2}$ ; and are around  $10^2 \text{ GN m}^{-2}$  for metals’ – in any real design you need an accurate value, which you can get from suppliers’ specifications; but an order-of-

magnitude knowledge prevents you getting the units wrong, or making other silly, and possibly expensive, mistakes. To help you in this, we have added at the end of the book a list of the important definitions and formulae that you should know, or should be able to derive, and a summary of the orders-of-magnitude of materials properties.

### *To the lecturer*

This book is a course in Engineering Materials for engineering students with no previous background in the subject. It is designed to link up with the teaching of Design, Mechanics and Structures, and to meet the needs of engineering students in the 1990s for a first materials course, emphasising applications.

The text is deliberately concise. Each chapter is designed to cover the content of one 50-minute lecture, twenty-seven in all, and allows time for demonstrations and illustrative slides. A list of the slides, and a description of the demonstrations that we have found appropriate to each lecture, are given in Appendix 2. The text contains sets of worked case studies (Chapters 7, 12, 16, 20, 22, 24, 26 and 27) which apply the material of the preceding block of lectures. There are examples for the student at the end of the book; worked solutions are available separately from the publisher.

We have made every effort to keep the mathematical analysis as simple as possible while still retaining the essential physical understanding, and still arriving at results which, although approximate, are useful. But we have avoided mere description: most of the case studies and examples involve analysis, and the use of data, to arrive at numerical solutions to real or postulated problems. This level of analysis, and these data, are of the type that would be used in a preliminary study for the selection of a material or the analysis of a design (or design-failure). It is worth emphasising to students that the next step would be a detailed analysis, using *more precise mechanics* (from the texts given as 'further reading') and *data from the supplier of the material or from in-house testing*. Materials data are notoriously variable. Approximate tabulations like those given here, though useful, should never be used for final designs.

# Chapter 1

## Engineering materials and their properties

---

### Introduction

There are, it is said, more than 50,000 materials available to the engineer. In designing a structure or device, how is the engineer to choose from this vast menu the material which best suits the purpose? Mistakes can cause disasters. During World War II, one class of welded merchant ship suffered heavy losses, not by enemy attack, but by breaking in half at sea: the *fracture toughness* of the steel – and, particularly, of the welds was too low. More recently, three Comet aircraft were lost before it was realised that the design called for a *fatigue strength* that – given the design of the window frames – was greater than that possessed by the material. You yourself will be familiar with poorly-designed appliances made of plastic: their excessive ‘give’ is because the designer did not allow for the low *modulus* of the polymer. These bulk properties are listed in Table 1.1, along with other common classes of property that the designer must consider when choosing a material. Many of these properties will be unfamiliar to you – we will introduce them through examples in this chapter. They form the basis of this first course on materials.

In this first course, we shall also encounter the *classes of materials* shown in Table 1.2. More engineering components are made of *metals and alloys* than of any other class of solid. But increasingly, *polymers* are replacing metals because they offer a combination of properties which are more attractive to the designer. And if you’ve been reading the newspaper, you will know that the new *ceramics*, at present under development world wide, are an emerging class of engineering material which may permit more efficient heat engines, sharper knives, and bearings with lower friction. The engineer can combine the best properties of these materials to make *composites* (the most familiar is fibreglass) which offer specially attractive packages of properties. And – finally – one should not ignore *natural materials* like wood and leather which have properties which – even with the innovations of today’s materials scientists – are hard to beat.

In this chapter we illustrate, using a variety of examples, how the designer selects materials so that they provide him or her with the properties needed. As a first example, consider the selection of materials for a

### Plastic-handled screwdriver

A typical screwdriver has a shaft and blade made of a high-carbon steel, a metal. Steel is chosen because its *modulus* is high. The modulus measures the resistance of the material to elastic deflection or bending. If you made the shaft out of a polymer like polyethylene instead, it would twist far too much. A high modulus is one criterion in

**Table 1.1** Classes of property

Economic	Price and availability Recyclability
General Physical	Density
Mechanical	Modulus Yield and tensile strength Hardness Fracture toughness Fatigue strength Creep strength Damping
Thermal	Thermal conductivity Specific heat Thermal expansion coefficient
Electrical and Magnetic	Resistivity Dielectric constant Magnetic permeability
Environmental Interaction	Oxidation Corrosion Wear
Production	Ease of manufacture Joining Finishing
Aesthetic	Colour Texture Feel

the selection of a material for this application. But it is not the only one. The shaft must have a high *yield strength*. If it does not, it will bend or twist if you turn it hard (bad screwdrivers do). And the blade must have a high *hardness*, otherwise it will be damaged by the head of the screw. Finally, the material of the shaft and blade must not only do all these things, it must also resist fracture – glass, for instance, has a high modulus, yield strength and hardness, but it would not be a good choice for this application because it is so brittle. More precisely, it has a very low *fracture toughness*. That of the steel is high, meaning that it gives a bit before it breaks.

The handle of the screwdriver is made of a polymer or plastic, in this instance polymethylmethacrylate, otherwise known as PMMA, plexiglass or perspex. The handle has a much larger section than the shaft, so its twisting, and thus its modulus, is less important. You could not make it satisfactorily out of a soft rubber (another polymer) because its modulus is much too low, although a thin skin of rubber might be useful because its *friction coefficient* is high, making it easy to grip. Traditionally, of course, tool handles were made of another natural, polymer – wood – and, if you measure importance by the volume consumed per year, wood is still by far the most important polymer available to the engineer. Wood has been replaced by PMMA

because PMMA becomes soft when hot and can be moulded quickly and easily to its final shape. Its *ease of fabrication* for this application is high. It is also chosen for aesthetic reasons: its *appearance*, and feel or *texture*, are right; and its *density* is low, so that the screwdriver is not unnecessarily heavy. Finally, PMMA is cheap, and this allows the product to be made at a reasonable *price*.

Now a second example, taking us from low technology to the advanced materials design involved in the turbofan aero-engines which power large planes. Air is propelled

**Table 1.2** Classes of materials

---

<i>Metals and alloys</i>
Iron and steels
Aluminium and its alloys
Copper and its alloys
Nickel and its alloys
Titanium and its alloys
<i>Polymers</i>
Polyethylene (PE)
Polymethylmethacrylate (Acrylic and PMMA)
Nylon, alias Polyamide (PA)
Polystyrene (PS)
Polyurethane (PU)
Polyvinylchloride (PVC)
Polyethylene tetrathalate (PET)
Polyethylether Ketone (PEEK)
Epoxies (EP)
Elastomers, such as natural rubber (NR)
<i>Ceramics and glasses*</i>
Alumina ( $Al_2O_3$ , emery, sapphire)
Magnesia (MgO)
Silica ( $SiO_2$ ) glasses and silicates
Silicon carbide (SiC)
Silicon nitride ( $Si_3N_4$ )
Cement and concrete
<i>Composites</i>
Fibreglass (GFRP)
Carbon-fibre reinforced polymers (CFRP)
Filled polymers
Cermets
<i>Natural materials</i>
Wood
Leather
Cotton/wool/silk
Bone

---

\*Ceramics are crystalline, inorganic, non-metals. Glasses are non-crystalline (or *amorphous*) solids. Most engineering glasses are non-metals, but a range of *metallic glasses* with useful properties is now available.

past (and into) the engine by the turbofan, providing aerodynamic thrust. The air is further compressed by the compressor blades, and is then mixed with fuel and burnt in the combustion chamber. The expanding gases drive the turbine blades, which provide power to the turbofan and the compressor blades, and finally pass out of the rear of the engine, adding to the thrust.

The *turbofan blades* are made from a titanium alloy, a metal. This has a sufficiently good modulus, yield strength, and fracture toughness. But the metal must also resist *fatigue* (due to rapidly fluctuating loads), *surface wear* (from striking everything from water droplets to large birds) and *corrosion* (important when taking off over the sea because salt spray enters the engine). Finally, *density* is extremely important for obvious reasons: the heavier the engine, the less the pay-load the plane can carry. In an effort to reduce weight even further, composite blades made of carbon-fibre reinforced polymers – CFRP – with density less than one-half of that of titanium, have been tried. But CFRP, by itself is simply not tough enough for turbofan blades – a ‘bird strike’ demolishes a CFRP blade. The problem can be overcome by *cladding*, giving the CFRP a metallic leading edge.

Turning to the *turbine blades* (those in the hottest part of the engine) even more material requirements must be satisfied. For economy the fuel must be burnt at as high a temperature as possible. The first row of engine blades (the ‘HP1’ blades) runs at metal temperatures of about 950°C, requiring resistance to *creep* and to *oxidation*. Nickel-based alloys of complicated chemistry and structure are used for this exceedingly stringent application; they are one pinnacle of advanced materials technology.

An example which brings in somewhat different requirements is the *spark plug* of an internal combustion engine. The *spark electrodes* must resist *thermal fatigue* (from rapidly fluctuating temperatures), *wear* (caused by spark erosion) and *oxidation and corrosion* from hot upper-cylinder gases containing nasty compounds of sulphur, and lead (from anti-knock additives). Tungsten alloys are used for the electrodes because they have the desired properties.

The *insulation* around the central electrode is an example of a non-metallic material – in this case, alumina, a ceramic. This is chosen because of its electrical insulating properties and because it also has good thermal fatigue resistance and resistance to corrosion and oxidation (it is an oxide already).

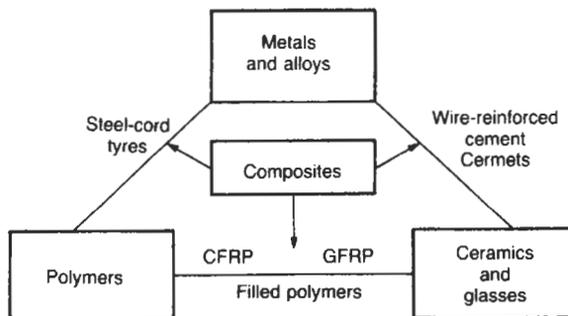


Fig. 1.1. The classes of engineering materials from which articles are made.

The use of non-metallic materials has grown most rapidly in the consumer industry. Our next example, a sailing cruiser, shows just how extensively polymers and man-made composites and fibres have replaced the 'traditional' materials of steel, wood and cotton. A typical cruiser has a *hull* made from GFRP, manufactured as a single moulding; GFRP has good *appearance* and, unlike steel or wood, does not rust or become eaten away by Terido worm. The *mast* is made from aluminium alloy, which is lighter for a given strength than wood; advanced masts are now being made by reinforcing the alloy with carbon or boron fibres (man-made composites). The sails, formerly of the natural material cotton, are now made from the polymers nylon, Terylene or Kevlar, and, in the running rigging, cotton ropes have been replaced by polymers also. Finally, polymers like PVC are extensively used for things like fenders, anoraks, bouyancy bags and boat covers.

Three man-made composite materials have appeared in the items we have considered so far: glass-fibre reinforced polymers (GFRP); the much more expensive carbon-fibre reinforced polymers (CFRP); and the still *more* expensive boron-fibre reinforced alloys (BFRP). The range of composites is a large and growing one (Fig. 1.1); during the next decade composites will, increasingly, compete with steel and aluminium in many traditional uses of these metals.

So far we have introduced the mechanical and physical properties of engineering materials, but we have yet to discuss a consideration which is often of overriding importance: that of *price and availability*.

Table 1.3 shows a rough breakdown of material prices. Materials for large-scale structural use – wood, cement and concrete, and structural steel – cost between UK£50 and UK£500 (US\$75 and US\$750) per tonne. There are many materials which have all the other properties required of a structural material – nickel or titanium, for example – but their use in this application is eliminated by their price.


The value that is added during light- and medium-engineering work is larger, and this usually means that the economic constraint on the choice of materials is less severe – a far greater proportion of the cost of the structure is that associated with labour or with production and fabrication. Stainless steels, most aluminium alloys and most polymers cost between UK£500 and UK£5000 (US\$750 and US\$7500) per

**Table 1.3**

<i>Class of use</i>	<i>Material</i>	<i>Price per tonne</i>	
Basic construction	Wood, concrete, structural steel	UK£50–500	US\$75–750
Medium and light engineering	Metals, alloys and polymers for aircraft, automobiles, appliances, etc.	UK£500–5,000	US\$750–7,500
Special materials	Turbine-blade alloys, advanced composites (CFRP, BRFP), etc.	UK£5,000–50,000	US\$7,500–75,000
Precious metals, etc.	Sapphire bearings, silver contacts, gold microcircuits	UK£50,000–10m	US\$75,000–15m
Industrial diamond	Cutting and polishing tools	>UK£10m	>US\$15m



**Fig. 1.2.** The wooden bridge at Queens' College, a 1902 reconstruction of the original 'mathematical' bridge built in 1749 to William Etheridge's design.

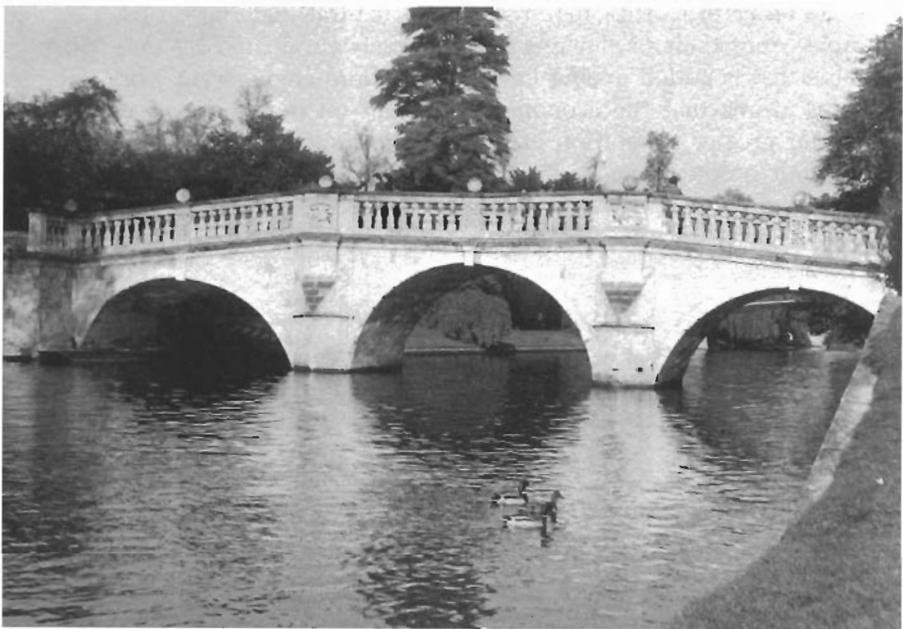

**Fig. 1.3.** Clare Bridge, built in 1640, is Cambridge's oldest surviving bridge; it is reputed to have been an escape-route from the college in times of plague.




**Fig. 1.4.** Magdalene Bridge built in 1823 on the site of the ancient Saxon bridge over the Cam. The present cast-iron arches carried, until recently, loads far in excess of those envisaged by the designers. Fortunately, the bridge has now undergone a well-earned restoration.



**Fig. 1.5.** A typical twentieth-century mild-steel bridge; a convenient crossing to the Fort St George inn!



**Fig. 1.6.** The reinforced concrete footbridge in Garret Hostel Lane. An inscription carved nearby reads: 'This bridge was given in 1960 by the Trusted family members of Trinity Hall. It was designed by Timothy Guy MORGAN an undergraduate of Jesus College who died in that year.'

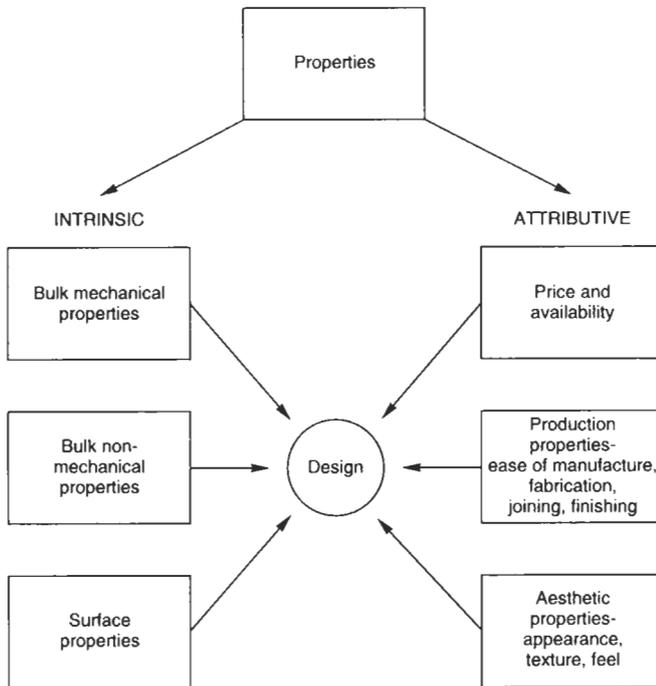

**Fig. 1.7.** How the properties of engineering materials affect the way in which products are designed.

tonne. It is in this sector of the market that the competition between materials is most intense, and the greatest scope for imaginative design exists. Here polymers and composites compete directly with metals, and new structural ceramics (silicon carbide and silicon nitride) may compete with both in certain applications.

Next there are the materials developed for high-performance applications, some of which we have mentioned already: nickel alloys (for turbine blades), tungsten (for sparking-plug electrodes) and special composite materials such as CFRP. The price of these materials ranges between UK£5000 and UK£50,000 (US\$7500 and US\$75,000) per tonne. This the régime of high materials technology, actively under research, and in which major new advances are continuing to be made. Here, too, there is intense competition from new materials.

Finally, there are the so-called precious metals and gemstones, widely used in engineering: gold for microcircuits, platinum for catalysts, sapphire for bearings, diamond for cutting tools. They range in price from UK£50,000 (US\$75,000) to well over UK£100m (US\$150m) per tonne.

As an example of how price and availability affect the choice of material for a particular job, consider how the materials used for building bridges in Cambridge have changed over the centuries. As our photograph of Queens' Bridge (Fig. 1.2) suggests, until 150 years or so ago wood was commonly used for bridge building. It was cheap, and high-quality timber was still available in large sections from natural forests. Stone, too, as the picture of Clare Bridge (Fig. 1.3) shows, was widely used. In the eighteenth century the ready availability of cast-iron, with its relatively low assembly costs, led to many cast-iron bridges of the type exemplified by Magdalene Bridge (Fig. 1.4). Metallurgical developments of the later nineteenth century allowed large mild-steel structures to be built (the Fort St. George Footbridge, Fig. 1.5). Finally, the advent of cheap reinforced concrete led to graceful and durable structures like that of the Garret Hostel Lane bridge (Fig. 1.6). This evolution clearly illustrates how availability influences the choice of materials. Nowadays, wood, steel and reinforced concrete are often used interchangeably in structures, reflecting the relatively small *price* differences between them. The choice of which of the three materials to use is mainly dictated by the kind of structure the architect wishes to build: chunky and solid (stone), structurally efficient (steel), slender and graceful (pre-stressed concrete).

Engineering design, then, involves many considerations (Fig. 1.7). The choice of a material must meet certain criteria on bulk and surface properties (strength and corrosion resistance, for example). But it must also be easy to fabricate; it must appeal to potential consumers; and it must compete economically with other alternative materials. In the next chapter we consider the economic aspects of this choice, returning in later chapters to a discussion of the other properties.

## Further reading

- J. E. Gordon, *The New Science of Strong Materials, or Why You Don't Fall Through the Floor*, Penguin Books, London, 1976, (an excellent general introduction to materials).
- K. E. Easterling, *Tomorrow's Materials*, Institute of Materials, London, 1987, (an entertaining introduction focussing on the use of high-tech. materials in aerospace, electronics and sporting goods).



## **A. Price and availability**

---



# Chapter 2

## The price and availability of materials

---

### Introduction

In the first chapter we introduced the range of properties required of engineering materials by the design engineer, and the range of materials available to provide these properties. We ended by showing that the *price* and *availability* of materials were important and often overriding factors in selecting the materials for a particular job. In this chapter we examine these economic properties of materials in more detail.

### Data for material prices

Table 2.1 ranks materials by their cost per unit weight: UK£ per tonne (i.e. 1000 kg) in the second column, US\$ per tonne in the third. The most expensive materials – diamond, platinum, gold – are at the top. The cheapest – cast iron, wood, cement – are at the bottom. Such data are obviously important in choosing a material. How do we keep informed about materials prices change and what controls them?

*The Financial Times* and the *Wall Street Journal* give some, on a daily basis. Trade supply journals give more extensive lists of current prices. A typical such journal is *Procurement Weekly*, listing current prices of basic materials, together with prices 6 months and a year ago. All manufacturing industries take this or something equivalent – the workshop in your engineering department will have it – and it gives a guide to prices and their trends. Figure 2.1 shows the variation in price of two materials – copper and rubber – between September 1993 and May 1994. It illustrates two points. First, there is a long-term upward movement in material prices. Thirty years ago, copper was UK£200 (US\$300) per tonne and rubber was UK£60 (US\$90) per tonne; now they are more than five times this price.

Second, there are considerable short-term fluctuations in material prices. Copper dropped 15% in the month of September 1993; gold, in the same period, rose 38%. Aluminium changed in price by nearly 10% in a single day in December 1993. These are large changes, important to the purchaser of materials.

The short-term price fluctuations have little to do with the real scarcity or abundance of materials. They are caused by small differences between the rate of supply and demand, much magnified by speculation in commodity futures. The volatile nature of the commodity market can result in large changes over a period of a few days – that is one reason speculators are attracted to it – and there is very little that an engineer can do to foresee or insure against these changes. Political factors are also extremely important – a scarcity of cobalt in 1978 was due to the guerilla attacks on mineworkers in Zaire, the world's principal producer of cobalt; the low price of aluminium and of

**Table 2.1** Price per tonne (May 1994)

<i>Material</i>	<i>UK£/tonne</i>	<i>US\$/tonne</i>
Diamonds, industrial	$4-6 \times 10^8$	$6-9 \times 10^8$
Platinum	$1.2-1.5 \times 10^7$	$1.8-2.25 \times 10^7$
Gold	$5.0-5.6 \times 10^6$	$7.5-8.4 \times 10^6$
Silver	$3.0-4.5 \times 10^5$	$4.5-6.75 \times 10^5$
CFRP (mats. 70% of cost; fabr. 30% of cost)	$3.5-8 \times 10^4$	$5.25-12 \times 10^4$
Cobalt/tungsten carbide cermets	$3.7-5.0 \times 10^4$	$5.55-7.5 \times 10^4$
Tungsten	$1.3-1.5 \times 10^4$	$1.95-2.25 \times 10^4$
Cobalt alloys	$1.6-2.4 \times 10^4$	$2.4-3.6 \times 10^4$
Titanium alloys	$3.2-4.0 \times 10^4$	$4.8-6.0 \times 10^4$
Nickel alloys	$5.1-6.0 \times 10^4$	$7.6-9.0 \times 10^4$
Polyimides	$2.2-2.5 \times 10^4$	$3.3-3.75 \times 10^4$
Silicon carbide (fine ceramic)	$1.5-2.5 \times 10^4$	$2.25-3.75 \times 10^4$
Magnesium alloys	2200-3300	3300-4950
Nylon 66	2500-5400	3750-8100
Polycarbonate	2750-3200	4125-4800
PMMA	1800-2500	2700-3750
Magnesia, MgO (fine ceramic)	5000-15000	7500-22500
Alumina, Al <sub>2</sub> O <sub>3</sub> (fine ceramic)	8000-12000	12000-18000
Tool steel	1200-2000	1800-3000
GFRP (mats. 60% of cost; fabr. 40% of cost)	1300-3000	1950-4500
Stainless steels	1800-2300	2700-3450
Copper, worked (sheets, tubes, bars)	1200-1250	1800-1875
Copper, ingots	1150-1200	1725-1800
Aluminium alloys, worked (sheet, bars)	910-1200	1365-1800
Aluminium ingots	910-930	1365-1395
Brass, worked (sheet, tubes, bars)	1200-1400	1800-2100
Brass, ingots	1100-1400	1650-2100
Epoxy	2500-3200	3750-4800
Polyester	1200-1800	1800-2700
Glass	680-1200	1020-1800
Foamed polymers	1100-3000	1650-4500
Zinc, worked (sheet, tubes, bars)	1000-1300	1500-1950
Zinc, ingots	1000-1100	1500-1650
Lead, worked (bars, sheet, tube)	550-800	825-1200
Lead, ingots	500-550	750-825
Natural rubber	450-1500	675-2250
Polypropylene	500-700	750-1050
Polyethylene, high density	550-600	825-900
Polystyrene	600-800	900-1200
Hard woods	400-1000	600-1500
Polyethylene, low density	600-650	900-975
Polyvinyl chloride	450-1200	675-1800
Plywood	300-1000	450-1500
Low-alloy steels	320-450	480-675
Mild steel, worked (angles, sheet, bars)	250-350	375-525
Cast iron	200-350	300-525
Iron, ingots	180-200	270-300
Soft woods	100-300	150-450
Concrete, reinforced (beams, columns, slabs)	128-180	192-270
Fuel oil	100-140	150-210
Cement	50-60	75-90
Coal	50-58	75-87

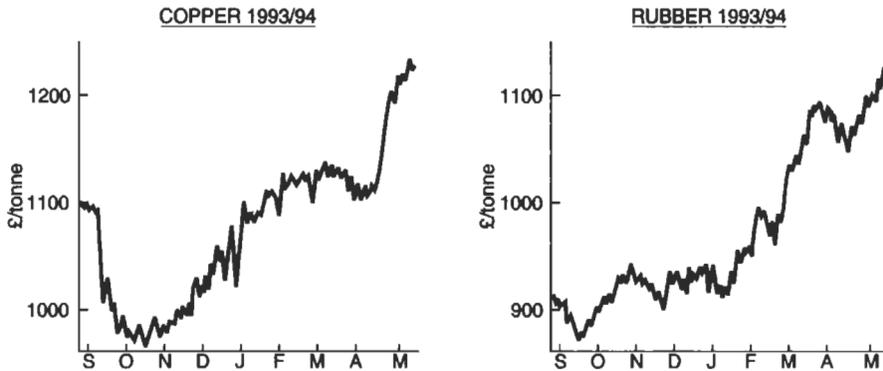


Fig. 2.1. The fluctuations in price of copper and of rubber between September 1993 and May 1994.

diamonds today is partly caused by a flood of both from Russia since the end of the Cold War.

The long-term changes are of a different kind. They reflect, in part, the real cost (in capital investment, labour and energy) of extracting and transporting the ore or feedstock and processing it to give the engineering material. Inflation and increased energy costs obviously drive the price up; so, too, does the necessity to extract materials, like copper, from increasingly lean ores; the leaner the ore, the more machinery and energy are required to crush the rock containing it, and to concentrate it to the level that the metal can be extracted.

In the long term, then, it is important to know which materials are basically plentiful, and which are likely to become scarce. It is also important to know the extent of our dependence on materials.

## The use-pattern of materials

The way in which materials are used in a developed nation is fairly standard. All consume steel, concrete and wood in construction; steel and aluminium in general engineering; copper in electrical conductors; polymers in appliances, and so forth; and roughly in the same proportions. Among metals, steel is used in the greatest quantities by far: 90% of all the metal produced in the world is steel. But the non-metals wood and concrete beat steel – they are used in even greater volume.

About 20% of the total import bill of a country like Britain is spent on engineering materials. Table 2.2 shows how this spend is distributed. Iron and steel, and the raw materials used to make them, account for about a quarter of it. Next are wood and lumber – still widely used in light construction. More than a quarter is spent on the metals copper, silver, aluminium and nickel. All polymers taken together, including rubber, account for little more than 10%. If we include the further metals zinc, lead, tin, tungsten and mercury, the list accounts for 99% of all the money spent abroad on materials, and we can safely ignore the contribution of materials which do not appear on it.

**Table 2.2** UK imports of engineering materials, raw and semis: Percentage of total cost

Iron and steel	27
Wood and lumber	21
Copper	13
Plastics	9.7
Silver and platinum	6.5
Aluminium	5.4
Rubber	5.1
Nickel	2.7
Zinc	2.4
Lead	2.2
Tin	1.6
Pulp/paper	1.1
Glass	0.8
Tungsten	0.3
Mercury	0.2
Etc.	1.0

## Ubiquitous materials

### The composition of the earth's crust

Let us now shift attention from what we *use* to what is widely *available*. A few engineering materials are synthesised from compounds found in the earth's oceans and atmosphere: magnesium is an example. Most, however, are won by mining their ore from the earth's crust, and concentrating it sufficiently to allow the material to be extracted or synthesised from it. How plentiful and widespread are these materials on which we depend so heavily? How much copper, silver, tungsten, tin and mercury in useful concentrations does the crust contain? All five are rare: workable deposits of them are relatively small, and are so highly localised that many governments classify them as of strategic importance, and stockpile them.

Not all materials are so thinly spread. Table 2.3 shows the relative abundance of the commoner elements in the earth's crust. The crust is 47% oxygen by weight or – because oxygen is a big atom, it occupies 96% of the volume (geologists are fond of saying that the earth's crust is solid oxygen containing a few per cent of impurities). Next in abundance are the elements silicon and aluminium; by far the most plentiful solid materials available to us are silicates and alumino-silicates. A few metals appear on the list, among them iron and aluminium both of which feature also in the list of widely-used materials. The list extends as far as carbon because it is the backbone of virtually all polymers, including wood. Overall, then, oxygen and its compounds are overwhelmingly plentiful – on every hand we are surrounded by oxide-ceramics, or the raw materials to make them. Some materials are widespread, notably iron and aluminium; but even for these the local concentration is frequently small, usually too small to make it economic to extract them. In fact, the raw materials for making polymers are more readily available at present than those for most metals. There are

**Table 2.3** Abundance of elements/weight percent

Crust		Oceans		Atmosphere	
Oxygen	47	Oxygen	85	Nitrogen	79
Silicon	27	Hydrogen	10	Oxygen	19
Aluminium	8	Chlorine	2	Argon	2
Iron	5	Sodium	1	Carbon dioxide	0.04
Calcium	4	Magnesium	0.1		
Sodium	3	Sulphur	0.1		
Potassium	3	Calcium	0.04		
Magnesium	2	Potassium	0.04		
Titanium	0.4	Bromine	0.007		
Hydrogen	0.1	Carbon	0.002		
Phosphorus	0.1				
Manganese	0.1				
Fluorine	0.06				
Barium	0.04				
Strontium	0.04				
Sulphur	0.03				
Carbon	0.02				

\* The total mass of the crust to a depth of 1 km is  $3 \times 10^{21}$  kg; the mass of the oceans is  $10^{20}$  kg; that of the atmosphere is  $5 \times 10^{18}$  kg.

huge deposits of carbon in the earth: on a world scale, we extract a greater tonnage of carbon every month than we extract iron in a year, but at present we simply burn it. And the second ingredient of most polymers – hydrogen – is also one of the most plentiful of elements. Some materials – iron, aluminium, silicon, the elements to make glass and cement – are plentiful and widely available. But others – mercury, silver, tungsten are examples – are scarce and highly localised, and – if the current pattern of use continues – may not last very long.

## Exponential growth and consumption doubling-time

How do we calculate the life-time of a resource like mercury? Like almost all materials, mercury is being consumed at a rate which is growing exponentially with time (Fig. 2.2), simply because both population and living standards grow exponentially. We analyse this in the following way. If the current rate of consumption in tonnes per year is  $C$  then exponential growth means that

$$\frac{dC}{dt} = \frac{r}{100} C \quad (2.1)$$

where, for the generally small growth rates we deal with here (1 to 5% per year),  $r$  can be thought of as the percentage fractional rate of growth per year. Integrating gives

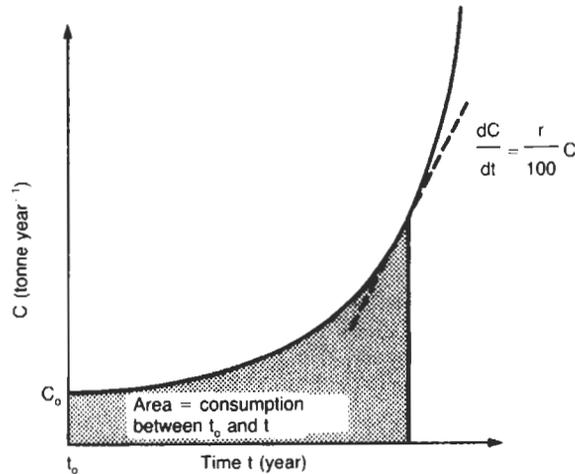


Fig. 2.2. The exponentially rising consumption of materials.

$$C = C_0 \exp \left\{ \frac{r(t - t_0)}{100} \right\} \quad (2.2)$$

where  $C_0$  is the consumption rate at time  $t = t_0$ . The *doubling-time*  $t_D$  of consumption is given by setting  $C/C_0 = 2$  to give

$$t_D = \frac{100}{r} \log_e 2 \approx \frac{70}{r}. \quad (2.3)$$

Steel consumption is growing at less than 2% per year – it doubles about every 35 years. Polymer consumption is rising at about 5% per year – it doubles every 14 years. During times of boom – the 1960s and 1970s for instance – polymer production increased much faster than this, peaking at 18% per year (it doubled every 4 years), but it has now fallen back to a more modest rate.

## Resource availability

The availability of a resource depends on the degree to which it is *localised* in one or a few countries (making it susceptible to production controls or cartel action); on the *size* of the reserves, or, more accurately, the resource base (explained shortly); and on the *energy* required to mine and process it. The influence of the last two (size of reserves and energy content) can, within limits, be studied and their influence anticipated.

The calculation of resource life involves the important distinction between *reserves* and *resources*. The current reserve is the known deposits which can be extracted profitably at today's price using today's technology; it bears little relationship to the true magnitude of the resource base; in fact, the two are not even roughly proportional.

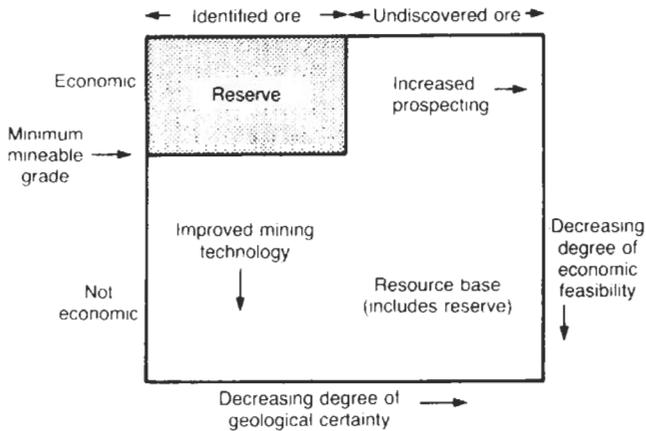


Fig. 2.3. The distinction between the reserve and the resource base, illustrated by the McElvey diagram.

The resource base includes the current reserve. But it also includes all deposits that might become available given diligent prospecting and which, by various extrapolation techniques, can be estimated. And it includes, too, all known and unknown deposits that cannot be mined profitably now, but which – due to higher prices, better technology or improved transportation – might reasonably become available in the future (Fig. 2.3). The reserve is like money in the bank – you know you have got it. The resource base is more like your total potential earnings over your lifetime – it is much larger than the reserve, but it is less certain, and you may have to work very hard to get it. The resource base is the realistic measure of the total available material. Resources are almost always much larger than reserves, but because the geophysical data and economic projections are poor, their evaluation is subject to vast uncertainty.

Although the resource base is uncertain, it obviously is important to have some estimate of how long it can last. Rough estimates do exist for the size of the resource base, and, using these, our exponential formula gives an estimate of how long it would take us to use up *half* of the resources. The half-life is an important measure: at this stage prices would begin to rise so steeply that supply would become a severe problem. For a number of important materials these half-lives lie within your life-time: for silver, tin, tungsten, zinc, lead, mercury and oil (the feedstock of polymers) they lie between 40 and 70 years. Others (most notably iron, aluminium, and the raw materials from which most ceramics and glasses are made) have enormous resource bases, adequate for hundreds of years, even allowing for continued exponential growth.

The cost of energy enters here. The extraction of materials requires energy (Table 2.4). As a material becomes scarcer – copper is a good example – it must be extracted from leaner and leaner ores. This expends more and more energy, per tonne of copper *metal* produced, in the operations of mining, crushing and concentrating the ore; and these energy costs rapidly become prohibitive. The rising energy content of copper shown in Table 2.4 reflects the fact that the richer copper ores are, right now, being worked out.

**Table 2.4** Approximate energy content of materials GJ tonne<sup>-1</sup>

Aluminium	280
Plastics	85–180
Copper	140, rising to 300
Zinc	68
Steel	55
Glass	20
Cement	7
Brick	4
Timber	2.5–7
Gravel	0.2
Oil	44
Coal	29

\*Energy costs roughly UK£3 (US\$4.5) per GJ in 1994.

## The future

How are we going to cope with the shortages of engineering materials in the future? One way obviously is by

### Material-efficient design

Many current designs use far more material than is necessary, or use potentially scarce materials where the more plentiful would serve. Often, for example, it is a surface property (e.g. low friction, or high corrosion resistance) which is wanted; then a thin surface film of the rare material bonded to a cheap plentiful substrate can replace the bulk use of a scarcer material. Another way of coping with shortages is by

### Substitution

It is the property, not the material itself, that the designer wants. Sometimes a more readily available material can replace the scarce one, although this usually involves considerable outlay (new processing methods, new joining methods, etc.). Examples of substitution are the replacement of stone and wood by steel and concrete in construction; the replacement of copper by polyethylene in plumbing; the change from wood and metals to polymers in household goods; and from copper to aluminium in electrical wiring.

There are, however, technical limitations to substitution. Some materials are used in ways not easily filled by others. Platinum as a catalyst, liquid helium as a refrigerant, and silver on electrical contact areas cannot be replaced; they perform a unique function – they are, so to speak, the vitamins of engineering materials. Others – a replacement for tungsten for lamp filaments, for example – would require the development of a whole new technology, and this can take many years. Finally,

substitution increases the demand for the replacement material, which may also be in limited supply. The massive trend to substitute plastics for other materials puts a heavier burden on petrochemicals, at present derived from oil. A third approach is that of

### Recycling

Recycling is not new: old building materials have been recycled for millennia; scrap metal has been recycled for decades; both are major industries. Recycling is labour intensive, and therein lies the problem in expanding its scope. Over the last 30 years, the rising cost of labour made most recycling less than economic. But if energy and capital become relatively scarcer (and thus more costly) or governments impose penalties for not reusing materials, then recycling will become much more attractive. There will be an increasing incentive to design manufactured products so that they can be taken apart more easily, identified and re-used.

### Conclusion

Overall, the materials-resource problem is not as critical as that of energy. Some materials have an enormous base or (like wood) are renewable – and fortunately these include the major structural materials. For others, the resource base is small, but they are often used in small quantities so that the price could rise a lot without having a drastic effect on the price of the product in which they are incorporated; and for some, substitutes are available. But such adjustments can take time – up to 25 years if a new technology is needed; and they need capital too. Rising energy costs, plus rising material costs as the Developing World assumes control of its own resources, mean that the relative costs of materials will change in the next 20 years, and a good designer must be aware of these changes, and continually on the look out for opportunities to substitute one material for another.

### Further reading

- P. F. Chapman and F. Roberts, *Metal Resources and Energy*, Butterworths, London, 1983.  
 A. H. Cottrell, *Environmental Economics*, Edward Arnold, 1977.  
 T. Darwent (ed.), *World Resources – Engineering Solutions*, Inst. Civil Engineers, London, 1976.  
 E. G. Kovach (ed.), *Technology of Efficient Energy Utilisation*, NATO Science Committee, Brussels, 1973.



## **B. The elastic moduli**

---



# Chapter 3

## The elastic moduli

---

### Introduction

The next material property that we shall examine is the *elastic modulus*. The modulus measures the resistance of a material to elastic (or 'springy') deformation. If rods of identical cross-section are laid on two widely spaced supports and then identical weights are hung at their centres, they bend elastically by very different amounts depending on the material of which they are made: wood or nylon deflect much more than steel or glass. Low modulus materials are floppy and deflect a lot when they are loaded. Sometimes this is desirable, of course: springs, cushions, vaulting poles – these structures are designed to deflect, and the right choice of modulus may be a low one. But in the great majority of mechanical applications, deflection is undesirable, and the engineer seeks a material with a high modulus. The modulus is reflected, too, in the natural frequency of vibration of a structure. A beam of low modulus has a lower natural frequency than one of higher modulus (although the density matters also) and this, as well as the deflection, is important in design calculations.

Before we look in detail at the modulus, we must first define stress and strain.

### Definition of stress

Imagine a block of material to which we apply a force  $F$ , as in Fig. 3.1(a). The force is transmitted through the block and is balanced by the equal, opposite force which the base exerts on the block (if this were not so, the block would move). We can replace the base by the equal and opposite force,  $F$ , which acts on all sections through the block parallel to the original surface; the whole of the block is said to be in a state of stress. The intensity of the stress,  $\sigma$ , is measured by the force  $F$  divided by the area,  $A$ , of the block face, giving

$$\sigma = \frac{F}{A}. \quad (3.1)$$

This particular stress is caused by a force pulling at right angles to the face; we call it the *tensile stress*.

Suppose now that the force acted not normal to the face but at an angle to it, as shown in Fig. 3.1(b). We can resolve the force into two components, one,  $F_t$ , normal to the face and the other,  $F_s$ , parallel to it. The normal component creates a tensile stress in the block. Its magnitude, as before, is  $F_t/A$ .

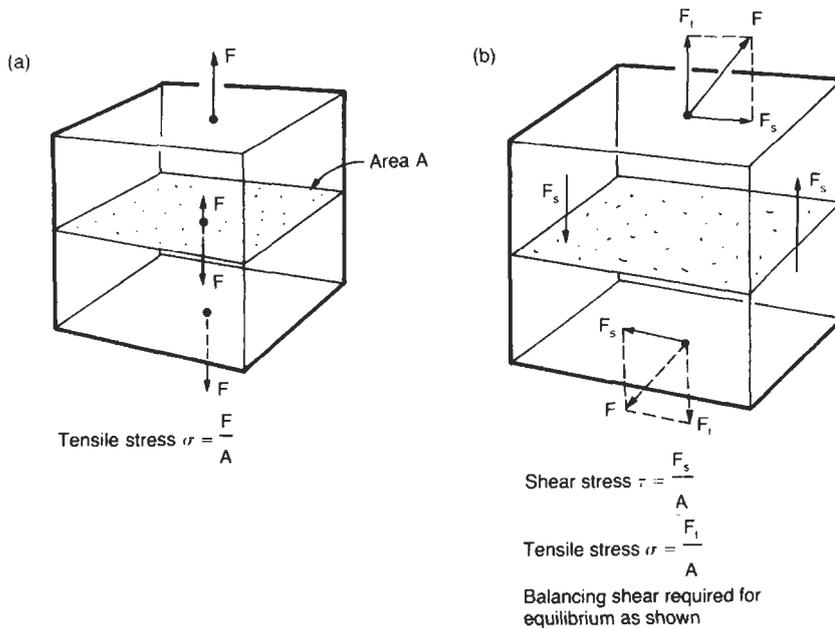



Fig. 3.1. Definitions of tensile stress  $\sigma$  and shear stress  $\tau$ .

The other component,  $F_s$ , also loads the block, but it does so in *shear*. The shear stress,  $\tau$ , in the block parallel to the direction of  $F_s$ , is given by

$$\tau = \frac{F_s}{A}. \quad (3.2)$$

The important point is that the magnitude of a stress is always equal to the magnitude of a *force* divided by the *area* of the face on which it acts. Forces are measured in newtons, so stresses are measured in units of newtons per metre squared ( $\text{N m}^{-2}$ ). For many engineering applications, this is inconveniently small, and the normal unit of stress is the mega newton per metre squared or mega( $10^6$ ) pascal ( $\text{MN m}^{-2}$  or MPa) or even the giga( $10^9$ )newtons per metre squared or gigapascal ( $\text{GN m}^{-2}$  or GPa).

There are four commonly occurring states of stress, shown in Fig. 3.2. The simplest is that of *simple tension* or *compression* (as in a tension member loaded by pin joints at its ends or in a pillar supporting a structure in compression). The stress is, of course, the force divided by the section area of the member or pillar. The second common state of stress is that of *biaxial tension*. If a spherical shell (like a balloon) contains an internal pressure, then the skin of the shell is loaded in two directions, not one, as shown in Fig. 3.2. This state of stress is called biaxial tension (unequal biaxial tension is obviously the state in which the two tensile stresses are unequal). The third common state of stress is that of *hydrostatic pressure*. This occurs deep in the earth's crust, or deep in the ocean, when a solid is subjected to equal compression on all sides. There is a convention that stresses are *positive* when they *pull*, as we have drawn them in earlier figures. Pressure,

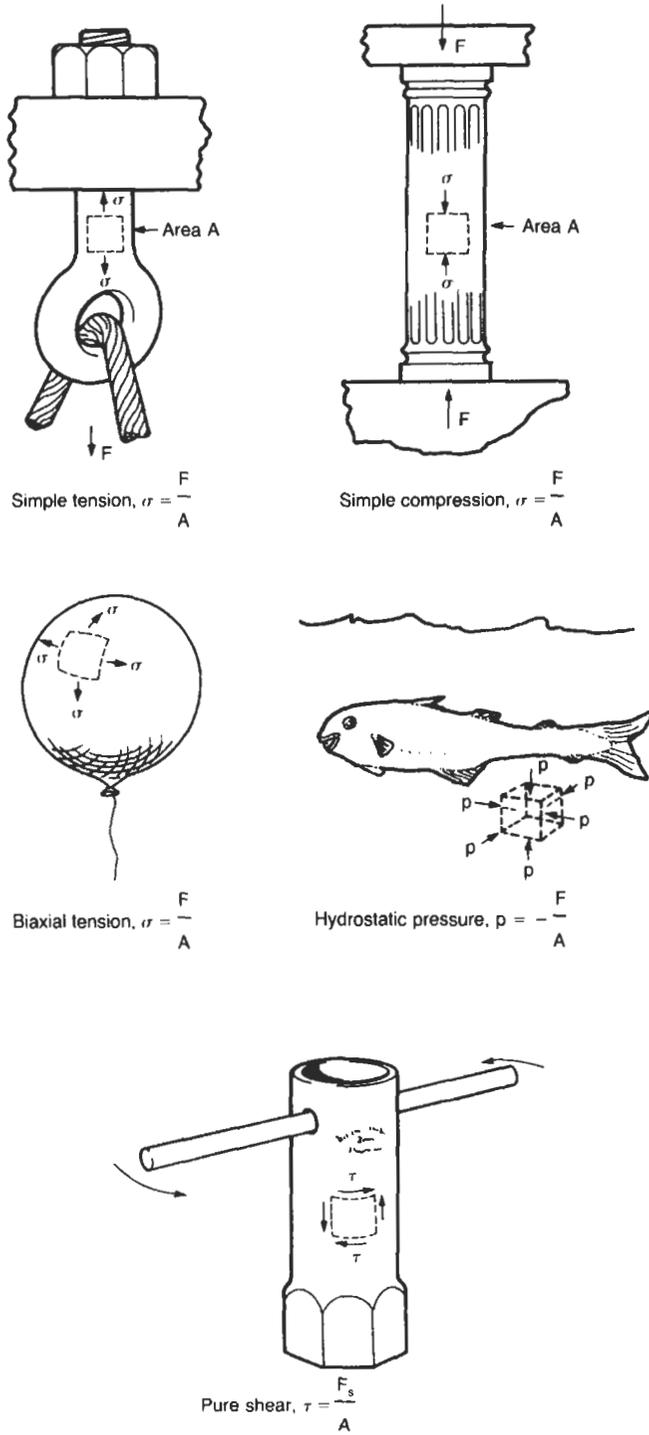

**Fig. 3.2.** Common states of stress: tension, compression, hydrostatic pressure and shear.

however, is positive when it *pushes*, so that the magnitude of the pressure differs from the magnitude of the other stresses in its sign. Otherwise it is defined in exactly the same way as before: the force divided by the area on which it acts. The final common state of stress is that of *pure shear*. If you try to twist a thin tube, then elements of it are subjected to pure shear, as shown. This shear stress is simply the shearing force divided by the area of the face on which it acts.

Remember one final thing; if you know the stress in a body, then the *force* acting across any face of it is the stress times the area.

## Strain

Materials respond to stress by *straining*. Under a given stress, a stiff material (like steel) strains only slightly; a floppy or compliant material (like polyethylene) strains much more. The modulus of the material describes this property, but before we can measure it, or even define it, we must define strain properly.

The kind of stress that we called a tensile stress induces a tensile strain. If the stressed cube of side  $l$ , shown in Fig. 3.3(a) extends by an amount  $u$  parallel to the tensile stress, the *nominal tensile strain* is

$$\epsilon_n = \frac{u}{l}. \quad (3.3)$$

When it strains in this way, the cube usually gets thinner. The amount by which it shrinks inwards is described by Poisson's ratio,  $\nu$ , which is the negative of the ratio of the inward strain to the original tensile strain:

$$\nu = - \frac{\text{lateral strain}}{\text{tensile strain}}.$$

A shear stress induces a shear strain. If a cube shears sideways by an amount  $w$  then the *shear strain* is defined by

$$\gamma = \frac{w}{l} = \tan \theta \quad (3.4)$$

where  $\theta$  is the angle of shear and  $l$  is the edge-length of the cube (Fig. 3.3(b)). Since the elastic strains are almost always very small, we may write, to a good approximation,

$$\gamma = \theta.$$

Finally, hydrostatic pressure induces a volume change called *dilatation* (Fig. 3.3(c)). If the volume change is  $\Delta V$  and the cube volume is  $V$ , we define the dilatation by

$$\Delta = \frac{\Delta V}{V}. \quad (3.5)$$

Since strains are the ratios of two lengths or of two volumes, they are dimensionless.

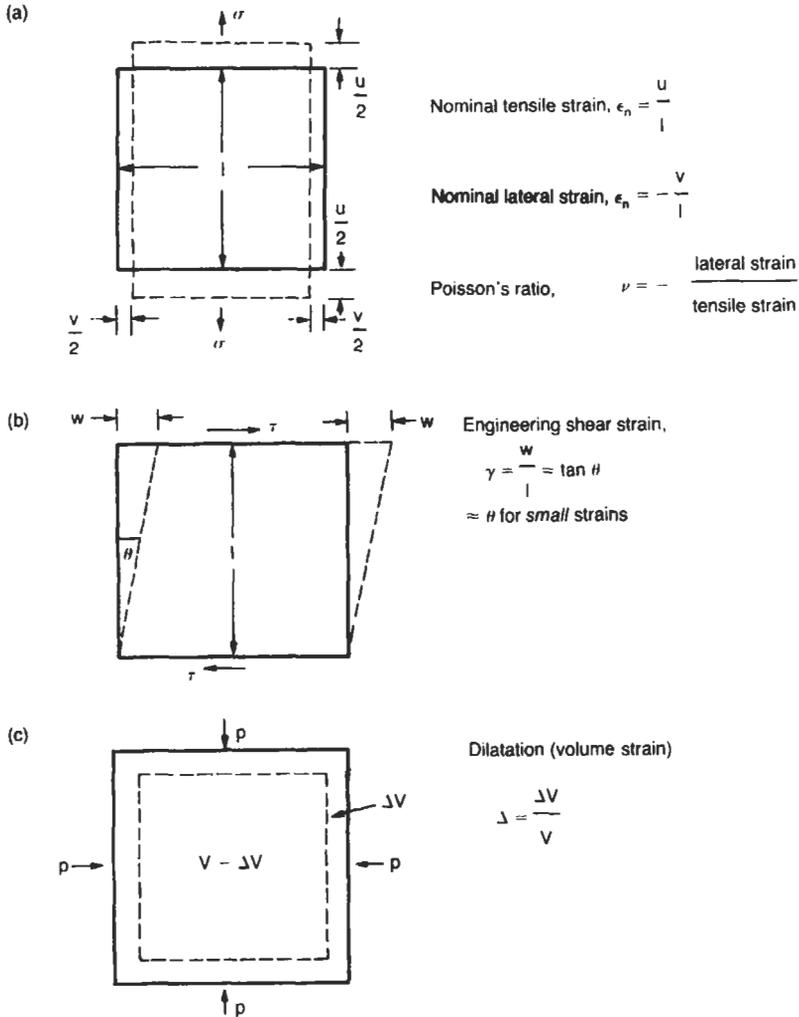


Fig. 3.3. Definitions of tensile strain,  $\epsilon_n$ , shear strain,  $\gamma$  and dilatation,  $\Delta$ .

### Hooke's Law

We can now define the elastic moduli. They are defined through Hooke's Law, which is merely a description of the experimental observation that, when strains are small, the strain is very nearly proportional to the stress; that is, they are *linear-elastic*. The nominal tensile strain, for example, is proportional to the tensile stress; for simple tension

$$\sigma = E\epsilon_n \tag{3.6}$$

where  $E$  is called *Young's modulus*. The same relationship also holds for stresses and strains in simple compression, of course.

In the same way, the shear strain is proportional to the shear stress, with

$$\tau = G\gamma \quad (3.7)$$

where  $G$  is the *shear modulus*.

Finally, the negative of the dilatation is proportional to the pressure (because positive pressure causes a shrinkage of volume) so that

$$p = -K\Delta \quad (3.8)$$

where  $K$  is called the *bulk modulus*.

Because strain is dimensionless, the moduli have the same dimensions as those of stress: force per unit area ( $\text{N m}^{-2}$ ). In those units, the moduli are enormous, so they are usually reported instead in units of GPa.

This linear relationship between stress and strain is a very handy one when calculating the response of a solid to stress, but it must be remembered that most solids are elastic only to *very small* strains: up to about 0.001. Beyond that some break and some become plastic – and this we will discuss in later chapters. A few solids like rubber are elastic up to very much larger strains of order 4 or 5, but they cease to be *linearly* elastic (that is the stress is no longer proportional to the strain) after a strain of about 0.01.

One final point. We earlier defined Poisson's ratio as the negative of the lateral shrinkage strain to the tensile strain. This quantity, Poisson's ratio, is also an elastic constant, so we have four elastic constants:  $E$ ,  $G$ ,  $K$  and  $\nu$ . In a moment when we give data for the elastic constants we list data only for  $E$ . For many materials it is useful to know that

$$K \approx E, G \approx \frac{3}{8}E \text{ and } \nu \approx 0.33, \quad (3.9)$$

although for some the relationship can be more complicated.

## Measurement of Young's modulus

How is Young's modulus measured? One way is to compress the material with a known compressive force, and measure the strain. Young's modulus is then given by  $E = \sigma/\epsilon_n$ , each defined as described earlier. But this is not generally a good way to measure the modulus. For one thing, if the modulus is large, the extension  $u$  may be too small to measure with precision. And, for another, if anything else contributes to the strain, like creep (which we will discuss in a later chapter), or deflection of the testing machine itself, then it will lead to an incorrect value for  $E$  – and these spurious strains can be serious.

A better way of measuring  $E$  is to measure the natural frequency of vibration of a round rod of the material, simply supported at its ends (Fig. 3.4) and heavily loaded by

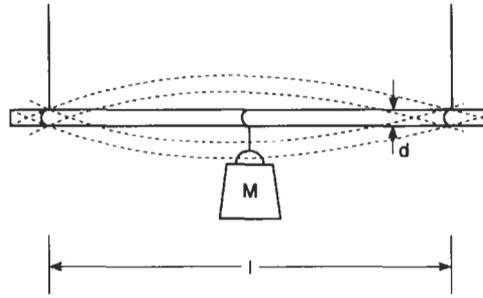


Fig. 3.4. A vibrating bar with a central mass,  $M$ .

a mass  $M$  at the middle (so that we may neglect the mass of the rod itself). The frequency of oscillation of the rod,  $f$  cycles per second (or hertz), is given by

$$f = \frac{1}{2\pi} \left\{ \frac{3\pi E d^4}{4l^3 M} \right\}^{1/2} \quad (3.10)$$

where  $l$  is the distance between the supports and  $d$  is the diameter of the rod. From this,

$$E = \frac{16\pi M l^3 f^2}{3d^4}. \quad (3.11)$$

Use of stroboscopic techniques and carefully designed apparatus can make this sort of method very accurate.

The best of all methods of measuring  $E$  is to measure the velocity of sound in the material. The velocity of longitudinal waves,  $v_l$ , depends on Young's modulus and the density,  $\rho$ :

$$v_l = \left( \frac{E}{\rho} \right)^{1/2}. \quad (3.12)$$

$v_l$  is measured by 'striking' one end of a bar of the material (by glueing a piezo-electric crystal there and applying a charge-difference to the crystal surfaces) and measuring the time sound takes to reach the other end (by attaching a second piezo-electric crystal there). Most moduli are measured by one of these last two methods.

### Data for Young's modulus

Now for some real numbers. Table 3.1 is a ranked list of Young's modulus of materials – we will use it later in solving problems and in selecting materials for particular applications. Diamond is at the top, with a modulus of 1000 GPa; soft rubbers and foamed polymers are at the bottom with moduli as low as 0.001 GPa. You can, of course, make special materials with lower moduli – jelly, for instance, has a modulus of about  $10^{-6}$  GPa. Practical engineering materials lie in the range  $10^{-3}$  to  $10^{+3}$  GPa – a

**Table 3.1** Data for Young's modulus,  $E$ 

<i>Material</i>	<i>E (GN m<sup>-2</sup>)</i>	<i>Material</i>	<i>E (GN m<sup>-2</sup>)</i>
Diamond	1000	Niobium and alloys	80–110
Tungsten carbide, WC	450–650	Silicon	107
Osmium	551	Zirconium and alloys	96
Cobalt/tungsten carbide cermets	400–530	Silica glass, SiO <sub>2</sub> (quartz)	94
Borides of Ti, Zr, Hf	450–500	Zinc and alloys	43–96
Silicon carbide, SiC	430–445	Gold	82
Boron	441	Calcite (marble, limestone)	70–82
Tungsten and alloys	380–411	Aluminium	69
Alumina, Al <sub>2</sub> O <sub>3</sub>	385–392	Aluminium and alloys	69–79
Beryllia, BeO	375–385	Silver	76
Titanium carbide, TiC	370–380	Soda glass	69
Tantalum carbide, TaC	360–375	Alkali halides (NaCl, LiF, etc.)	15–68
Molybdenum and alloys	320–365	Granite (Westerly granite)	62
Niobium carbide, NbC	320–340	Tin and alloys	41–53
Silicon nitride, Si <sub>3</sub> N <sub>4</sub>	280–310	Concrete, cement	30–50
Beryllium and alloys	290–318	Fibreglass (glass-fibre/epoxy)	35–45
Chromium	285–290	Magnesium and alloys	41–45
Magnesia, MgO	240–275	GFRP	7–45
Cobalt and alloys	200–248	Calcite (marble, limestone)	31
Zirconia, ZrO <sub>2</sub>	160–241	Graphite	27
Nickel	214	Shale (oil shale)	18
Nickel alloys	130–234	Common woods,    to grain	9–16
CFRP	70–200	Lead and alloys	16–18
Iron	196	Alkyds	14–17
Iron-based super-alloys	193–214	Ice, H <sub>2</sub> O	9.1
Ferritic steels, low-alloy steels	196–207	Melamines	6–7
Stainless austenitic steels	190–200	Polyimides	3–5
Mild steel	200	Polyesters	1.8–3.5
Cast irons	170–190	Acrylics	1.6–3.4
Tantalum and alloys	150–186	Nylon	2–4
Platinum	172	PMMA	3.4
Uranium	172	Polystyrene	3–3.4
Boron/epoxy composites	80–160	Epoxies	2.6–3
Copper	124	Polycarbonate	2.6
Copper alloys	120–150	Common woods, ⊥ to grain	0.6–1.0
Mullite	145	Polypropylene	0.9
Vanadium	130	PVC	0.2–0.8
Titanium	116	Polyethylene, high density	0.7
Titanium alloys	80–130	Foamed polyurethane	0.01–0.06
Palladium	124	Polyethylene, low density	0.2
Brasses and bronzes	103–124	Rubbers	0.01–0.1
		Foamed polymers	0.001–0.01

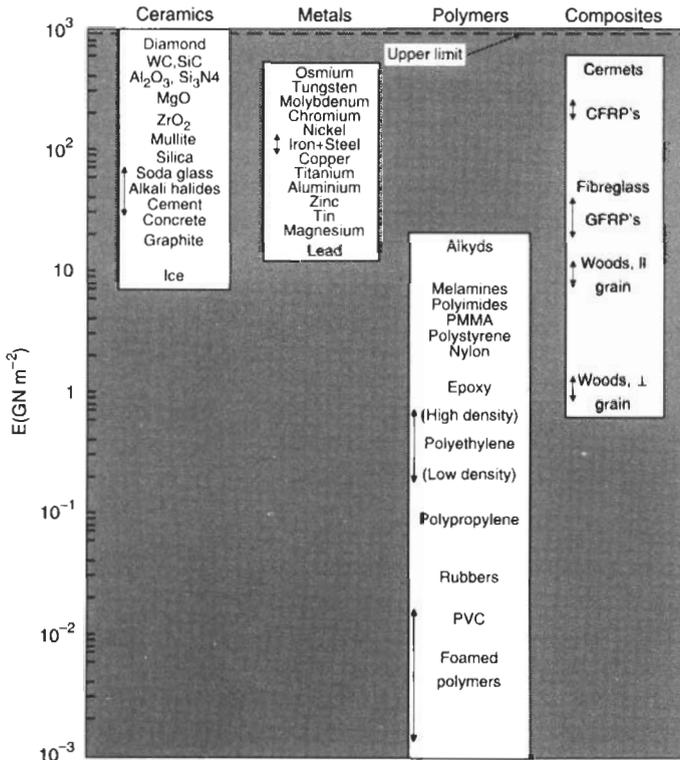


Fig. 3.5. Bar-chart of data for Young's modulus,  $E$ .

range of  $10^6$ . This is the range you have to choose from when selecting a material for a given application. A good perspective of the spread of moduli is given by the bar-chart shown in Fig. 3.5. Ceramics and metals – even the floppiest of them, like lead – lie near the top of this range. Polymers and elastomers are much more compliant, the common ones (polyethylene, PVC and polypropylene) lying several decades lower. Composites span the range between polymers and ceramics.

To understand the origin of the modulus, why it has the values it does, why polymers are much less stiff than metals, and what we can do about it, we have to examine the *structure* of materials, and the *nature of the forces* holding the atoms together. In the next two chapters we will examine these, and then return to the modulus, and to our bar-chart, with new understanding.

## Further reading

- A. H. Cottrell, *The Mechanical Properties of Matter*, Wiley, 1964, Chap. 4.  
 S. P. Timoshenko and J. N. Goodier, *Theory of Elasticity*, McGraw Hill, 1970, Chap. 1.  
 C. J. Smithells' *Metals Reference Book*, 7th edition, Butterworth-Heinemann, 1992 and the *ASM Metals Handbook*, 10th edition, ASM International, 1990 (for data).

# Chapter 4

## Bonding between atoms

---

### Introduction

In order to understand the origin of material properties like *Young's modulus*, we need to focus on materials at the *atomic* level. Two things are especially important in influencing the modulus:

- (1) The forces which hold atoms together (the *interatomic bonds*) which act like little springs, linking one atom to the next in the solid state (Fig. 4.1).

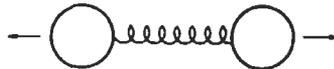


Fig. 4.1. The spring-like bond between two atoms.

and

- (2) The ways in which atoms pack together (the *atom packing*), since this determines how many little springs there are per unit area, and the angle at which they are pulled (Fig. 4.2).

In this chapter we shall look at the forces which bind atoms together – the springs. In the next we shall examine the arrangements in which they can be packed.

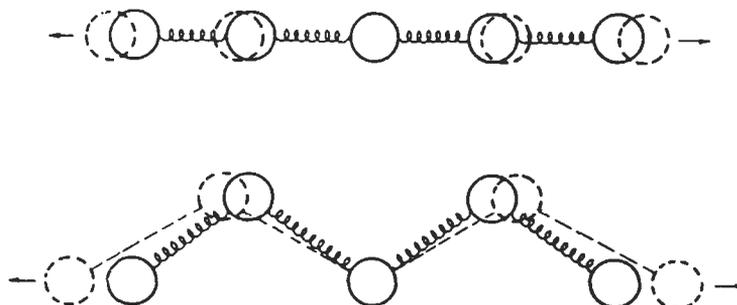


Fig. 4.2. Atom packing and bond-angle.



can remove it by expending 5.14 eV\* of work. This electron can be most profitably transferred to a vacant position on a distant chlorine atom, giving us back 4.02 eV of energy. Thus, we can make isolated  $\text{Na}^+$  and  $\text{Cl}^-$  by doing  $5.14 \text{ eV} - 4.02 \text{ eV} = 1.12 \text{ eV}$  of work,  $U_i$ .

So far, we have had to *do* work to create the ions which will make the ionic bond: it does not seem to be a very good start. However, the + and - charges attract each other and if we now bring them together, the force of attraction does work. This force is simply that between two opposite point charges:

$$F = q^2/4\pi\epsilon_0r^2 \quad (4.1)$$

where  $q$  is the charge on each ion,  $\epsilon_0$  is the permittivity of vacuum, and  $r$  is the separation of the ions. The work done as the ions are brought to a separation  $r$  (from infinity) is:

$$U = \int_r^\infty F \, dr = q^2/4\pi\epsilon_0r. \quad (4.2)$$

Figure 4.4 shows how the energy of the pair of ions falls as  $r$  decreases, until, at  $r \approx 1 \text{ nm}$  for a typical ionic bond, we have paid off the 1.12 eV of work borrowed to form  $\text{Na}^+$  and  $\text{Cl}^-$  in the first place. For  $r < 1 \text{ nm}$  ( $1 \text{ nm} = 10^{-9} \text{ m}$ ), it is all gain, and the ionic bond now becomes more and more stable.

Why does  $r$  not decrease indefinitely, releasing more and more energy, and ending in the *fusion* of the two ions? Well, when the ions get close enough together, the electronic charge distributions start to overlap one another, and this causes a very large repulsion. Figure 4.4 shows the potential energy increase that this causes. Clearly, the ionic bond is most stable at the minimum in the  $U(r)$  curve, which is well approximated by

$$U(r) = U_i - \underbrace{\frac{q^2}{4\pi\epsilon_0r}}_{\text{attractive part}} + \underbrace{\frac{B}{r^n}}_{\text{repulsive part}} \quad (4.3)$$

where  $n$  is a large power – typically about 12.

How much can we bend this bond? Well, the electrons of each ion occupy complicated three-dimensional regions (or ‘orbitals’) around the nuclei. But at an approximate level we can assume the ions to be spherical, and there is then considerable freedom in the way we pack the ions round each other. The ionic bond therefore *lacks directionality*, although in packing ions of opposite sign, it is obviously necessary to make sure that the total charge (+ and -) adds up to zero, and that positive ions (which repel each other) are always separated by negative ions.

*Covalent bonding* appears in its pure form in diamond, silicon and germanium – all materials with large moduli (that of diamond is the highest known). It is the dominant

---

\*The eV is a convenient unit for energy when dealing with atoms because the values generally lie in the range 1 to 10. 1 eV is equal to  $1.6 \times 10^{-19}$  joules.

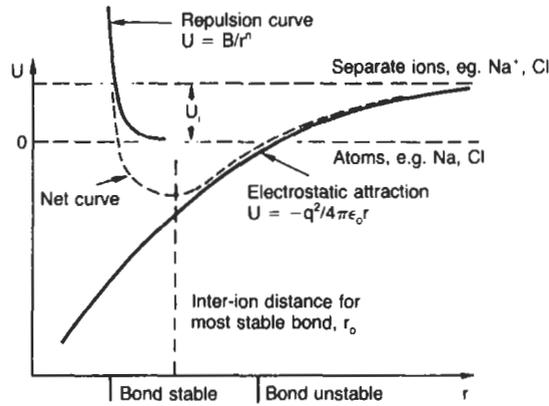


Fig. 4.4. The formation of ionic bond, viewed in terms of energy.

bond-type in silicate ceramics and glasses (stone, pottery, brick, all common glasses, components of cement) and contributes to the bonding of the high-melting-point metals (tungsten, molybdenum, tantalum, etc.). It appears, too, in polymers, linking carbon atoms to each other along the polymer chain; but because polymers also contain bonds of other, much weaker, types (see below) their moduli are usually small.

The simplest example of covalent bonding is the hydrogen molecule. The proximity of the two nuclei creates a new electron orbital, shared by the two atoms, into which the two electrons go (Fig. 4.5). This sharing of electrons leads to a reduction in energy, and a stable bond, as Fig. 4.6 shows. The energy of a covalent bond is well described by the empirical equation

$$U = - \underbrace{\frac{A}{r^m}}_{\text{attractive part}} + \underbrace{\frac{B}{r^n}}_{\text{repulsive part}} \quad (m < n). \quad (4.4)$$

Hydrogen is hardly an engineering material. A more relevant example of the covalent bond is that of diamond, one of several solid forms of carbon. It is more of an engineering material than you might at first think, finding wide application for rock-drilling bits, cutting tools, grinding wheels and precision bearings. Here, the shared

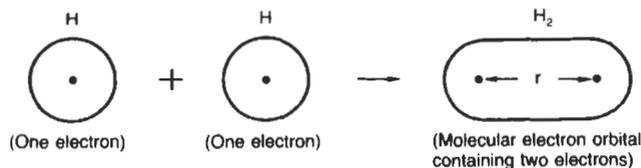


Fig. 4.5. The formation of a covalent bond – in this case between two hydrogen atoms, making a hydrogen molecule.

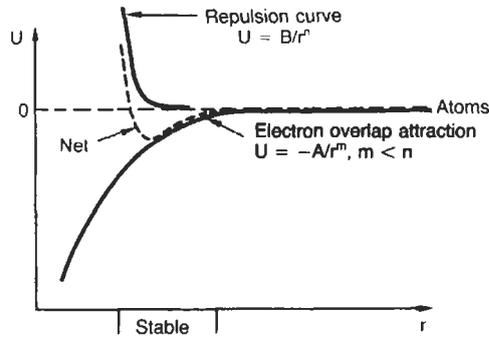


Fig. 4.6. The formation of a covalent bond, viewed in terms of energy.

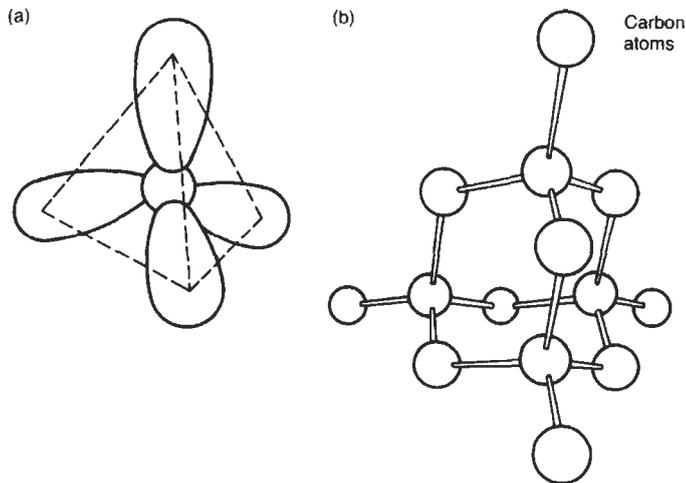


Fig. 4.7. Directional covalent bonding in diamond.

electrons occupy regions that point to the corners of a tetrahedron, as shown in Fig. 4.7(a). The unsymmetrical shape of these orbitals leads to a very *directional* form of bonding in diamond, as Fig. 4.7(b) shows. All covalent bonds have directionality which, in turn, influences the ways in which atoms pack together to form crystals – more on that topic in the next chapter.

The *metallic bond*, as the name says, is the dominant (though not the only) bond in metals and their alloys. In a solid (or, for that matter, a liquid) metal, the highest energy electrons tend to leave the parent atoms (which become ions) and combine to form a 'sea' of freely wandering electrons, not attached to any ion in particular (Fig. 4.8). This gives an energy curve that is very similar to that for covalent bonding; it is well described by eqn. (4.4) and has a shape like that of Fig. 4.6.

The easy movement of the electrons gives the high electrical conductivity of metals. The metallic bond has no directionality, so that metal ions tend to pack to give simple, high-density structures, like ball-bearings shaken down in a box.

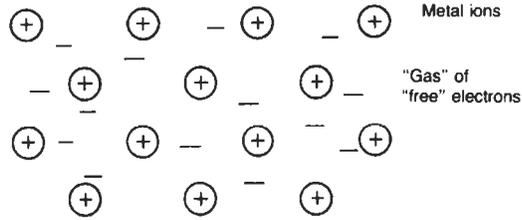


Fig. 4.8. Bonding in a metal – metallic bonding.

## Secondary bonds

Although much weaker than primary bonds, secondary bonds are still very important. They provide the links between polymer molecules in polyethylene (and other polymers) which make them solids. Without them, water would boil at  $-80^{\circ}\text{C}$ , and life as we know it on earth would not exist.

*Van der Waals bonding* describes a dipolar attraction between *uncharged* atoms. The electronic charge on an atom is in motion; one can think of the electrons as little charged blobs whizzing round the nucleus like the moon around the earth. Averaged over time, the electron charge has spherical symmetry, but at any given instant it is unsymmetric relative to the nucleus. The effect is a bit like that which causes the tides. The instantaneous distribution has a dipole moment; this moment induces a like moment on a nearby atom and the two dipoles attract (Fig. 4.9).

Dipoles attract such that their energy varies as  $1/r^6$ . Thus the energy of the Van der Waals bond has the form

$$U = - \underbrace{\frac{A}{r^6}}_{\text{attractive part}} + \underbrace{\frac{B}{r^n}}_{\text{repulsive part}} \quad (n \approx 12). \quad (4.5)$$

A good example is liquid nitrogen, which liquifies, at atmospheric pressure, at  $-198^{\circ}\text{C}$  glued by Van der Waals forces between the covalently bonded  $\text{N}_2$  molecules. The


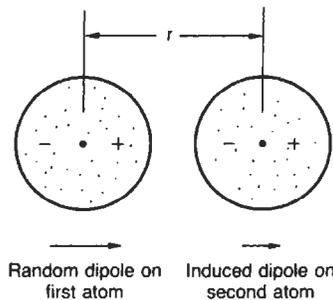


Fig. 4.9. Van der Waals bonding; the atoms are held together by the dipole charge distribution.

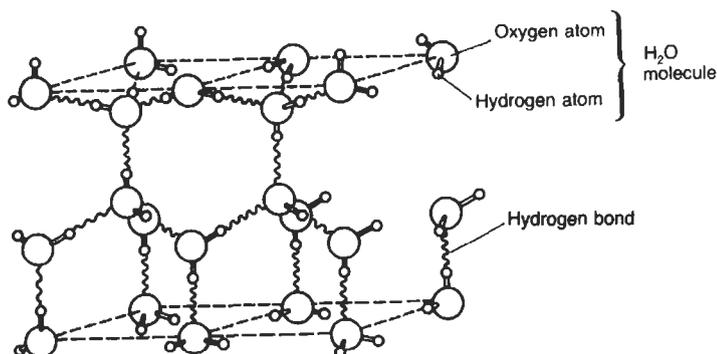

**Fig. 4.10.** The arrangement of  $\text{H}_2\text{O}$  molecules in the common form of ice, showing the hydrogen bonds. The hydrogen bonds keep the molecules well apart, which is why ice has a lower density than water.

thermal agitation produced when liquid nitrogen is poured on the floor at room temperature is more than enough to break the Van der Waals bonds, showing how weak they are. But without these bonds, most gases would not liquefy at attainable temperatures, and we should not be able to separate industrial gases from the atmosphere.

*Hydrogen bonds* keep water liquid at room temperature, and bind polymer chains together to give solid polymers. Ice (Fig. 4.10) is hydrogen-bonded. Each hydrogen atom shares its charge with the nearest oxygen atom. The hydrogen, having lost part of its share, acquires a + charge; the oxygen, having a share in more electrons than it should, is -ve. The positively charged H atom acts as a bridging bond between neighbouring oxygen ions, because the charge redistribution gives each  $\text{H}_2\text{O}$  molecule a dipole moment which attracts other  $\text{H}_2\text{O}$  dipoles.

## The condensed states of matter

It is because these primary and secondary bonds can form that matter condenses from the gaseous state to give liquids and solids. Five distinct *condensed states of matter*,

**Table 4.1** Condensed states of matter

State	Bonds		Moduli	
	Molten	Solid	K	G and E
1. Liquids	•		Large	Zero
2. Liquid crystals	•		Large	Some non-zero but very small
3. Rubbers	• (2 <sup>ary</sup> )	• (1 <sup>ary</sup> )	Large	Small ( $E \ll K$ )
4. Glasses		•	Large	Large ( $E \approx K$ )
5. Crystals		•	Large	Large ( $E \approx K$ )

differing in their structure and the state of their bonding, can be identified (Table 4.1). The bonds in ordinary liquids have melted, and for this reason the liquid resists compression, but not shear; the bulk modulus,  $K$ , is large compared to the gas because the atoms are in contact, so to speak; but the shear modulus,  $G$ , is zero because they can slide past each other. The other states of matter, listed in Table 4.1, are distinguished by the state of their bonding (molten versus solid) and their structure (crystalline versus non-crystalline). These differences are reflected in the relative magnitudes of their bulk modulus and shear modulus – the more liquid-like the material becomes, the smaller is its ratio of  $G/K$ .

## Interatomic forces

Having established the various types of bonds that can form between atoms, and the shapes of their potential energy curves, we are now in a position to explore the *forces* between atoms. Starting with the  $U(r)$  curve, we can find this force  $F$  for any separation of the atoms,  $r$ , from the relationship

$$F = -\frac{dU}{dr}. \quad (4.6)$$

Figure 4.11 shows the shape of the *force/distance* curve that we get from a typical *energy/distance* curve in this way. Points to note are:

- (1)  $F$  is zero at the equilibrium point  $r = r_0$ ; however, if the atoms are pulled apart by distance  $(r - r_0)$  a resisting force appears. For *small*  $(r - r_0)$  the resisting force is proportional to  $(r - r_0)$  for all materials, in both tension and compression.
- (2) The *stiffness*,  $S$ , of the bond is given by

$$S = \frac{dF}{dr} = \frac{d^2U}{dr^2}. \quad (4.7)$$

When the stretching is small,  $S$  is constant and equal to

$$S_0 = \left( \frac{d^2U}{dr^2} \right)_{r=r_0}, \quad (4.8)$$

that is, the bond behaves in linear-elastic manner – this is the physical origin of Hooke's Law.

To conclude, the concept of bond stiffness, based on the energy/distance curves for the various bond types, goes a long way towards explaining the origin of the elastic modulus. But we need to find out how individual atom bonds build up to form whole pieces of material before we can fully explain experimental data for the modulus. The

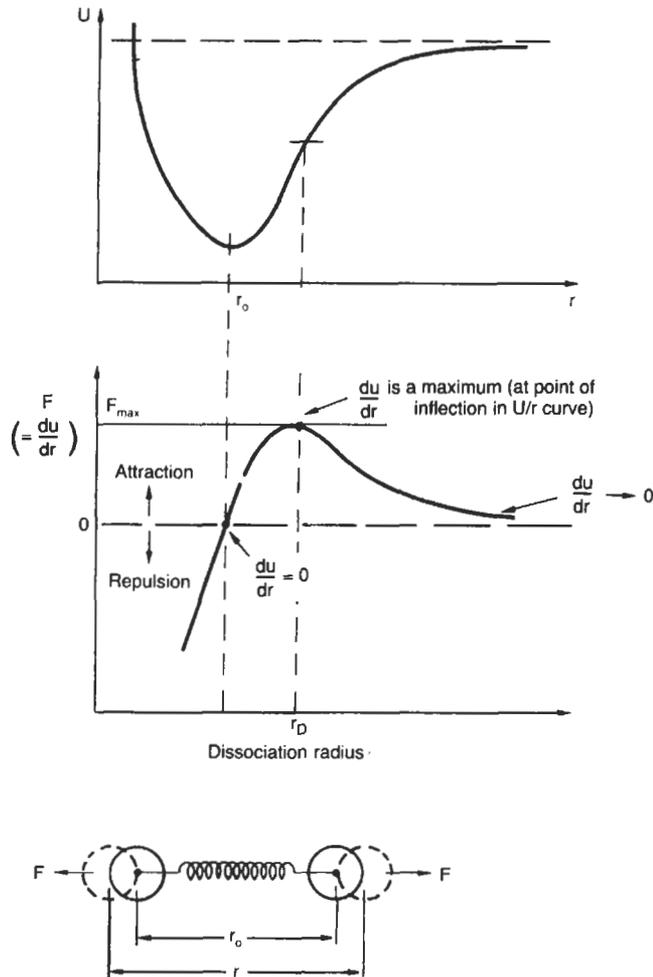


Fig. 4.11. The energy curve (top), when differentiated (eqn. (4.6)) gives the force-distance curve (centre).

nature of the bonds we have mentioned influences the *packing* of atoms in engineering materials. This is the subject of the next chapter.

### Further reading

- A. H. Cottrell, *The Mechanical Properties of Matter*, Wiley, 1964, Chap. 2.
- K. J. Pascoe, *An Introduction to the Properties of Engineering Materials*, 3rd edition. Van Nostrand, 1978, Chaps. 2,4.
- C. Kittel, *Introduction to Solid State Physics*, 4th edition, Wiley, 1971, Chap. 3.

# Chapter 5

## Packing of atoms in solids

---

### Introduction

In the previous chapter, as a first step in understanding the stiffness of solids, we examined the stiffnesses of the bonds holding atoms together. But bond stiffness alone does not fully explain the stiffness of solids; the way in which the atoms are packed together is equally important. In this chapter we examine how atoms are arranged in some typical engineering solids.

### Atomic packing in crystals


Many engineering materials (almost all metals and ceramics, for instance) are made up entirely of small crystals or *grains* in which atoms are packed in regular, repeating, three-dimensional patterns; the grains are stuck together, meeting at *grain boundaries*, which we will describe later. We focus now on the individual crystals, which can best be understood by thinking of the atoms as *hard spheres* (although, from what we said in the previous chapter, it should be obvious that this is a considerable, although convenient, simplification). To make things even simpler, let us for the moment consider a material which is *pure* – with only one size of hard sphere to consider – and which also has *non-directional bonding*, so that we can arrange the spheres subject only to geometrical constraints. Pure copper is a good example of a material satisfying these conditions.

In order to build up a three-dimensional packing pattern, it is easier, conceptually, to begin by

- (i) packing atoms two-dimensionally in *atomic planes*,
- (ii) stacking these planes on top of one another to give *crystals*.

### Close-packed structures and crystal energies

An example of how we might pack atoms in a *plane* is shown in Fig. 5.1; it is the arrangement in which the reds are set up on a billiard table before starting a game of snooker. The balls are packed in a triangular fashion so as to take up the least possible space on the table. This type of plane is thus called a *close-packed plane*, and contains three *close-packed directions*; they are the directions along which the balls touch. The figure shows only a small region of close-packed plane – if we had more reds we could extend the plane sideways and could, if we wished, fill the whole billiard table. The

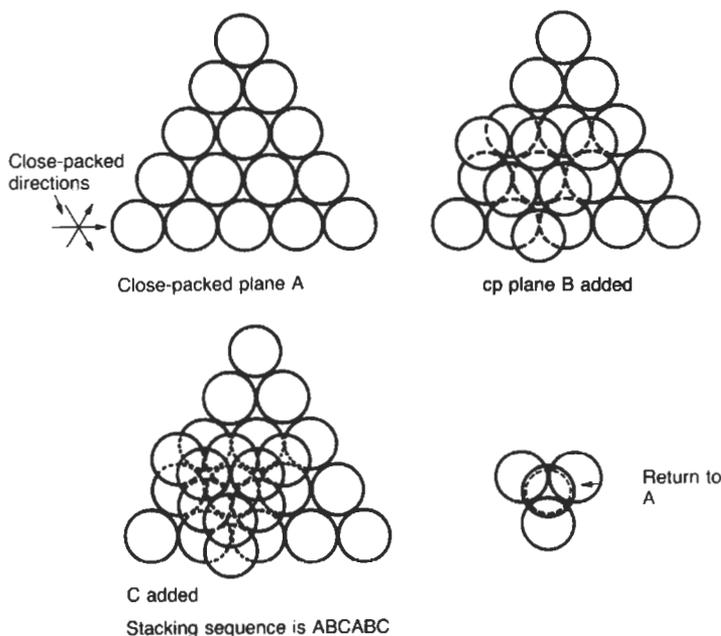


**Fig. 5.1.** The close packing of hard-sphere atoms. The ABC stacking gives the 'face-centred cubic' (f.c.c.) structure.

important thing to notice is the way in which the balls are packed in a *regularly repeating two-dimensional pattern*.

How could we add a second layer of atoms to our close-packed plane? As Fig. 5.1 shows, the depressions where the atoms meet are ideal 'seats' for the next layer of atoms. By dropping atoms into alternate seats, we can generate a second close-packed plane lying on top of the original one and having an identical packing pattern. Then a third layer can be added, and a fourth, and so on until we have made a sizeable piece of crystal – with, this time, a *regularly repeating pattern of atoms in three dimensions*. The particular structure we have produced is one in which the atoms take up the *least volume* and is therefore called a *close-packed structure*. The atoms in many solid metals are packed in this way.

There is a complication to this apparently simple story. There are two alternative and different *sequences* in which we can stack the close-packed planes on top of one another. If we follow the stacking sequence in Fig. 5.1 rather more closely, we see that, by the time we have reached the *fourth* atomic plane, we are placing the atoms directly above the original atoms (although, naturally, separated from them by the two interleaving planes of atoms). We then carry on adding atoms as before, generating an ABCABC ... sequence. In Fig. 5.2 we show the alternative way of stacking, in which the atoms in the *third* plane are now directly above those in the first layer. This gives an ABAB ... sequence. These two different stacking sequences give two different three-dimensional packing structures – *face-centred cubic (f.c.c.)* and *close-packed hexagonal (c.p.h.)* respec-

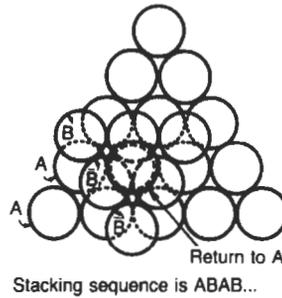

**Fig. 5.2.** Close packing of hard-sphere atoms – an alternative arrangement, giving the ‘hexagonal close-packed’ (h.c.p.) structure.

tively. Many common metals (e.g. Al, Cu and Ni) have the f.c.c. structure and many others (e.g. Mg, Zn and Ti) have the c.p.h. structure.

Why should Al choose to be f.c.c. while Mg chooses to be c.p.h.? The answer is that the f.c.c. structure is the one that gives an Al crystal the least *energy*, and the c.p.h. structure the one that gives a Mg crystal the least energy. In general, materials choose the crystal structure that gives minimum energy. This structure may not necessarily be close-packed or, indeed, very simple geometrically, although, to be a crystal, it must still have some sort of three-dimensional repeating pattern.

The difference in energy between alternative structures is often slight. Because of this, the crystal structure which gives the minimum energy at one temperature may not do so at another. Thus tin changes its crystal structure if it is cooled enough; and, incidentally, becomes much more brittle in the process (causing the tin-alloy coat-buttons of Napoleon’s army to fall apart during the harsh Russian winter; and the soldered cans of paraffin on Scott’s South Pole expedition to leak, with disastrous consequences). Cobalt changes its structure at 450°C, transforming from an h.c.p. structure at lower temperatures to an f.c.c. structure at higher temperatures. More important, pure iron transforms from a b.c.c. structure (defined below) to one which is f.c.c. at 911°C, a process which is important in the heat-treatment of steels.

## Crystallography

We have not yet explained why an ABCABC sequence is called ‘f.c.c.’ or why an ABAB sequence is referred to as ‘c.p.h.’. And we have not even begun to describe the features of the more complicated crystal structures like those of ceramics such as alumina. In order to explain things such as the geometric differences between f.c.c. and c.p.h. or to ease the conceptual labour of constructing complicated crystal structures, we need an appropriate descriptive language. The methods of *crystallography* provide this language, and give us also an essential shorthand way of describing crystal structures.

Let us illustrate the crystallographic approach in the case of f.c.c. Figure 5.3 shows that the *atom centres* in f.c.c. can be placed at the corners of a cube and in the centres of the

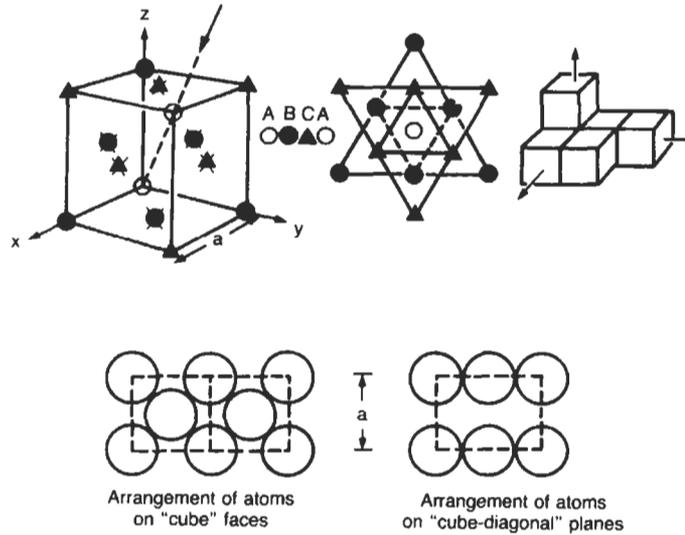


Fig. 5.3. The face-centred-cubic (f.c.c.) structure.

cube faces. The cube, of course, has no physical significance but is merely a constructional device. It is called a *unit cell*. If we look along the cube diagonal, we see the view shown in Fig. 5.3 (top centre): a triangular pattern which, with a little effort, can be seen to be that of bits of close-packed planes stacked in an ABCABC sequence. This unit-cell visualisation of the atomic positions is thus exactly equivalent to our earlier approach based on stacking of close-packed planes, but is much more powerful as a descriptive aid. For example, we can see how our complete f.c.c. crystal is built up by attaching further unit cells to the first one (like assembling a set of children's building cubes) so as to fill space without leaving awkward gaps – something you cannot so easily do with 5-sided shapes (in a plane) or 7-sided shapes (in three dimensions). Beyond this, inspection of the unit cell reveals planes in which the atoms are packed in other than a close-packed way. On the 'cube' faces the atoms are packed in a square array, and on the cube-diagonal planes in separated rows, as shown in Fig. 5.3.

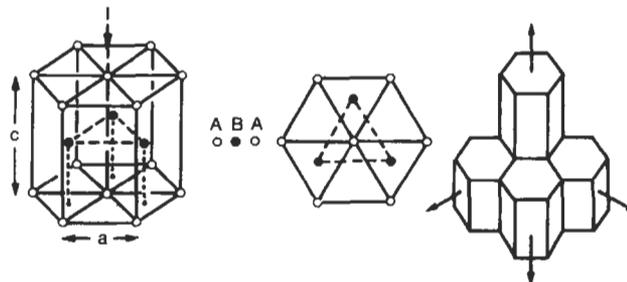


Fig. 5.4. The close-packed-hexagonal (c.p.h.) structure.

Obviously, properties like the shear modulus might well be different for close-packed planes and cube planes, because the number of bonds attaching them per unit area is different. This is one of the reasons that it is important to have a method of describing various planar packing arrangements.

Let us now look at the c.p.h. unit cell as shown in Fig. 5.4. A view looking down the vertical axis reveals the ABA stacking of close-packed planes. We build up our c.p.h. crystal by adding hexagonal building blocks to one another: hexagonal blocks also stack so that they fill space. Here, again, we can use the unit cell concept to 'open up' views of the various types of planes.

## Planes indices

We could make scale drawings of the many types of planes that we see in all unit cells; but the concept of a unit cell also allows us to describe any plane by a set of numbers called *Miller Indices*. The two examples given in Fig. 5.5 should enable you to find the

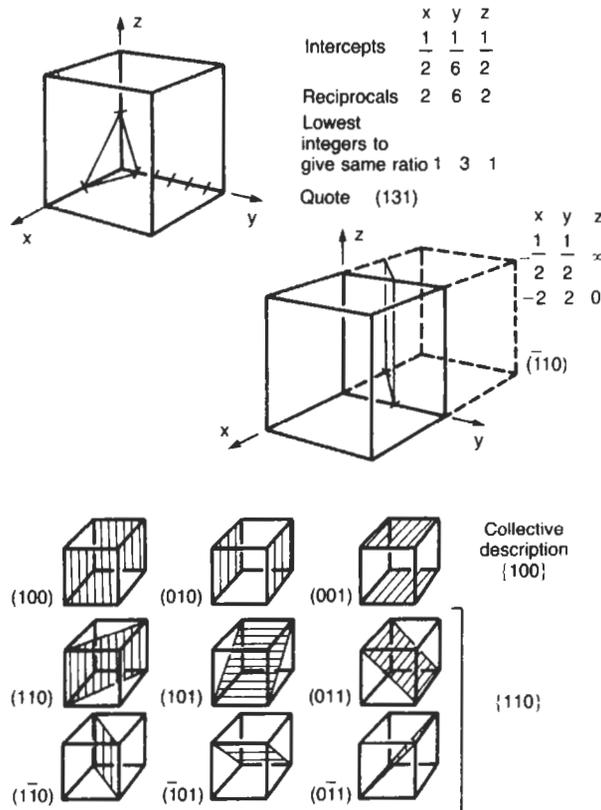



Fig. 5.5. Miller indices for identifying crystal planes, showing how the (131) plane and the  $(\bar{1}10)$  planes are defined. The lower part of the figure shows the family of {100} and of {110} planes.

Miller index of any plane in a cubic unit cell, although they take a little getting used to. The indices (for a plane) are the *reciprocals* of the intercepts the plane makes with the three axes, reduced to the smallest integers (reciprocals are used simply to avoid infinities when planes are parallel to axes). As an example, the six individual 'cube' planes are called (100), (010), (001). Collectively this type of plane is called {100}, with curly brackets. Similarly the six cube *diagonal* planes are (110), ( $\bar{1}\bar{1}0$ ), (101), ( $\bar{1}0\bar{1}$ ), (011) and (0 $\bar{1}\bar{1}$ ), or, collectively, {110}. (Here the sign  $\bar{1}$  means an intercept of -1.) As a final example, our original close-packed planes – the ones of the ABC stacking – are of {111} type. Obviously the unique structural description of '{111} f.c.c.' is a good deal more succinct than a scale drawing of close-packed billiard balls.

Different indices are used in hexagonal cells (we build a c.p.h. crystal up by adding bricks in four directions, not three as in cubic). We do not need them here – the crystallography books listed under 'Further Reading' at the end of this chapter do them more than justice.

## Direction indices

Properties like Young's modulus may well vary with *direction* in the unit cell; for this (and other) reasons we need a succinct description of crystal directions. Figure 5.6 shows the method and illustrates some typical directions. The indices of direction are the components of a vector (*not* reciprocals, because infinities do not crop up here), starting from the origin, along the desired direction, again reduced to the smallest integer set. A single direction (like the '111' direction which links the origin to the corner of the cube)

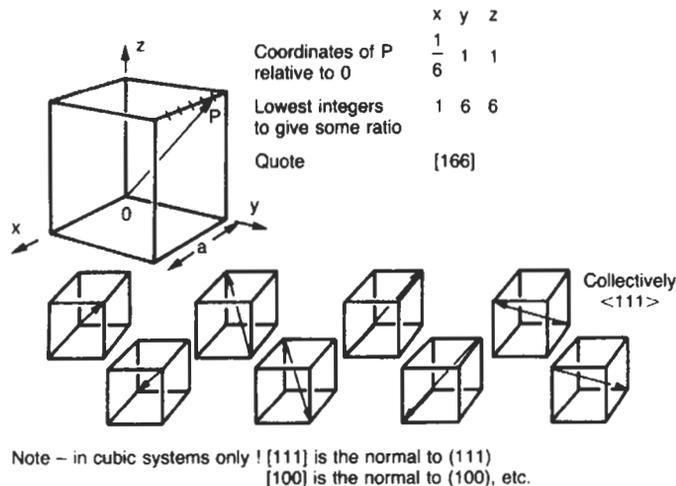

**Fig. 5.6.** Direction indices for identifying crystal directions, showing how the [166] direction is defined. The lower part of the figure shows the family of  $\langle 111 \rangle$  directions.

furthest from the origin) is given square brackets (i.e.  $[111]$ ), to distinguish it from the Miller index of a plane. The family of directions of this type (illustrated in Fig. 5.6) is identified by angled brackets:  $\langle 111 \rangle$ .

### Other simple, important, crystal structures

Figure 5.7 shows a new crystal structure, and an important one: it is the body-centred cubic (b.c.c.) structure of tungsten, of chromium, of iron and many steels. The  $\langle 111 \rangle$  directions are close-packed (that is to say: the atoms touch along this direction) but there are no close-packed planes. The result is that b.c.c. packing is less dense than either f.c.c. or h.c.p. It is found in materials which have *directional bonding*: the directionality distorts the structure, preventing the atoms from dropping into one of the two close-packed structures we have just described. There are other structures involving only one sort of atom which are not close-packed, for the same reason, but we don't need them here.

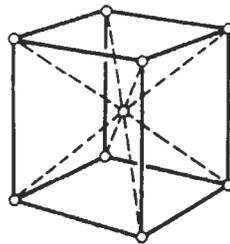


Fig. 5.7. The body-centred-cubic (b.c.c.) structure.


In compound materials – in the ceramic sodium chloride, for instance – there are two (sometimes more) species of atoms, packed together. The crystal structures of such compounds can still be simple. Figure 5.8(a) shows that the ceramics NaCl, KCl and MgO, for example, also form a cubic structure. Naturally, when two species of atoms are not in the ratio 1:1, as in compounds like the nuclear fuel  $\text{UO}_2$  (a ceramic too) the structure is more complicated (it is shown in Fig. 5.8(b)), although this, too, has a cubic unit cell.

### Atomic packing in polymers


As we saw in the first chapter, polymers have become important engineering materials. They are much more complex structurally than metals, and because of this they have very special mechanical properties. The extreme elasticity of a rubber band is one; the formability of polyethylene is another.



Polystyrene, similarly, is made by the polymerisation of styrene (left), again by sacrificing the double bond to provide the hooks which give the chain:

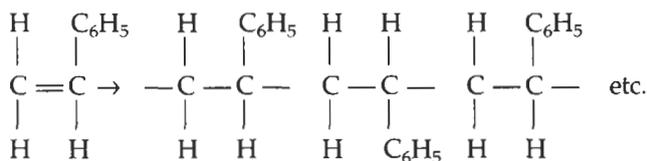

A copolymer is made by polymerisation of two monomers, adding them randomly (a random copolymer) or in an ordered way (a block copolymer). An example is styrene-butadiene rubber, SBR. Styrene, extreme left, loses its double bond in the marriage; butadiene, richer in double bonds to start with, keeps one.

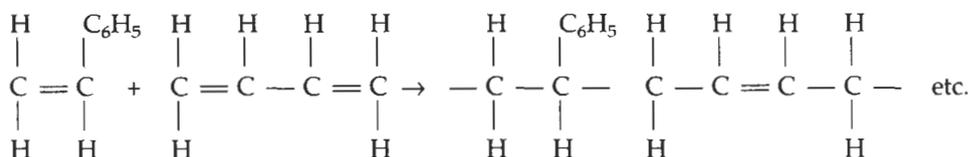

Molecules such as these form long, flexible, spaghetti-like chains like that of Fig. 5.9. Figure 5.10 shows how they pack to form bulk material. In some polymers the chains can be folded carefully backwards and forwards over one another so as to look like the firework called the 'jumping jack'. The regularly repeating symmetry of this chain-folding leads to crystallinity, so polymers can be crystalline. More usually the chains are arranged *randomly* and *not* in regularly repeating three-dimensional patterns. These



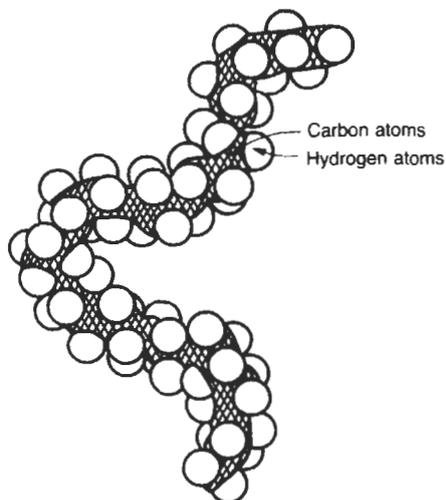


Fig. 5.9. The three-dimensional appearance of a short bit of a polyethylene molecule.

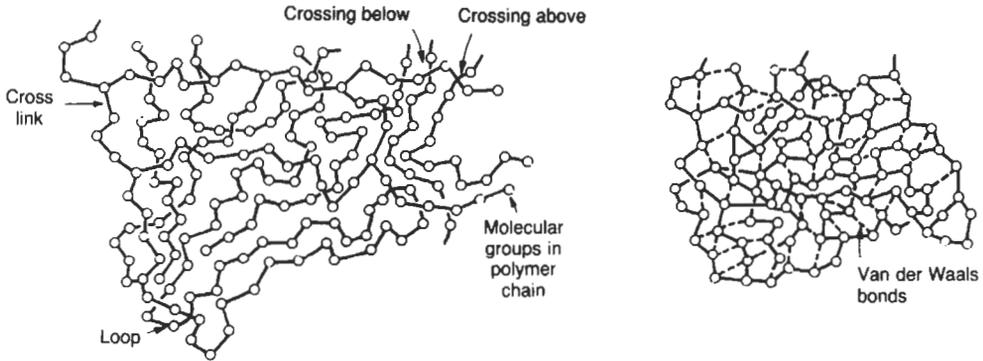

(a) A rubber above its glass-transition temperature. The structure is entirely amorphous. The chains are held together only by occasional *covalent* cross-linking

(b) A rubber below its glass-transition temperature. In addition to occasional covalent cross-linking the molecular groups in the polymer chains attract by Van der Waals bonding, tying the chains closely to one another.

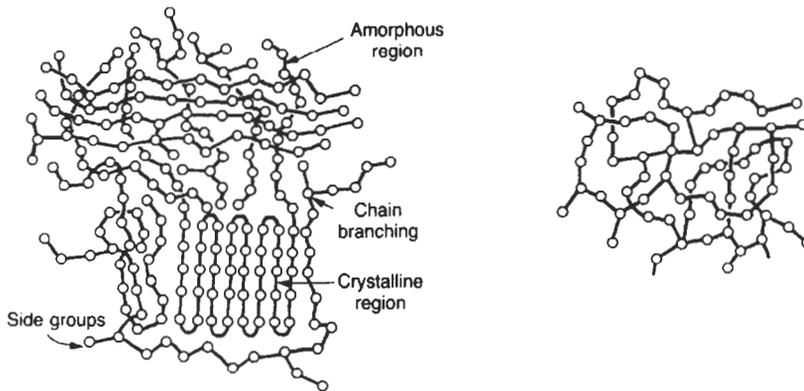

(c) Low-density polyethylene, showing both amorphous and crystalline regions

(d) A polymer (e.g. epoxy resin) where the chains are tied tightly together by frequent *covalent* cross-links

**Fig. 5.10.** How the molecules are packed together in polymers.

polymers are thus *non-crystalline*, or *amorphous*. Many contain both amorphous and crystalline regions, as shown in Fig. 5.10, that is, they are *partly crystalline*.

There is a whole science called *molecular architecture* devoted to making all sorts of chains and trying to arrange them in all sorts of ways to make the final material. There are currently thousands of different polymeric materials, all having different properties – and new ones are under development. This sounds like bad news, but we need only a few: six basic polymers account for almost 95% of all current production. We will meet them later.

**Table 5.1** Data for density,  $\rho$ 

<i>Material</i>	$\rho$ ( $\text{Mg m}^{-3}$ )	<i>Material</i>	$\rho$ ( $\text{Mg m}^{-3}$ )
Osmium	22.7	Silicon carbide, SiC	2.5–3.2
Platinum	21.4	Silicon nitride, Si <sub>3</sub> N <sub>4</sub>	3.2
Tungsten and alloys	13.4–19.6	Mullite	3.2
Gold	19.3	Beryllia, BeO	3.0
Uranium	18.9	Common rocks	2.2–3.0
Tungsten carbide, WC	14.0–17.0	Calcite (marble, limestone)	2.7
Tantalum and alloys	16.6–16.9	Aluminium	2.7
Molybdenum and alloys	10.0–13.7	Aluminium alloys	2.6–2.9
Cobalt/tungsten-carbide cermets	11.0–12.5	Silica glass, SiO <sub>2</sub> (quartz)	2.6
Lead and alloys	10.7–11.3	Soda glass	2.5
Silver	10.5	Concrete/cement	2.4–2.5
Niobium and alloys	7.9–10.5	GFRPs	1.4–2.2
Nickel	8.9	Carbon fibres	2.2
Nickel alloys	7.8–9.2	PTFE	2.3
Cobalt and alloys	8.1–9.1	Boron fibre/epoxy	2.0
Copper	8.9	Beryllium and alloys	1.85–1.9
Copper alloys	7.5–9.0	Magnesium and alloys	1.74–1.88
Brasses and bronzes	7.2–8.9	Fibreglass (GFRP/Polyester)	1.55–1.95
Iron	7.9	Graphite, high strength	1.8
Iron-based super-alloys	7.9–8.3	PVC	1.3–1.6
Stainless steels, austenitic	7.5–8.1	CFRPs	1.5–1.6
Tin and alloys	7.3–8.0	Polyesters	1.1–1.5
Low-alloy steels	7.8–7.85	Polyimides	1.4
Mild steel	7.8–7.85	Epoxies	1.1–1.4
Stainless steel, ferritic	7.5–7.7	Polyurethane	1.1–1.3
Cast iron	6.9–7.8	Polycarbonate	1.2–1.3
Titanium carbide, TiC	7.2	PMMA	1.2
Zinc and alloys	5.2–7.2	Nylon	1.1–1.2
Chromium	7.2	Polystyrene	1.0–1.1
Zirconium carbide, ZrC	6.6	Polyethylene, high-density	0.94–0.97
Zirconium and alloys	6.6	Ice, H <sub>2</sub> O	0.92
Titanium	4.5	Natural rubber	0.83–0.91
Titanium alloys	4.3–5.1	Polyethylene, low-density	0.91
Alumina, Al <sub>2</sub> O <sub>3</sub>	3.9	Polypropylene	0.88–0.91
Alkali halides	3.1–3.6	Common woods	0.4–0.8
Magnesia, MgO	3.5	Foamed plastics	0.01–0.6
		Foamed polyurethane	0.06–0.2

## Atom packing in inorganic glasses

Inorganic glasses are mixtures of oxides, almost always with silica, SiO<sub>2</sub>, as the major ingredient. As the name proclaims, the atoms in glasses are packed in a non-crystalline (or amorphous) way. Figure 5.11(a) shows schematically the structure of silica glass, which is solid to well over 1000°C because of the strong covalent bonds linking the Si to the O atoms. Adding soda (Na<sub>2</sub>O) breaks up the structure and lowers the *softening temperature* (at which the glass can be worked) to about 600°C. This soda glass (Fig.

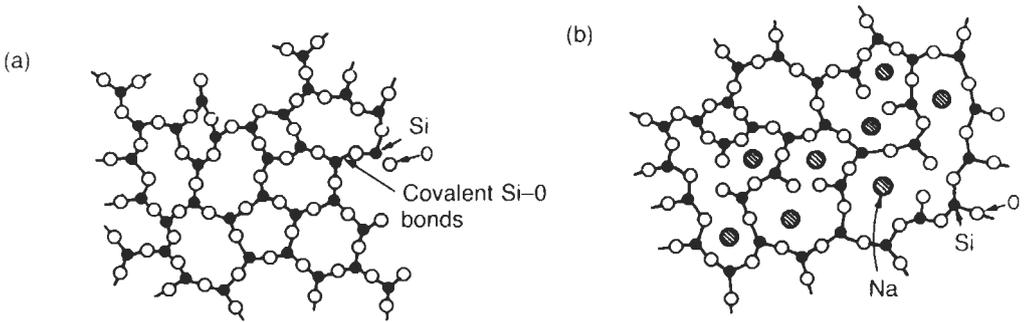


Fig. 5.11. (a) Atom packing in amorphous (glassy) silica. (b) How the addition of soda breaks up the bonding in amorphous, silica, giving soda glass.

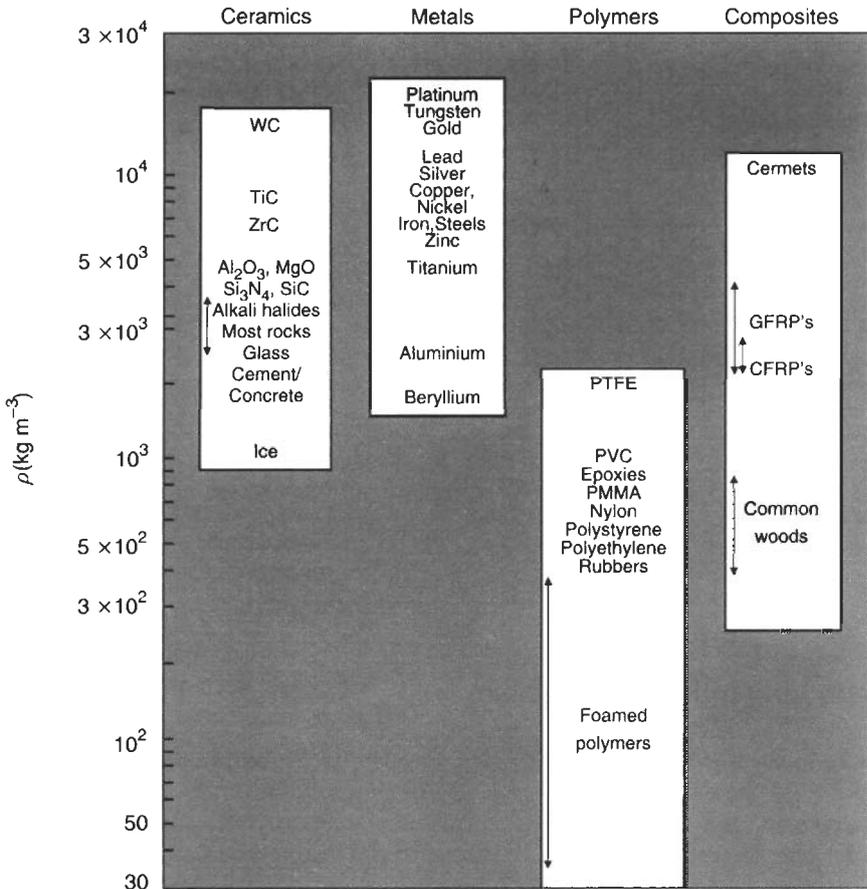


Fig. 5.12. Bar-chart of data for density,  $\rho$ .

5.11(b)) is the material of which milk bottles and window panes are made. Adding boron oxide ( $B_2O_3$ ) instead gives boro-silicate glasses (pyrex is one) which withstand higher temperatures than ordinary window-glass.

## The density of solids

The densities of common engineering materials are listed in Table 5.1 and shown in Fig. 5.12. These reflect the mass and diameter of the atoms that make them up and the efficiency with which they are packed to fill space. Metals, most of them, have high densities because the atoms are heavy and closely packed. Polymers are much less dense because the atoms of which they are made (C, H, O) are light, and because they generally adopt structures which are not close-packed. Ceramics – even the ones in which atoms are packed closely – are, on average, a little less dense than metals because most of them contain light atoms like O, N and C. Composites have densities which are simply an average of the materials of which they are made.

## Further reading

- A. H. Cottrell, *Mechanical Properties of Matter*, Wiley, 1964, Chap. 3 (for metals).
- D. W. Richerson, *Modern Ceramic Engineering*, Marcel Dekker (for ceramics).
- I. M. Ward, *Mechanical Properties of Solid Polymers*, 2nd edition, Wiley, 1983 (for polymers).

# Chapter 6

## The physical basis of Young's modulus

---

### Introduction

We are now in a position to bring together the factors underlying the moduli of materials. First, let us look back to Fig. 3.5, the bar-chart showing the moduli of materials. Recall that most ceramics and metals have moduli in a comparatively narrow range: 30–300 GN m<sup>-2</sup>. Cement and concrete (45 GN m<sup>-2</sup>) are near the bottom of that range. Aluminium (69 GN m<sup>-2</sup>) is higher up; and steels (200 GN m<sup>-2</sup>) are near the top. Special materials, it is true, lie outside it – diamond and tungsten lie above; ice and lead lie a little below – but most crystalline materials lie in that fairly narrow range. Polymers are quite different: all of them have moduli which are smaller, some by several orders of magnitude. Why is this? What determines the general level of the moduli of solids? And is there the possibility of producing stiff polymers?

We shall now examine the modulus of ceramics, metals, polymers and composites, relating it to their structure.

### Moduli of crystals

As we showed in Chapter 4, atoms in crystals are held together by bonds which behave like little springs. We defined the stiffness of one of these bonds as

$$S_0 = \left( \frac{d^2U}{dr^2} \right)_{r=r_0} \quad (6.1)$$

For *small* strains,  $S_0$  stays constant (it is the *spring constant* of the bond). This means that the force between a pair of atoms, stretched apart to a distance  $r$  ( $r \approx r_0$ ), is

$$F = S_0(r - r_0). \quad (6.2)$$

Imagine, now, a solid held together by such little springs, linking atoms between two planes within the material as shown in Fig. 6.1. For simplicity we shall put atoms at the corners of cubes of side  $r_0$ . To be correct, of course, we should draw out the atoms in the positions dictated by the *crystal structure* of a particular material, but we shall not be *too* far out in our calculations by making our simplifying assumption – and it makes drawing the physical situation considerably easier!

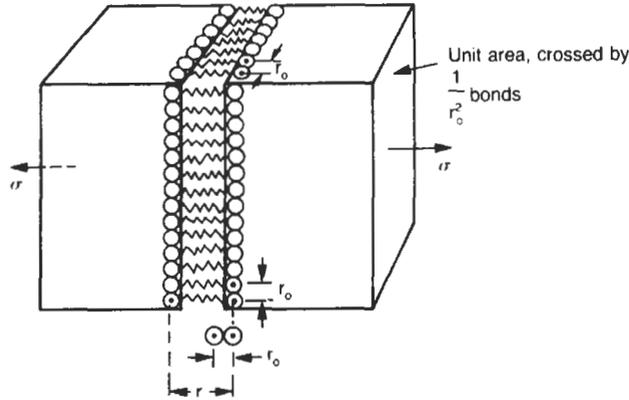


Fig. 6.1. The method of calculating Young's modulus from the stiffnesses of individual bonds.

Now, the total force exerted across *unit area*, if the two planes are pulled apart a distance  $(r - r_0)$  is defined as the stress  $\sigma$ , with

$$\sigma = NS_0(r - r_0). \quad (6.3)$$

$N$  is the number of bonds/unit area, equal to  $1/r_0^2$  (since  $r_0^2$  is the average area-per-atom). We convert displacement  $(r - r_0)$  into strain  $\epsilon_n$  by dividing by the *initial* spacing,  $r_0$ , so that

$$\sigma = \left( \frac{S_0}{r_0} \right) \epsilon_n. \quad (6.4)$$

Young's modulus, then, is just

$$E = \frac{\sigma}{\epsilon_n} = \left( \frac{S_0}{r_0} \right). \quad (6.5)$$

$S_0$  can be calculated from the theoretically derived  $U(r)$  curves of the sort described in Chapter 4. This is the realm of the solid-state physicist and quantum chemist, but we shall consider one example: the ionic bond, for which  $U(r)$  is given in eqn. (4.3). Differentiating once with respect to  $r$  gives the *force* between the atoms, which must, of course, be zero at  $r = r_0$  (because the material would not otherwise be in equilibrium, but would move). This gives the value of the constant  $B$  in equation (4.3):

$$B = \frac{q^2 r_0^{n-1}}{4\pi n \epsilon_0} \quad (6.6)$$

where  $q$  is the electron charge and  $\epsilon_0$  the permittivity of vacuum.

Then eqn. (6.1) for  $S_0$  gives

$$S_0 = \frac{\alpha q^2}{4\pi\epsilon_0 r_0^3} \quad (6.7)$$

where  $\alpha = (n - 1)$ . But the coulombic attraction is a *long-range* interaction (it varies as  $1/r$ ; an example of a short-range interaction is one which varies as  $1/r^{10}$ ). Because of this, a given  $\text{Na}^+$  ion not only interacts (attractively) with its shell of six neighbouring  $\text{Cl}^-$  ions, it also interacts (repulsively) with the 12 slightly more distant  $\text{Na}^+$  ions, with the eight  $\text{Cl}^-$  ions beyond that, and with the six  $\text{Na}^+$  ions which form the shell beyond that. To calculate  $S_0$  properly, we must sum over all these bonds, taking attractions and repulsions properly into account. The result is identical with eqn. (6.7), with  $\alpha = 0.58$ .

The Table of Physical Constants on the inside front cover gives value for  $q$  and  $\epsilon_0$ ; and  $r_0$ , the atom spacing, is close to  $2.5 \times 10^{-10}$  m. Inserting these values gives:

$$S_0 = \frac{0.58 (1.6 \times 10^{-19})^2}{4\pi \times 8.85 \times 10^{-12} (2.5 \times 10^{-10})^3} = 8.54 \text{ Nm}^{-1}.$$

The stiffnesses of other bond types are calculated in a similar way (in general, the cumbersome sum described above is not needed because the interactions are of *short range*). The resulting hierarchy of bond stiffnesses is as shown in Table 6.1.

**Table 6.1**

Bond type	$S_0$ ( $\text{Nm}^{-1}$ )	$E$ (GPa); from eqn. (6.5) (with $r_0 = 2.5 \times 10^{-10}$ m)
Covalent, e.g. C-C	50–180	200–1000
Metallic, e.g. Cu-Cu	15–75	60–300
Ionic, e.g. Na-Cl	8–24	32–96
H-bond, e.g. $\text{H}_2\text{O}-\text{H}_2\text{O}$	2–3	8–12
Van der Waals, e.g. Polymers	0.5–1	2–4


A comparison of these predicted values of  $E$  with the measured values plotted in the bar-chart of Fig. 3.5 shows that, for metals and ceramics, the values of  $E$  we calculate are about right: the bond-stretching idea explains the stiffness of these solids. We can be happy that we can explain the moduli of these classes of solid. But a paradox remains: *there exists a whole range of polymers and rubbers which have moduli which are lower – by up to a factor of 100 – than the lowest we have calculated.* Why is this? What determines the moduli of these floppy polymers if it is not the springs between the atoms? We shall explain this under our next heading.

## Rubbers and the glass transition temperature

All polymers, if really solid, should have moduli above the lowest level we have calculated – about  $2 \text{ GN m}^{-2}$  – since they are held together partly by Van der Waals and partly by covalent bonds. If you take ordinary rubber tubing (a polymer) and cool it down in liquid nitrogen, it becomes stiff – its modulus rises rather suddenly from around  $10^{-2} \text{ GN m}^{-2}$  to a 'proper' value of  $4 \text{ GN m}^{-2}$ . But if you warm it up again, its modulus drops back to  $10^{-2} \text{ GN m}^{-2}$ .

This is because rubber, like many polymers, is composed of long spaghetti-like chains of carbon atoms, all tangled together as we showed in Chapter 5. In the case of rubber, the chains are also lightly cross-linked, as shown in Fig. 5.10. There are covalent bonds along the carbon chain, and where there are occasional cross-links. These are very stiff, but they contribute very little to the overall modulus because when you load the structure it is the flabby Van der Waals bonds *between* the chains which stretch, and it is these which determine the modulus.

Well, that is the case at the low temperature, when the rubber has a 'proper' modulus of a few GPa. As the rubber warms up to room temperature, the Van der Waals bonds *melt*. (In fact, the stiffness of the bond is proportional to its melting point: that is why diamond, which has the highest melting point of any material, also has the highest modulus.) The rubber remains solid because of the cross-links which form a sort of skeleton: but when you load it, the chains now slide over each other in places where there are no cross-linking bonds. This, of course, gives extra strain, and the modulus goes down (remember,  $E = \sigma / \epsilon_n$ ).

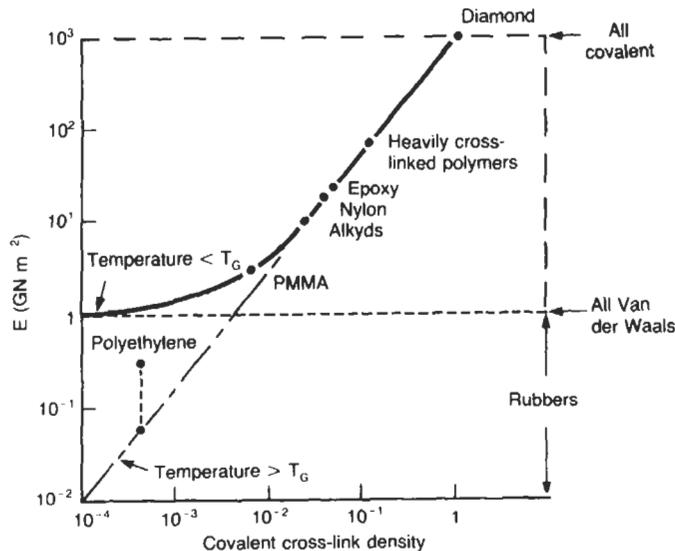

**Fig. 6.2.** How Young's modulus increases with increasing density of covalent cross-links in polymers, including rubbers above the glass temperature. Below  $T_G$ , the modulus of rubbers increases markedly because the Van der Waals bonds take hold. Above  $T_G$  they melt, and the modulus drops.

Many of the most floppy polymers have half-melted in this way at room temperature. The temperature at which this happens is called the *glass temperature*,  $T_G$ , for the polymer. Some polymers, which have no cross-links, melt completely at temperatures above  $T_G$ , becoming viscous liquids. Others, containing cross-links, become *leathery* (like PVC) or *rubbery* (as polystyrene butadiene does). Some typical values for  $T_G$  are: polymethylmethacrylate (PMMA, or perspex), 100°C; polystyrene (PS), 90°C; polyethylene (low-density form), -20°C; *natural* rubber, -40°C. To summarise, above  $T_G$ , the polymer is leathery, rubbery or molten; below, it is a true solid with a modulus of at least 2 GN m<sup>-2</sup>. This behaviour is shown in Fig. 6.2 which also shows how the stiffness of polymers increases as the covalent cross-link density increases, towards the value for diamond (which is simply a polymer with 100% of its bonds cross-linked, Fig. 4.7). Stiff polymers, then, are possible; the stiffest now available have moduli comparable with that of aluminium.

## Composites

Is it possible to make polymers stiffer than the Van der Waals bonds which usually hold them together? The answer is yes – if we mix into the polymer a second, stiffer, material. Good examples of materials stiffened in this way are:

- (a) GFRP – glass-fibre-reinforced polymers, where the polymer is stiffened or reinforced by long fibres of soda glass;
- (b) CFRP – carbon-fibre-reinforced polymers, where the reinforcement is achieved with fibres of graphite;
- (c) KFRP – Kevlar-fibre-reinforced polymers, using Kevlar fibres (a unique polymer with a high density of covalent bonds oriented along the fibre axis) as stiffening;
- (d) FILLED POLYMERS – polymers into which glass powder or silica flour has been mixed to stiffen them;
- (e) WOOD – a natural composite of lignin (an amorphous polymer) stiffened with fibres of cellulose.

The bar-chart of moduli (Fig. 3.5) shows that composites can have moduli much higher than those of their matrices. And it also shows that they can be *very* anisotropic meaning that the modulus is higher in some directions than others. Wood is an example: its modulus, measured parallel to the fibres, is about 10 GN m<sup>-2</sup>; at right angles to this, it is less than 1 GN m<sup>-2</sup>.

There is a simple way to estimate the modulus of a fibre-reinforced composite. Suppose we stress a composite, containing a volume fraction  $V_f$  of fibres, parallel to the fibres (see Fig. 6.3(a)). Loaded in this direction, the strain,  $\epsilon_n$ , in the fibres and the matrix is the same. The stress carried by the composite is

$$\sigma = V_f \sigma_f + (1 - V_f) \sigma_m,$$

where the subscripts  $f$  and  $m$  refer to the fibre and matrix respectively.

Since  $\sigma = E \epsilon_n$ , we can rewrite this as:

$$\sigma = E_f V_f \epsilon_n + E_m (1 - V_f) \epsilon_n.$$

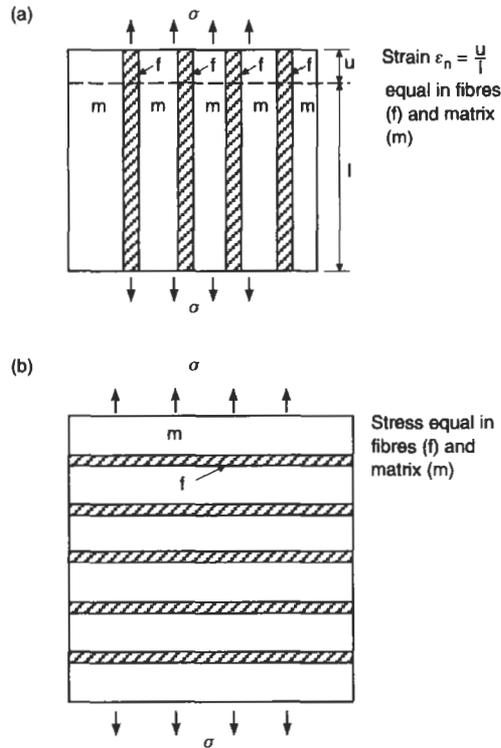


Fig. 6.3. A fibre-reinforced composite loaded in the direction in which the modulus is (a) a maximum, (b) a minimum.

But since  $E_{\text{composite}} = \sigma / \epsilon_n$ , we find

$$E_{\text{composite}} = V_f E_f + (1 - V_f) E_m. \tag{6.8}$$

This gives us an upper estimate for the modulus of our fibre-reinforced composite. The modulus cannot be greater than this, since the strain in the stiff fibres can never be greater than that in the matrix.

How is it that the modulus can be less? Suppose we had loaded the composite in the opposite way, at right angles to the fibres (as in Fig. 6.3(b)) It now becomes much more reasonable to assume that the *stresses*, not the strains, in the two components are equal. If this is so, then the total nominal strain  $\epsilon_n$  is the weighted sum of the individual strains:

$$\epsilon_n = V_f \epsilon_{nf} + (1 - V_f) \epsilon_{nm}.$$

Using  $\epsilon_n = \sigma / E$  gives:

$$\epsilon_n = \frac{V_f \sigma}{E_f} + \left( \frac{1 - V_f}{E_m} \right) \sigma.$$

The modulus is still  $\sigma/\epsilon_n$ , so that

$$E_{\text{composite}} = 1 \left/ \left\{ \frac{V_f}{E_f} + \frac{(1 - V_f)}{E_m} \right\} \right. \quad (6.9)$$

Although it is not obvious, this is a lower limit for the modulus – it cannot be less than this.

The two estimates, if plotted, look as shown in Fig. 6.4. This explains why fibre-reinforced composites like wood and GFRP are so stiff along the reinforced direction (the upper line of the figure) and yet so floppy at right angles to the direction of reinforcement (the lower line), that is, it explains their *anisotropy*. Anisotropy is sometimes what you want – as in the shaft of a squash racquet or a vaulting pole. Sometimes it is not, and then the layers of fibres can be *laminated* in a criss-cross way, as they are in the body shell of a Formula 1 racing car.

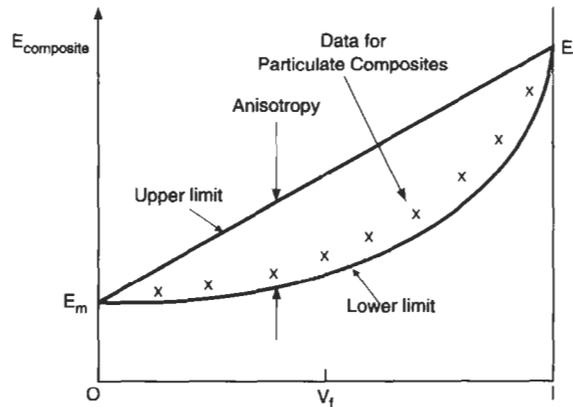


Fig. 6.4. Composite modulus for various volume fractions of stiffener, showing the upper and lower limits of eqns (6.8) and (6.9).

Not all composites contain fibres. Materials can also be stiffened by (roughly spherical) *particles*. The theory is, as one might imagine, more difficult than for fibre-reinforced composites; and is too advanced to talk about here. But it is useful to know that the moduli of these so-called *particulate* composites lie between the upper and lower limits of eqns (6.8) and (6.9), nearer the lower one than the upper one, as shown in Fig. 6.4. Now, it is much cheaper to mix sand into a polymer than to carefully align specially produced glass fibres in the same polymer. Thus the modest increase in stiffness given by particles is economically worthwhile. Naturally the resulting particulate composite is *isotropic*, rather than *anisotropic* as would be the case for the fibre-reinforced composites; and this, too, can be an advantage. These filled polymers can be formed and moulded by normal methods (most fibre-composites cannot) and so are cheap to fabricate. Many of the polymers of everyday life – bits of cars and bikes, household appliances and so on – are, in fact, filled.

## Summary

The moduli of metals, ceramics and glassy polymers below  $T_G$  reflect the stiffness of the bonds which link the atoms. Glasses and glassy polymers above  $T_G$  are leathers, rubbers or viscous liquids, and have much lower moduli. Composites have moduli which are a weighted average of those of their components.

## Further reading

- A. H. Cottrell, *The Mechanical Properties of Matter*, Wiley, 1964, Chap. 4.
- D. Hull, *An Introduction to Composite Materials*, Cambridge University Press, 1981, (for composites).
- C. Kittel, *Introduction to Solid State Physics*, 4th edition, Wiley, 1971, Chaps 3 and 4 (for metals and ceramics).
- P. C. Powell, *Engineering with Polymers*, Chapman and Hall, 1983, Chap. 2 (for polymers).

# Chapter 7

## Case studies of modulus-limited design

---

### CASE STUDY 1: A TELESCOPE MIRROR – INVOLVING THE SELECTION OF A MATERIAL TO MINIMISE THE DEFLECTION OF A DISC UNDER ITS OWN WEIGHT

#### Introduction


The world's largest single-mirror reflecting-telescope is sited on Mount Semivodrike, near Zelenchukskaya in the Caucasus Mountains. The mirror is 6 m (236 inches) in diameter, but it has never worked very well. The largest satisfactory single-mirror reflector is that at Mount Palomar in California; it is 5.08 m (200 inches) in diameter. To be sufficiently rigid, the mirror (which is made of glass) is about 1 m thick and weighs 70 tonnes.\*

The cost of a 5 m telescope is, like the telescope itself, astronomical – about UK£120 m or US\$180 m. This cost varies roughly with the square of the weight of the mirror so it rises very steeply as the diameter of the mirror increases. The mirror itself accounts for about 5% of the total cost of the telescope. The rest goes on the mechanism which holds, positions and moves the mirror as it tracks across the sky (Fig. 7.1). This must be so stiff that it can position the mirror relative to the collecting system with a precision about equal to that of the wavelength of light. At first sight, if you double the mass  $M$  of the mirror, you need only double the sections of the structure which holds it in order to keep the stresses (and hence the strains and deflections) the same, but this is incorrect because the heavier structure deflects under its *own* weight. In practice, you have to add more section to allow for this so that the volume (and thus the cost) of the structure goes as  $M^2$ . The main obstacle to building such large telescopes is the cost.

Before the turn of the century, mirrors were made of speculum metal, a copper–tin alloy (the Earl of Rosse (1800–1867), who lived in Ireland, used one to discover spiral galaxies) but they never got bigger than 1 m because of the weight. Since then, mirrors have been made of glass, silvered on the *front* surface, so none of the optical properties of the glass are used. Glass is chosen for its mechanical properties only; the 70 tonnes of glass is just a very elaborate support for 100 nm (about 30 g) of silver. Could one, by taking a radically new look at mirror design, suggest possible routes to the construction of larger mirrors which are much lighter (and therefore cheaper) than the present ones?

---

\*The world's *largest* telescope is the 10 m Keck reflector. It is made of 36 separate segments each of which is independently controlled.

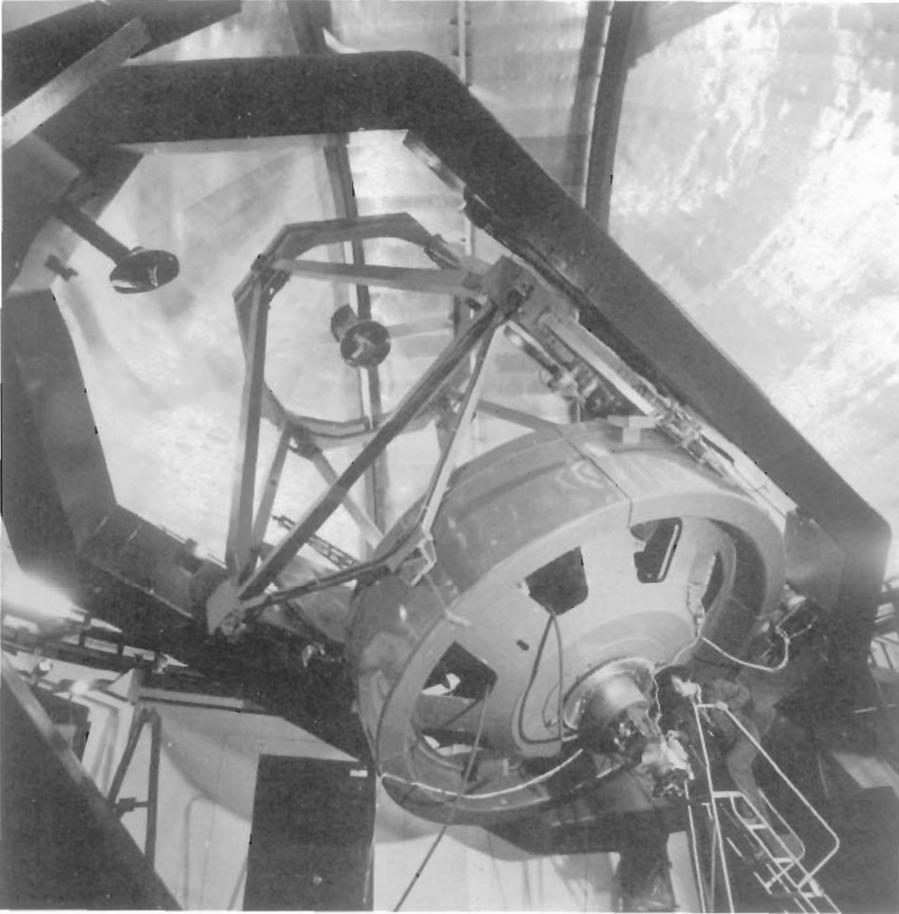


**Fig. 7.1.** The British infrared telescope at Mauna Kea, Hawaii. The picture shows the housing for the 3.8 m diameter mirror, the supporting frame, and the interior of the aluminium dome with its sliding 'window' (© 1979 by Photolabs, Royal Observatory, Edinburgh.)

## Optimum combination of elastic properties for the mirror support

Consider the selection of the material for the mirror backing of a 200-inch (5 m) diameter telescope. We want to identify the material that gives a mirror which will distort by less than the wavelength of light when it is moved, and has minimum weight. We will limit ourselves to these criteria alone for the moment – we will leave the problem of grinding the parabolic shape and getting an optically perfect surface to the development research team.


At its simplest, the mirror is a circular disc, of diameter  $2a$  and mean thickness  $t$ , simply supported at its periphery (Fig. 7.2). When horizontal, it will deflect under its own weight  $M$ ; when vertical it will not deflect significantly. We want this distortion (which changes the focal length and introduces aberrations into the mirror) to be small

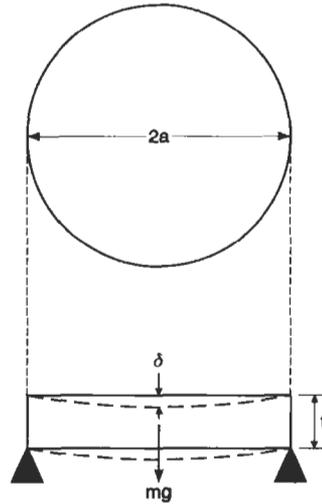

**Fig. 7.2.** The elastic deflection of a telescope mirror, shown for simplicity as a flat-faced disc, under its own weight.

enough that it does not significantly reduce the performance of the mirror. In practice, this means that the deflection  $\delta$  of the mid-point of the mirror must be less than the wavelength of light. We shall require, therefore, that the mirror deflect less than  $\approx 1 \mu\text{m}$  at its centre. This is an exceedingly stringent limitation. Fortunately, it can be *partially* overcome by engineering design without reference to the material used. By using counterbalanced weights or hydraulic jacks, the mirror can be supported by distributed forces over its back surface which are made to vary automatically according to the attitude of the mirror (Fig. 7.3). Nevertheless, the limitations of this compensating system still require that the mirror have a stiffness such that  $\delta$  be less than  $10 \mu\text{m}$ .

You will find the formulae for the elastic deflections of plates and beams under their own weight in standard texts on mechanics or structures (one is listed under 'Further Reading' at the end of this chapter). We need only one formula here: it is that for the deflection,  $\delta$ , of the centre of a horizontal disc, simply supported at its

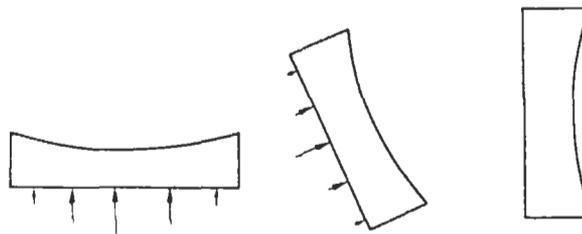

**Fig. 7.3.** The distortion of the mirror under its own weight can be corrected by applying forces (shown as arrows) to the back surface.

periphery (meaning that it rests there but is not clamped) due to its own weight. It is:

$$\delta = \frac{0.67}{\pi} \frac{Mga^2}{Et^3} \quad (7.1)$$

(for a material having a Poisson's ratio fairly close to 0.33). The quantity  $g$  in this equation is the acceleration due to gravity. We need to minimise the mass for fixed values of  $2a$  (5 m) and  $\delta$  (10  $\mu\text{m}$ ). The mass can be expressed in terms of the dimensions of the mirror:

$$M = \pi a^2 t \rho \quad (7.2)$$

where  $\rho$  is the density of the material. We can make it smaller by reducing the thickness  $t$  – but there is a constraint: if we reduce it too much the deflection  $\delta$  of eqn. (7.1) will be too great. So we solve eqn. (7.1) for  $t$  (giving the  $t$  which is just big enough to keep the deflection down to  $\delta$ ) and we substitute this into eqn. (7.2) giving

$$M = \left( \frac{0.67/g}{\delta} \right)^{\frac{1}{2}} \pi a^4 \left( \frac{\rho^3}{E} \right)^{\frac{1}{2}} \quad (7.3)$$

Clearly, the only variables left on the right-hand side of eqn. (7.3) are the *material* properties  $\rho$  and  $E$ . To minimise  $M$ , we must choose a material having the smallest possible value of

$$M_1 = (\rho^3/E)^{\frac{1}{2}} \quad (7.4)$$

where  $M_1$  is called the 'material index'.

Let us now examine its values for some materials. Data for  $E$  we can take from Table 3.1 in Chapter 3; those for density, from Table 5.1 in Chapter 5. The resulting values of the index  $M_1$  are as shown in Table 7.1.

**Table 7.1** Mirror backing for 200-inch telescope

Material	$E$ (GPa)	$\rho$ (Mg m <sup>-3</sup> )	$M_1$	$m$ (tonne)	$t$ (m)
Steel	200	7.8	1.54	199	0.95
Concrete	47	2.5	0.58	53	1.1
Aluminium	69	2.7	0.53	50	0.95
Glass	69	2.5	0.48	45	0.91
GFRP	40	2.0	0.45	42	1.0
Beryllium	290	1.85	0.15	15	0.4
Wood	12	0.6	0.13	13	1.1
Foamed polyurethane	0.06	0.1	0.13	12	6.8
CFRP	270	1.5	0.11	10	0.36

## Conclusions

The optimum material is CFRP. The next best is polyurethane foam. Wood is obviously impractical, but beryllium is good. Glass is better than steel, aluminium or concrete (that is why most mirrors are made of glass), but a lot less good than beryllium, which is used for mirrors when cost is not a concern.

We should, of course, examine other aspects of this choice. The mass of the mirror can be calculated from eqn. (7.3) for the various materials listed in Table 7.1. Note that the polyurethane foam and the CFRP mirrors are roughly one-fifth the weight of the glass one, and that the structure needed to support a CFRP mirror could thus be as much as 25 times less expensive than the structure needed to support an orthodox glass mirror.

Now that we have the mass  $M$ , we can calculate the thickness  $t$  from eqn (7.2). Values of  $t$  for various materials are given in Table 7.1. The glass mirror has to be about 1 m thick (and real mirrors are about this thick); the CFRP-backed mirror need only be 0.38 m thick. The polyurethane foam mirror has to be very thick – although there is no reason why one could not make a 6 m cube of such a foam.

Some of the above solutions – such as the use of polyurethane foam for mirrors – may at first seem ridiculously impractical. But the potential cost-saving (UK£5 m or US\$7.5 m per telescope in place of UK£120 m or US\$180 m) is so attractive that they are worth examining closely. There are ways of casting a thin film of silicone rubber, or of epoxy, onto the surface of the mirror-backing (the polyurethane or the CFRP) to give an optically smooth surface which could be silvered. The most obvious obstacle is the lack of stability of polymers – they change dimensions with age, humidity, temperature and so on. But glass itself can be foamed to give a material with a density not much larger than polyurethane foam, and the same stability as solid glass, so a study of this sort can suggest radically new solutions to design problems by showing how new classes of materials might be used.

## CASE STUDY 2: MATERIALS SELECTION TO GIVE A BEAM OF A GIVEN STIFFNESS WITH MINIMUM WEIGHT

### Introduction

Many structures require that a beam sustain a certain force  $F$  without deflecting more than a given amount,  $\delta$ . If, in addition, the beam forms part of a transport system – a plane or rocket, or a train – or something which has to be carried or moved – a rucksack for instance – then it is desirable, also, to minimise the weight.

In the following, we shall consider a single cantilever beam, of square section, and will analyse the material requirements to minimise the weight for a given stiffness. The results are quite general in that they apply equally to any sort of beam of square section, and can easily be modified to deal with beams of other sections: tubes, I-beams, box-sections and so on.

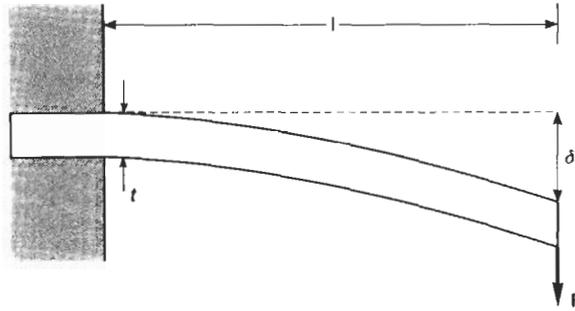


Fig. 7.4. The elastic deflection  $\delta$  of a cantilever beam of length  $l$  under an externally imposed force  $F$ .

## Analysis

The square-section beam of length  $l$  (determined by the design of the structure, and thus fixed) and thickness  $t$  (a variable) is held rigidly at one end while a force  $F$  (the maximum service force) is applied to the other, as shown in Fig. 7.4. The same texts that list the deflection of discs give equations for the elastic deflection of beams. The formula we want is

$$\delta = \frac{4l^3F}{Et^4} \quad (7.5)$$

(ignoring self-weight).

The mass of the beam is given by

$$M = lt^2\rho. \quad (7.6)$$

As before, the mass of the beam can be reduced by reducing  $t$ , but only so far that it does not deflect too much. The thickness is therefore *constrained* by eqn. (7.5). Solving this for  $t$  and inserting it into the last equation gives:

$$M = \left(\frac{4l^5F}{\delta}\right)^{\frac{1}{2}} \left(\frac{\rho^2}{E}\right)^{\frac{1}{2}}. \quad (7.7)$$

The mass of the beam, for given stiffness  $F/\delta$ , is minimised by selecting a material with the minimum value of the material index

$$M_2 = \left(\frac{\rho^2}{E}\right)^{\frac{1}{2}}. \quad (7.8)$$

The second column of numbers in Table 7.2 gives values for  $M_2$ .

**Table 7.2** Data for beam of given stiffness

Material	$M_2$	$\bar{p}$ (UK£ tonne <sup>-1</sup> ) (US\$ tonne <sup>-1</sup> )	$M_3$
Steel	0.55	300 (450)	165
Polyurethane foam	0.41	1500 (2250)	615
Concrete	0.36	160 (240)	58
Aluminium	0.32	1100 (1650)	350
GFRP	0.31	2000 (3000)	620
Wood	0.17	200 (300)	34
CFRP	0.09	50,000 (75,000)	4500

## Conclusions

The table shows that wood is one of the best materials for stiff beams – that is why it is so widely used in small-scale building, for the handles of rackets and shafts of golf-clubs, for vaulting poles, even for building aircraft. Polyurethane foam is no good at all – the criteria here are quite different from those of the first case study. The only material which is clearly superior to wood is CFRP – and it would reduce the mass of the beam very substantially: by the factor 0.17/0.09, or very nearly a factor of 2. That is why CFRP is used when weight-saving is the overriding design criterion. But as we shall see in a moment, it is very expensive.

Why, then, are bicycles not made of wood? (There was a time when they were.) That is because metals, and polymers, too, can readily be made in tubes; with wood it is more difficult. The formula for the bending of a tube depends on the mass of the tube in a different way than does that of a solid beam, and the optimisation we have just performed – which is easy enough to redo – favours the tube.

## CASE STUDY 3: MATERIALS SELECTION TO MINIMISE COST OF A BEAM OF GIVEN STIFFNESS

### Introduction

Often it is not the weight, but the *cost* of a structure which is the overriding criterion. Suppose that had been the case with the cantilever beam that we have just considered – would our conclusion have been the same? Would we still select wood? And how much more expensive would a replacement by CFRP be?

### Analysis

The price per tonne,  $\bar{p}$ , of materials is the first of the properties that we talked about in this book. The total price of the beam, crudely, is the weight of the beam times  $\bar{p}$

(although this may neglect certain aspects of manufacture). Thus

$$\text{Price} = \left( \frac{4l^5 F}{\delta} \right)^{\frac{1}{2}} \bar{p} \left( \frac{\rho^2}{E} \right)^{\frac{1}{2}}. \quad (7.9)$$

The beam of minimum price is therefore the one with the lowest value of the index

$$M_3 = \bar{p} \left( \frac{\rho}{E} \right)^{\frac{1}{2}}. \quad (7.10)$$

Values for  $M_3$  are given in Table 7.2, with prices taken from the table in Chapter 2.

## Conclusions

Concrete and wood are the cheapest materials to use for a beam having a given stiffness. Steel costs more; but it can be rolled to give I-section beams which have a much better stiffness-to-weight ratio than the solid square-section beam we have been analysing here. This compensates for steel's rather high cost, and accounts for the interchangeable use of steel, wood and concrete that we talked about in bridge construction in Chapter 1. Finally, the lightest beam (CFRP) costs more than 100 times that of a wooden one – and this cost at present rules out CFRP for all but the most specialised applications like aircraft components or sophisticated sporting equipment. But the cost of CFRP falls as the market for it expands. If (as now seems possible) its market continues to grow, its price could fall to a level at which it would compete with metals in many applications.

## Further reading

- M. F. Ashby, *Materials Selection in Mechanical Design*, Pergamon Press, Oxford, 1992 (for material indices).
- M. F. Ashby and D. Cebon, *Case Studies in Materials Selection*, Granta Design, Cambridge, 1996.
- S. Marx and W. Pfau, *Observatories of the World*, Blandford Press, Poole, Dorset, 1982 (for telescopes).
- Roawle's Formulas for Stress and Strain*, 6th edn, McGraw-Hill, 1989.



## **C. Yield strength, tensile strength, hardness and ductility**

---



# Chapter 8

## The yield strength, tensile strength, hardness and ductility

---

### Introduction

All solids have an *elastic limit* beyond which something happens. A totally brittle solid will fracture, either suddenly (like glass) or progressively (like cement or concrete). Most engineering materials do something different; they deform *plastically* or change their shapes in a *permanent* way. It is important to know when, and how, they do this – both so that we can design structures which will withstand normal service loads without any permanent deformation, and so that we can design rolling mills, sheet presses, and forging machinery which will be strong enough to impose the desired deformation onto materials we wish to form. To study this, we pull carefully prepared samples in a tensile-testing machine, or compress them in a compression machine (which we will describe in a moment), and record the *stress* required to produce a given *strain*.

### Linear and non-linear elasticity; anelastic behaviour

Figure 8.1 shows the *stress–strain* curve of a material exhibiting *perfectly linear elastic* behaviour. This is the behaviour characterised by Hooke's Law (Chapter 3). All solids are linear elastic at small strains – by which we usually mean less than 0.001, or 0.1%. The slope of the stress–strain line, which is the same in compression as in tension, is of


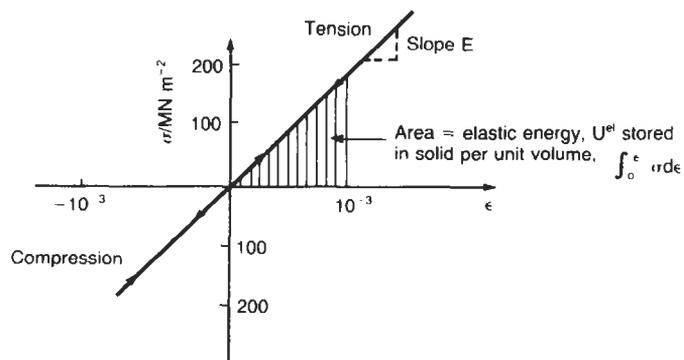


Fig. 8.1. Stress–strain behaviour for a *linear elastic solid*. The axes are calibrated for a material such as steel.

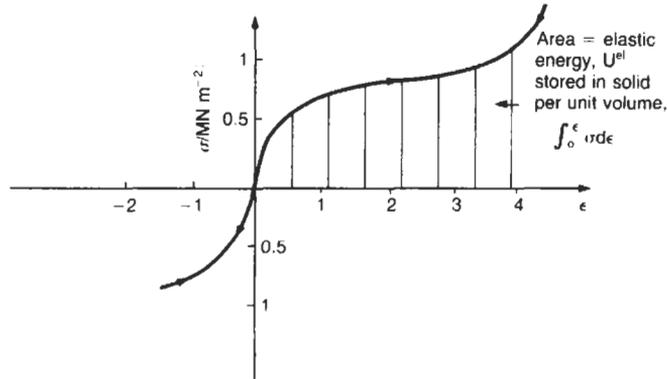


**Fig. 8.2.** Stress–strain behaviour for a *non-linear elastic solid*. The axes are calibrated for a material such as rubber.

course Young's Modulus,  $E$ . The area (shaded) is the elastic energy stored, per unit volume: since it is an elastic solid, we can get it all back if we unload the solid, which behaves like a linear spring.

Figure 8.2 shows a *non-linear elastic solid*. *Rubbers* have a stress-strain curve like this, extending to very large strains (of order 5). The material is still elastic: if unloaded, it follows the same path down as it did up, and all the energy stored, per unit volume, during loading is recovered on unloading – that is why catapults can be as lethal as they are.

Finally, Fig. 8.3 shows a third form of *elastic* behaviour found in certain materials. This is called *anelastic* behaviour. All solids are anelastic to a small extent: even in the régime where they are nominally elastic, the loading curve does not *exactly* follow the unloading curve, and energy is dissipated (equal to the shaded area) when the solid is cycled. Sometimes this is useful – if you wish to damp out vibrations or noise, for example; you

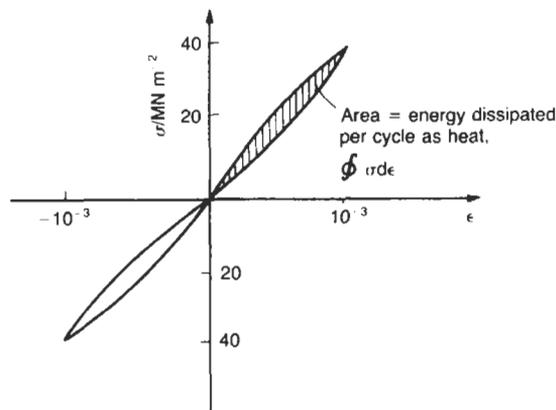

**Fig. 8.3.** Stress–strain behaviour for an *anelastic solid*. The axes are calibrated for fibreglass.

can do so with polymers or with soft metals (like lead) which have a high *damping capacity* (high anelastic loss). But often such damping is undesirable – springs and bells, for instance, are made of materials with the lowest possible damping capacity (spring steel, bronze, glass).

### Load-extension curves for non-elastic (plastic) behaviour

Rubbers are exceptional in behaving reversibly, or *almost* reversibly, to high strains; as we said, *almost all materials, when strained by more than about 0.001 (0.1%), do something irreversible*: and most engineering materials deform *plastically* to change their shape *permanently*. If we load a piece of ductile metal (like copper), for example in tension, we get the following relationship between the load and the extension (Fig. 8.4). This can be

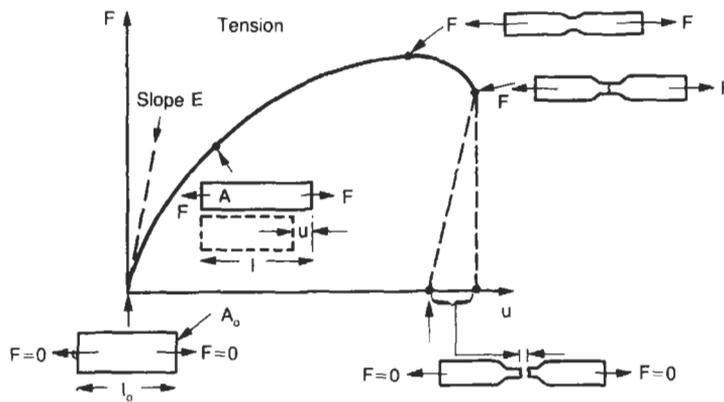


Fig. 8.4. Load-extension curve for a bar of ductile metal (e.g. annealed copper) pulled in tension.

demonstrated nicely by pulling a piece of plasticine (a ductile non-metallic material). Initially, the plasticine deforms elastically, but at a small strain begins to deform plastically, so that if the load is removed, the piece of plasticine is permanently longer than it was at the beginning of the test: it has undergone *plastic* deformation (Fig. 8.5). If you continue to pull, it continues to get longer, at the same time getting thinner because in plastic deformation *volume is conserved* (matter is just flowing from place to place). Eventually, the plasticine becomes unstable and begins to *neck* at the maximum load point in the force-extension curve (Fig. 8.4). Necking is an *instability* which we shall look at in more detail in Chapter 11. The neck then grows quite rapidly, and the load that the specimen can bear through the neck decreases until breakage takes place. The two pieces produced *after* breakage have a total length that is slightly *less* than the length *just* before breakage by the amount of the *elastic* extension produced by the terminal load.

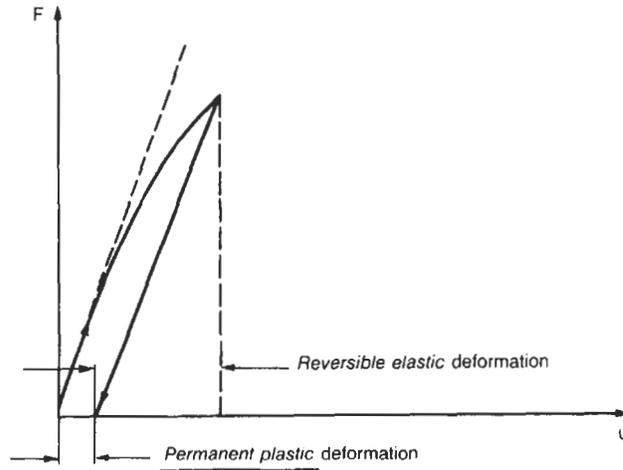


Fig. 8.5.

If we load a material in *compression*, the force–displacement curve is simply the reverse of that for tension at *small strains*, but it becomes different at larger strains. As the specimen squashes down, becoming shorter and fatter to conserve volume, the load needed to keep it flowing rises (Fig. 8.6). No instability such as necking appears, and the specimen can be squashed almost indefinitely, this process only being limited eventually by severe cracking in the specimen or the plastic flow of the compression plates.

Why this great difference in behaviour? After all, we are dealing with the same material in either case.

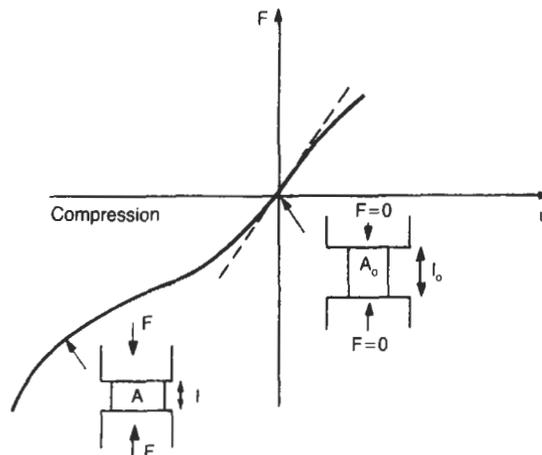


Fig. 8.6.

### True stress–strain curves for plastic flow

The apparent difference between the curves for tension and compression is due solely to the geometry of testing. If, instead of plotting load, we plot load divided by the actual area of the specimen,  $A$ , at any particular elongation or compression, the two curves become much more like one another. In other words, we simply plot true stress (see Chapter 3) as our vertical co-ordinate (Fig. 8.7). This method of plotting allows for the *thinning* of the material when pulled in tension, or the *fattening* of the material when compressed.

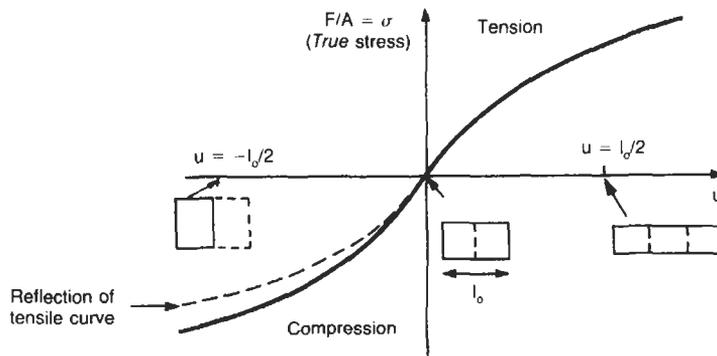


Fig. 8.7.

But the two curves still do not exactly match, as Fig. 8.7 shows. The reason is a displacement of (for example)  $u = l_0/2$  in tension and compression gives different strains; it represents a drawing out of the tensile specimen from  $l_0$  to  $1.5l_0$ , but a squashing down of the compressive specimen from  $l_0$  to  $0.5l_0$ . The material of the compressive specimen has thus undergone *much* more plastic deformation than the material in the tensile specimen, and can hardly be expected to be in the same state, or to show the same resistance to plastic deformation. The two conditions can be compared properly by taking small strain increments

$$\delta\epsilon = \frac{\delta u}{l} = \frac{\delta l}{l} \tag{8.1}$$

about which the state of the material is the same for either tension or compression (Fig. 8.8). This is the same as saying that a decrease in length from 100 mm ( $l_0$ ) to 99 mm ( $l$ ), or an increase in length from 100 mm ( $l_0$ ) to 101 mm ( $l$ ) both represent a 1% change in the state of the material. Actually, they do not *quite* give exactly 1% in both cases, of course, but they *do* in the limit

$$d\epsilon = \frac{dl}{l}. \tag{8.2}$$

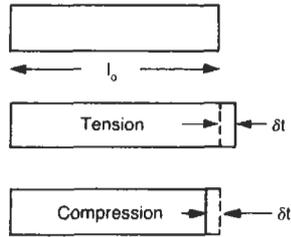


Fig. 8.8.

Then, if the stresses in compression and tension are plotted against

$$\epsilon = \int_{l_0}^l \frac{dl}{l} = \ln \left( \frac{l}{l_0} \right) \quad (8.3)$$

the two curves *exactly* mirror one another (Fig. 8.9). The quantity  $\epsilon$  is called the *true strain* (to be contrasted with the *nominal strain*  $u/l_0$  (defined in Chapter 3)) and the matching curves are *true stress/true strain* ( $\sigma/\epsilon$ ) curves. Now, a final catch. We can, from our original load–*extension* or load–*compression* curves easily calculate  $\epsilon$ , simply by knowing  $l_0$  and taking natural logs. But how do we calculate  $\sigma$ ? Because volume is conserved during plastic deformation we can write, at any strain,

$$A_0 l_0 = A l$$

provided the extent of plastic deformation is much greater than the extent of elastic deformation (this is usually the case, but the qualification must be mentioned because

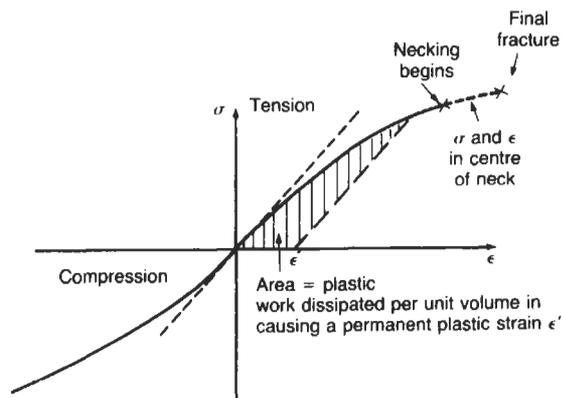


Fig. 8.9.

volume is only conserved during *elastic* deformation if Poisson's ratio  $\nu = 0.5$ ; and, as we showed in Chapter 3, it is near 0.33 for most materials). Thus

$$A = \frac{A_0 l_0}{l} \quad (8.4)$$

and

$$\sigma = \frac{F}{A} = \frac{Fl}{A_0 l_0}, \quad (8.5)$$

all of which we know or can measure easily.

### Plastic work

When metals are rolled or forged, or drawn to wire, or when polymers are injection-moulded or pressed or drawn, energy is absorbed. The work done on a material to change its shape permanently is called the *plastic work*; its value, per unit volume, is the area of the cross-hatched region shown in Fig. 8.9; it may easily be found (if the stress-strain curve is known) for any amount of permanent plastic deformation,  $\epsilon'$ . Plastic work is important in metal- and polymer-forming operations because it determines the forces that the rolls, or press, or moulding machine must exert on the material.

### Tensile testing

The plastic behaviour of a material is usually measured by conducting a tensile test. Tensile testing equipment is standard in all engineering laboratories. Such equipment produces a load/displacement ( $F/u$ ) curve for the material, which is then converted to a nominal stress/nominal strain, or  $\sigma_n/\epsilon_n$ , curve (Fig. 8.10), where

$$\sigma_n = \frac{F}{A_0} \quad (8.6)$$

and

$$\epsilon_n = \frac{u}{l_0} \quad (8.7)$$

(see Chapter 3, and above). Naturally, because  $A_0$  and  $l_0$  are constant, the *shape* of the  $\sigma_n/\epsilon_n$  curve is identical to that of the load-extension curve. But the  $\sigma_n/\epsilon_n$  plotting method allows one to compare data for specimens having different (though now standardised)  $A_0$  and  $l_0$ , and thus to examine the properties of *material*, unaffected by specimen size. The advantage of keeping the stress in *nominal* units and not converting to *true* stress (as shown above) is that the onset of necking can clearly be seen on the  $\sigma_n/\epsilon_n$  curve.

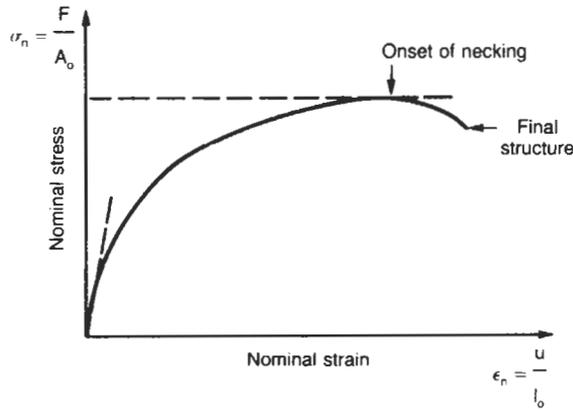


Fig. 8.10

Now, let us define the quantities usually listed as the results of a *tensile test*. The easiest way to do this is to show them on the  $\sigma_n/\epsilon_n$  curve itself (Fig. 8.11). They are:

- $\sigma_y$  Yield strength ( $F/A_0$  at onset of plastic flow).
- $\sigma_{0.1\%}$  0.1% Proof stress ( $F/A_0$  at a permanent strain of 0.1%) (0.2% proof stress is often quoted instead. Proof stress is useful for characterising yield of a material that yields gradually, and does not show a distinct yield point.)
- $\sigma_{TS}$  Tensile strength ( $F/A_0$  at onset of necking).
- $\epsilon_f$  (Plastic) strain after fracture, or tensile ductility. The broken pieces are put together and measured, and  $\epsilon_f$  calculated from  $(l - l_0)/l_0$ , where  $l$  is the length of the assembled pieces.

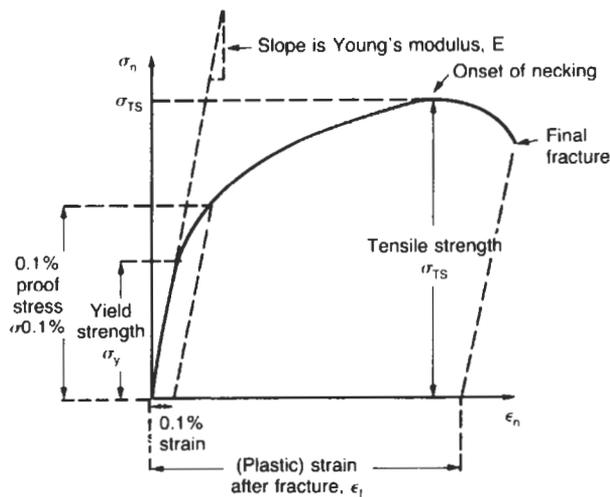


Fig. 8.11.

## Data

Data for the *yield strength*, *tensile strength* and the *tensile ductility* are given in Table 8.1 and shown on the bar-chart (Fig. 8.12). Like moduli, they span a range of about  $10^6$ : from about  $0.1 \text{ MN m}^{-2}$  (for polystyrene foams) to nearly  $10^5 \text{ MN m}^{-2}$  (for diamond).

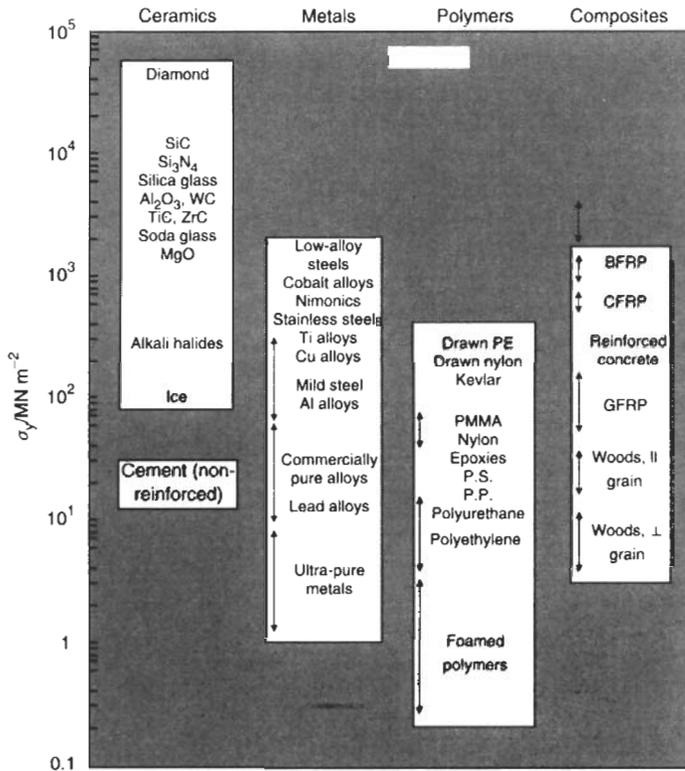


Fig. 8.12. Bar-chart of data for yield strength,  $\sigma_y$ .

Most ceramics have enormous yield stresses. In a tensile test, at room temperature, ceramics almost all fracture long before they yield: this is because their fracture toughness, which we will discuss later, is very low. Because of this, you cannot measure the yield strength of a ceramic by using a tensile test. Instead, you have to use a test which somehow suppresses fracture: a compression test, for instance. The best and easiest is the hardness test: the data shown here are obtained from hardness tests, which we shall discuss in a moment.

Pure metals are very soft indeed, and have a high ductility. This is what, for centuries, has made them so attractive at first for jewellery and weapons, and then for other implements and structures: they can be *worked* to the shape that you want them in; furthermore, their ability to work-harden means that, after you have finished, the

**Table 8.1** Yield strength,  $\sigma_y$ , tensile strength,  $\sigma_{TS}$ , and tensile ductility,  $\epsilon_f$ 

Material	$\sigma_y/\text{MN m}^{-2}$	$\sigma_{TS}/\text{MN m}^{-2}$	$\epsilon_f$
Diamond	50 000	–	0
Silicon carbide, SiC	10 000	–	0
Silicon nitride, Si <sub>3</sub> N <sub>4</sub>	8 000	–	0
Silica glass, SiO <sub>2</sub>	7 200	–	0
Tungsten carbide, WC	6 000	–	0
Niobium carbide, NbC	6 000	–	0
Alumina, Al <sub>2</sub> O <sub>3</sub>	5 000	–	0
Beryllia, BeO	4 000	–	0
Mullite	4 000	–	0
Titanium carbide, TiC	4 000	–	0
Zirconium carbide, ZrC	4 000	–	0
Tantalum carbide, TaC	4 000	–	0
Zirconia, ZrO <sub>2</sub>	4 000	–	0
Soda glass (standard)	3 600	–	0
Magnesia, MgO	3 000	–	0
Cobalt and alloys	180–2000	500–2500	0.01–6
Low-alloy steels (water-quenched and tempered)	500–1980	680–2400	0.02–0.3
Pressure-vessel steels	1500–1900	1500–2000	0.3–0.6
Stainless steels, austenitic	286–500	760–1280	0.45–0.65
Boron/epoxy composites (tension–compression)	–	725–1730	–
Nickel alloys	200–1600	400–2000	0.01–0.6
Nickel	70	400	0.65
Tungsten	1 000	1510	0.01–0.6
Molybdenum and alloys	560–1450	665–1650	0.01–0.36
Titanium and alloys	180–1320	300–1400	0.06–0.3
Carbon steels (water-quenched and tempered)	260–1300	500–1880	0.2–0.3
Tantalum and alloys	330–1090	400–1100	0.01–0.4
Cast irons	220–1030	400–1200	0–0.18
Copper alloys	60–960	250–1000	0.01–0.55
Copper	60	400	0.55
Cobalt/tungsten carbide cermets	400–900	900	0.02
CFRPs (tension–compression)	–	670–640	–
Brasses and bronzes	70–640	230–890	0.01–0.7
Aluminium alloys	100–627	300–700	0.05–0.3
Aluminium	40	200	0.5
Stainless steels, ferritic	240–400	500–800	0.15–0.25
Zinc alloys	160–421	200–500	0.1–1.0
Concrete, steel reinforced (tension or compression)	–	410	0.02
Alkali halides	200–350	–	0
Zirconium and alloys	100–365	240–440	0.24–0.37
Mild steel	220	430	0.18–0.25
Iron	50	200	0.3
Magnesium alloys	80–300	125–380	0.06–0.20
GFRPs	–	100–300	–
Beryllium and alloys	34–276	380–620	0.02–0.10
Gold	40	220	0.5
PMMA	60–110	110	0.03–0.05
Epoxies	30–100	30–120	–
Polyimides	52–90	–	–

Table 8.1 (Continued)

Material	$\sigma_y/\text{MNm}^{-2}$	$\sigma_{TS}/\text{MNm}^{-2}$	$\epsilon_f$
Nylons	49–87	100	–
Ice	85	–	0
Pure ductile metals	20–80	200–400	0.5–1.5
Polystyrene	34–70	40–70	–
Silver	55	300	0.6
ABS/polycarbonate	55	60	–
Common woods (compression,    to grain)	–	35–55	–
Lead and alloys	11–55	14–70	0.2–0.8
Acrylic/PVC	45–48	–	–
Tin and alloys	7–45	14–60	0.3–0.7
Polypropylene	19–36	33–36	–
Polyurethane	26–31	58	–
Polyethylene, high density	20–30	37	–
Concrete, non-reinforced, compression	20–30	–	0
Natural rubber	–	30	5.0
Polyethylene, low density	6–20	20	–
Common woods (compression, $\perp$ to grain)	–	4–10	–
Ultrapure f.c.c. metals	1–10	200–400	1–2
Foamed polymers, rigid	0.2–10	0.2–10	0.1–1
Polyurethane foam	1	1	0.1–1

metal is much stronger than when you started. By alloying, the strength of metals can be further increased, though – in yield strength – the strongest metals still fall short of most ceramics.

Polymers, in general, have lower yield strengths than metals. The very strongest (and, at present, these are produced only in small quantities, and are expensive) barely reach the strength of aluminium alloys. They can be strengthened, however, by making composites out of them: GFRP has a strength only slightly inferior to aluminium, and CFRP is substantially stronger.

## The hardness test

This consists of loading a pointed diamond or a hardened steel ball and pressing it into the surface of the material to be examined. The further into the material the ‘indenter’ (as it is called) sinks, the *softer* is the material and the lower its yield strength. The *true hardness* is defined as the load ( $F$ ) divided by the projected area of the ‘indent’,  $A$ . (The Vickers hardness,  $H_v$ , unfortunately was, and still is, defined as  $F$  divided by the total surface area of the ‘indent’. Tables are available to relate  $H$  to  $H_v$ .)

The yield strength can be found from the relation (derived in Chapter 11)

$$H = 3\sigma_y \quad (8.8)$$

but a correction factor is needed for materials which work-harden appreciably.

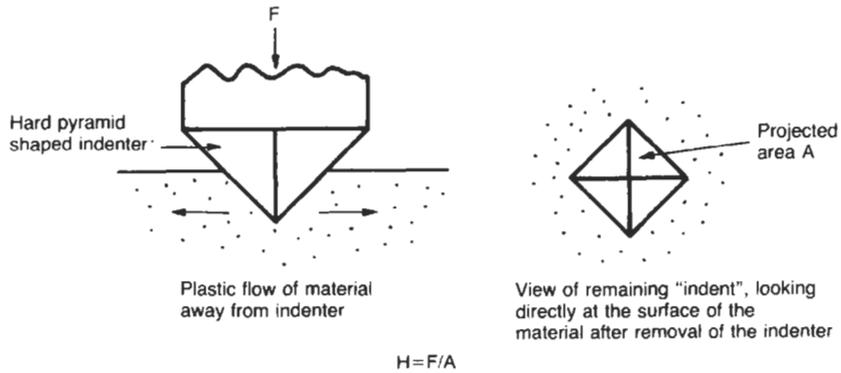


Fig. 8.13. The hardness test for yield strength.

As well as being a good way of measuring the yield strengths of materials like ceramics, as we mentioned above, the hardness test is also a very simple and cheap *non-destructive test for  $\sigma_y$* . There is no need to go to the expense of making tensile specimens, and the hardness indenter is so small that it scarcely damages the material. So it can be used for routine batch tests on materials to see if they are up to specification on  $\sigma_y$  without damaging them.

### Further reading

K. J. Pascoe, *An Introduction to the Properties of Engineering Materials*, 3rd edition, Van Nostrand, 1978, Chap. 12.  
 Smithells' *Metals Reference Book*, 7th edition, Butterworth-Heinemann, 1992 (for data).

### Revision of the terms mentioned in this chapter, and some useful relations

$\sigma_n$ , nominal stress

$$\sigma_n = F/A_0. \tag{8.9}$$

$\sigma$ , true stress

$$\sigma = F/A. \tag{8.10}$$

$\epsilon_n$ , nominal strain

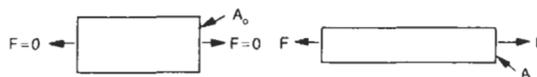


Fig. 8.14.

$$\epsilon_n = \frac{u}{l_0}, \text{ or } \frac{l - l_0}{l_0}, \text{ or } \frac{l}{l_0} - 1. \quad (8.11)$$

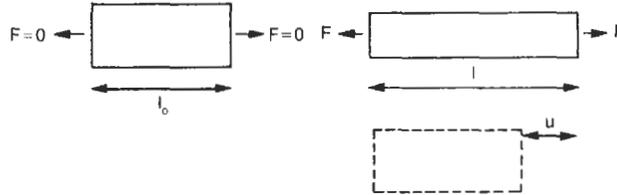


Fig. 8.15.

### Relations between $\sigma_n$ , $\sigma$ , and $\epsilon_n$

Assuming constant volume (valid if  $\nu = 0.5$  or, if not, plastic deformation  $\gg$  elastic deformation):

$$A_0 l_0 = Al; \quad A_0 = \frac{Al}{l_0} = A(1 + \epsilon_n). \quad (8.12)$$

Thus

$$\sigma = \frac{F}{A} = \frac{F}{A_0} (1 + \epsilon_n) = \sigma_n (1 + \epsilon_n). \quad (8.13)$$

### $\epsilon$ , true strain and the relation between $\epsilon$ and $\epsilon_n$

$$\epsilon = \int_{l_0}^l \frac{dl}{l} = \ln \left( \frac{l}{l_0} \right). \quad (8.14)$$

Thus

$$\epsilon = \ln (1 + \epsilon_n). \quad (8.15)$$

### Small strain condition

For small  $\epsilon_n$

$$\epsilon \approx \epsilon_n, \quad \text{from } \epsilon = \ln (1 + \epsilon_n), \quad (8.16)$$

$$\sigma \approx \sigma_n, \quad \text{from } \sigma = \sigma_n (1 + \epsilon_n). \quad (8.17)$$

Thus, when dealing with most *elastic* strains (but not in rubbers), it is immaterial whether  $\epsilon$  or  $\epsilon_n$ , or  $\sigma$  or  $\sigma_n$  are chosen.

Energy

The energy expended in deforming a material *per unit volume* is given by the area under the stress-strain curve. For example,

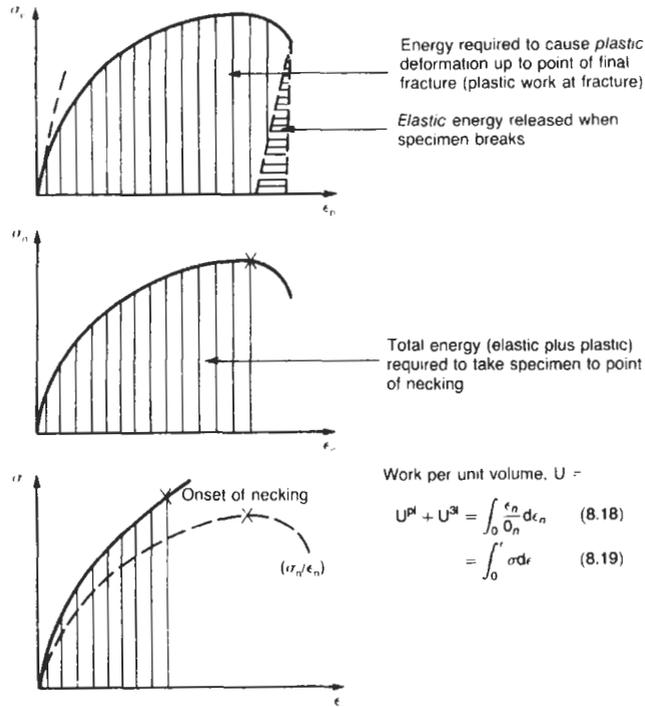


Fig. 8.16.

For linear elastic strains, and only linear elastic strains,

$$\frac{\sigma_n}{\epsilon_n} = E, \text{ and } U^{el} = \int \sigma_n d\epsilon_n = \int \sigma_n \frac{d\sigma_n}{E} = \left\{ \frac{\sigma_n^2}{2E} \right\}. \quad (8.20)$$

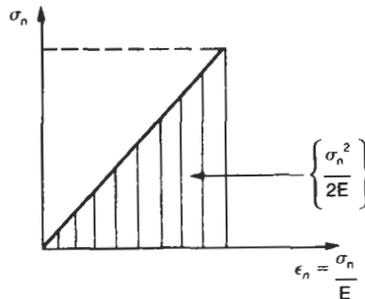


Fig. 8.17.

### Elastic limit

In a tensile test, as the load increases, the specimen at first is strained *elastically*, that is reversibly. Above a limiting stress – the elastic limit – some of the strain is permanent; this is *plastic* deformation.

### Yielding

The change from elastic to measurable plastic deformation.

### Yield strength

The nominal stress at yielding. In many materials this is difficult to spot on the stress–strain curve and in such cases it is better to use a proof stress.

### Proof stress

The stress which produces a permanent strain equal to a specified percentage of the specimen length. A common proof stress is one corresponding to 0.1% permanent strain.

### Strain hardening (work-hardening)

The increase in stress needed to produce further strain in the plastic region. Each strain increment strengthens or hardens the material so that a larger stress is needed for further strain.

$\sigma_{TS}$ , tensile strength (in old books, ultimate tensile strength, or UTS)

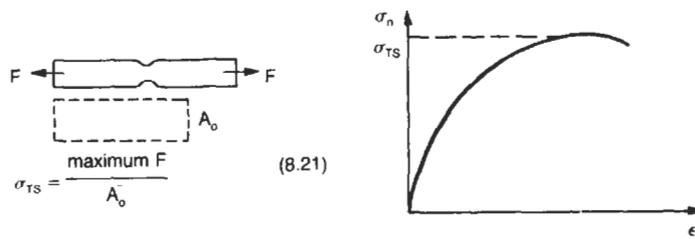
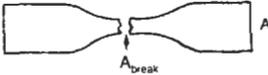


Fig. 8.18.

$\epsilon_f$ , strain after fracture, or tensile ductility

The permanent extension in length (measured by fitting the broken pieces together) expressed as a percentage of the original gauge length.

$$\left\{ \frac{l_{\text{break}} - l_0}{l_0} \right\} \times 100. \tag{8.22}$$

$$\left\{ \frac{A_0 - A_{\text{break}}}{A_0} \right\} \times 100 \quad (8.23)$$
The diagram shows a tensile specimen with a central necked region. The original cross-sectional area is labeled  $A_0$  and the area at the fracture is labeled  $A_{\text{break}}$ . The specimen is shown in a state of fracture, with the necked region having broken.

**Fig. 8.19.**

### Reduction in area at break

The maximum decrease in cross-sectional area at the fracture expressed as a percentage of the original cross-sectional area.

Strain after fracture and percentage reduction in area are used as measures of ductility, i.e. the ability of a material to undergo large plastic strain under stress before it fractures.

# Chapter 9

## Dislocations and yielding in crystals

---

### Introduction

In the last chapter we examined data for the yield strengths exhibited by materials. But what would we expect? From our understanding of the structure of solids and the stiffness of the bonds between the atoms, can we estimate what the yield strength should be? A simple calculation (given in the next section) overestimates it grossly. This is because real crystals contain defects, *dislocations*, which move easily. When they move, the crystal deforms; the stress needed to move them is the yield strength. Dislocations are the *carriers* of deformation, much as electrons are the carriers of charge.

### The strength of a perfect crystal

As we showed in Chapter 6 (on the modulus), the slope of the interatomic force–distance curve at the equilibrium separation is proportional to Young’s modulus  $E$ . Interatomic forces typically drop off to negligible values at a distance of separation of the atom centres of  $2r_0$ . The maximum in the force–distance curve is typically reached at  $1.25r_0$  separation, and if the stress applied to the material is sufficient to exceed this maximum force per *bond*, fracture is bound to occur. We will denote the stress at which this bond rupture takes place by  $\bar{\sigma}$ , the *ideal strength*; a material cannot be stronger than this. From Fig. 9.1

$$\begin{aligned}\sigma &= E\epsilon, \\ 2\bar{\sigma} &\approx E \frac{0.25r_0}{r_0} \approx \frac{E}{4}, \\ \bar{\sigma} &\approx \frac{E}{8}.\end{aligned}\tag{9.1}$$

More refined estimates of  $\bar{\sigma}$  are possible, using real interatomic potentials (Chapter 4): they give about  $E/15$  instead of  $E/8$ .

Let us now see whether materials really show this strength. The bar-chart (Fig. 9.2) shows values of  $\sigma_y/E$  for materials. The heavy broken line at the top is drawn at the level  $\sigma/E = 1/15$ . Glasses, and some ceramics, lie close to this line – they exhibit their ideal strength, and we could not expect them to be stronger than this. Most polymers, too, lie near the line – although they have low yield strengths, these are low because the *moduli* are low.

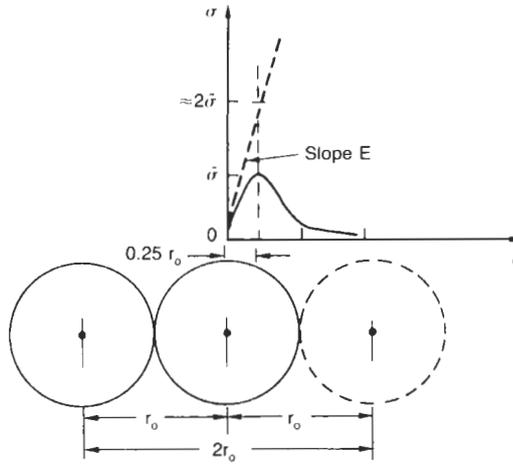


Fig. 9.1. The ideal strength,  $\bar{\sigma}$ .

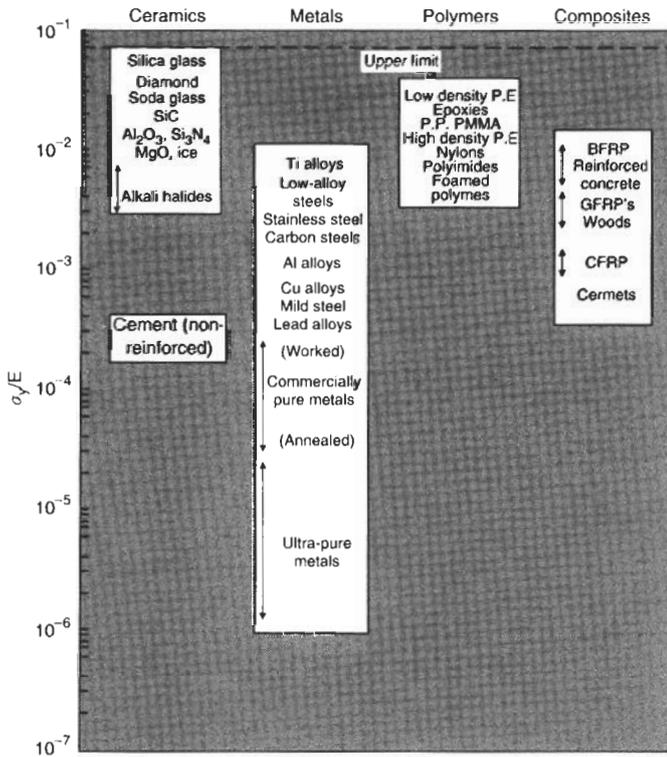



Fig. 9.2. Bar-chart of data for normalised yield strength,  $\sigma_y/E$ .

All metals, on the other hand, have yield strengths far below the levels predicted by our calculation – as much as a factor of  $10^5$  smaller. Even ceramics, many of them, yield at stresses which are as much as a factor of 10 below their ideal strength. Why is this?

## Dislocations in crystals

In Chapter 5 we said that many important engineering materials (e.g. metals) were normally made up of crystals, and explained that a perfect crystal was an assembly of *atoms packed together in a regularly repeating pattern*.


But crystals (like everything in this world) are not perfect; they have *defects* in them. Just as the strength of a chain is determined by the strength of the weakest link, so the strength of a crystal – and thus of our material – is usually limited by the defects that are present in it. The *dislocation* is a particular type of defect that has the effect of allowing materials to deform plastically (that is, they yield) at stress levels that are much less than  $\bar{\sigma}$ .

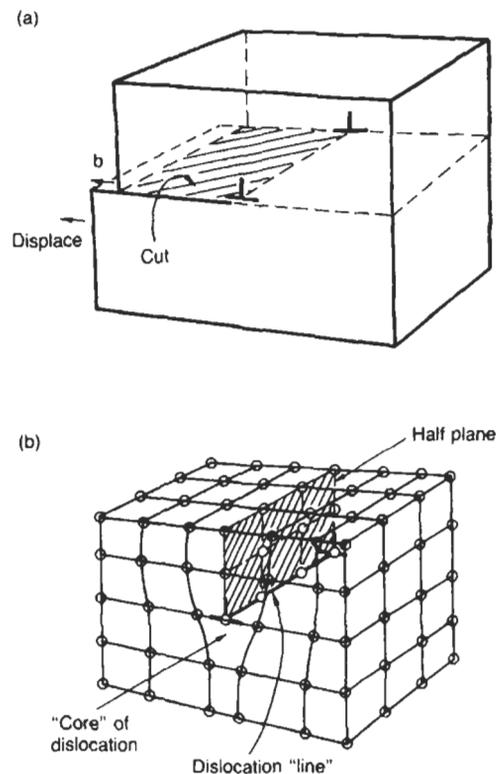

**Fig. 9.3.** An edge dislocation, (a) viewed from a continuum standpoint (i.e. ignoring the atoms) and (b) showing the positions of the atoms near the dislocation.

Figure 9.3(a) shows an *edge dislocation* from a continuum viewpoint (i.e. ignoring the atoms). Such a dislocation is made in a block of material by cutting the block up to the line marked  $\perp - \perp$ , then displacing the material below the cut relative to that above by a distance  $b$  (the atom size) normal to the line  $\perp - \perp$ , and finally gluing the cut-and-displaced surfaces back together. The result, on an atomic scale, is shown in the adjacent diagram (Fig. 9.3(b)); the material in the middle of the block now contains a *half-plane* of atoms, with its lower edge lying along the line  $\perp - \perp$ : the *dislocation line*. This defect is called an edge dislocation because it is formed by the edge of the half-plane of atoms; and it is written briefly by using the symbol  $\perp$ .

Dislocation motion produces plastic strain. Figure 9.4 shows how the atoms rearrange as the dislocation moves through the crystal, and that, when one dislocation moves entirely through a crystal, the lower part is displaced under the upper by the distance  $b$  (called the Burgers vector). The same process is drawn, without the atoms, and using the symbol  $\perp$  for the position of the dislocation line, in Fig. 9.5. The way in

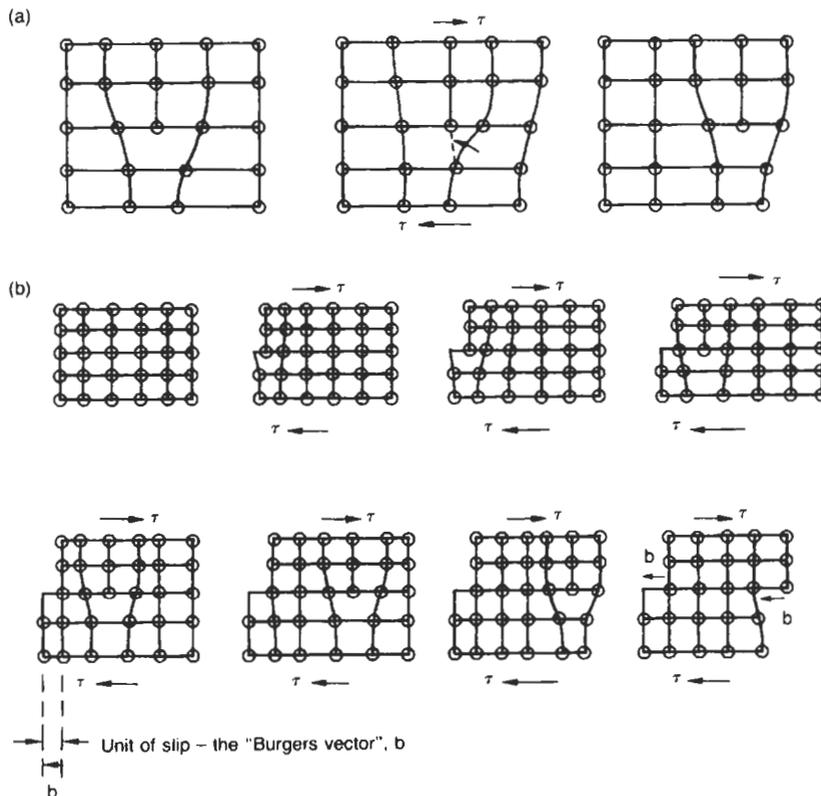

**Fig. 9.4.** How an edge dislocation moves through a crystal. (a) Shows how the atomic bonds at the centre of the dislocation break and reform to allow the dislocation to move. (b) Shows a complete sequence for the introduction of a dislocation into a crystal from the left-hand side, its migration through the crystal, and its expulsion on the right-hand side; this process causes the lower half of the crystal to slip by a distance  $b$  under the upper half.

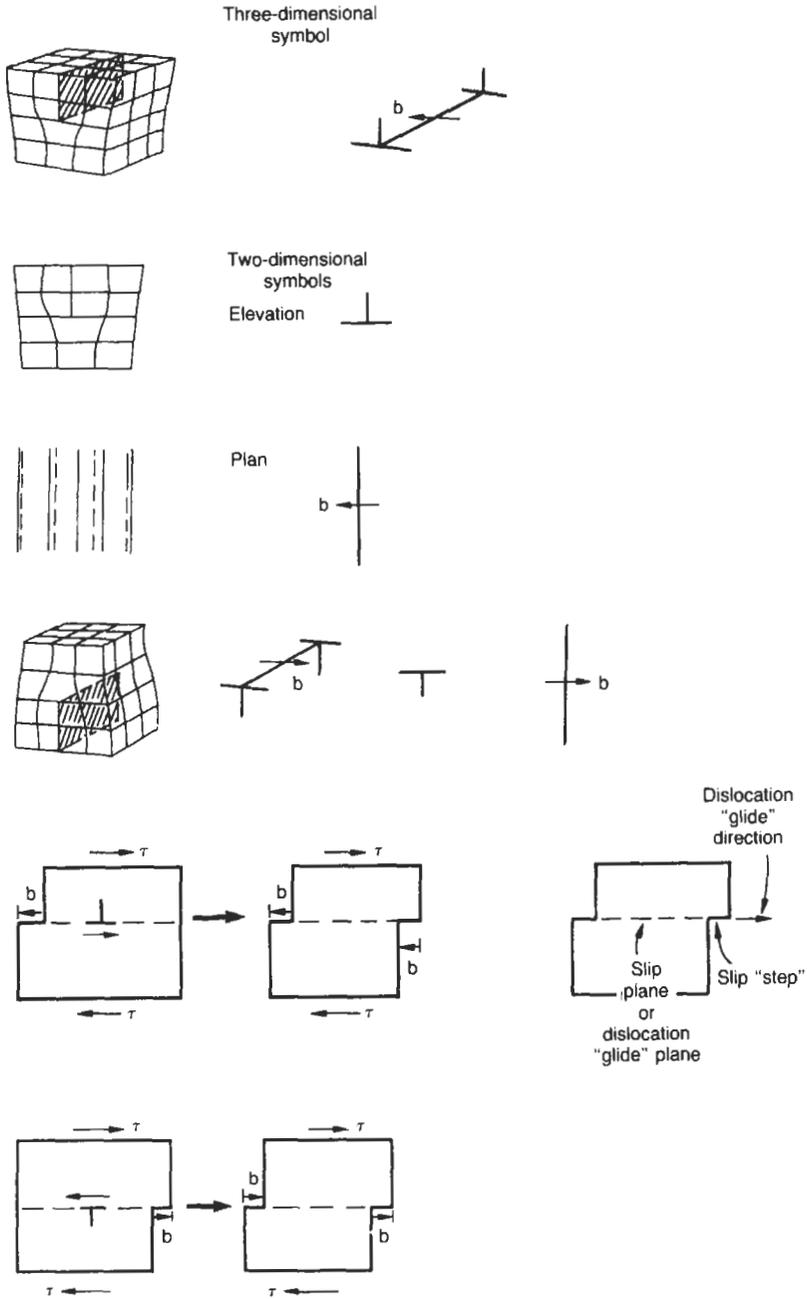


Fig. 9.5. Edge-dislocation conventions.

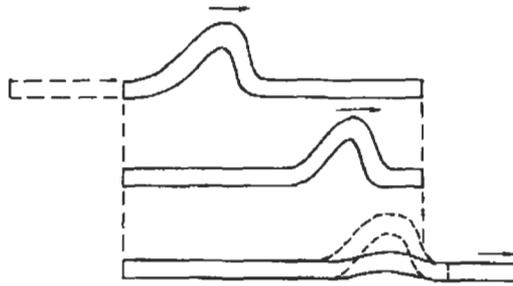


Fig. 9.6. The 'carpet-ruck' analogy of an edge dislocation.


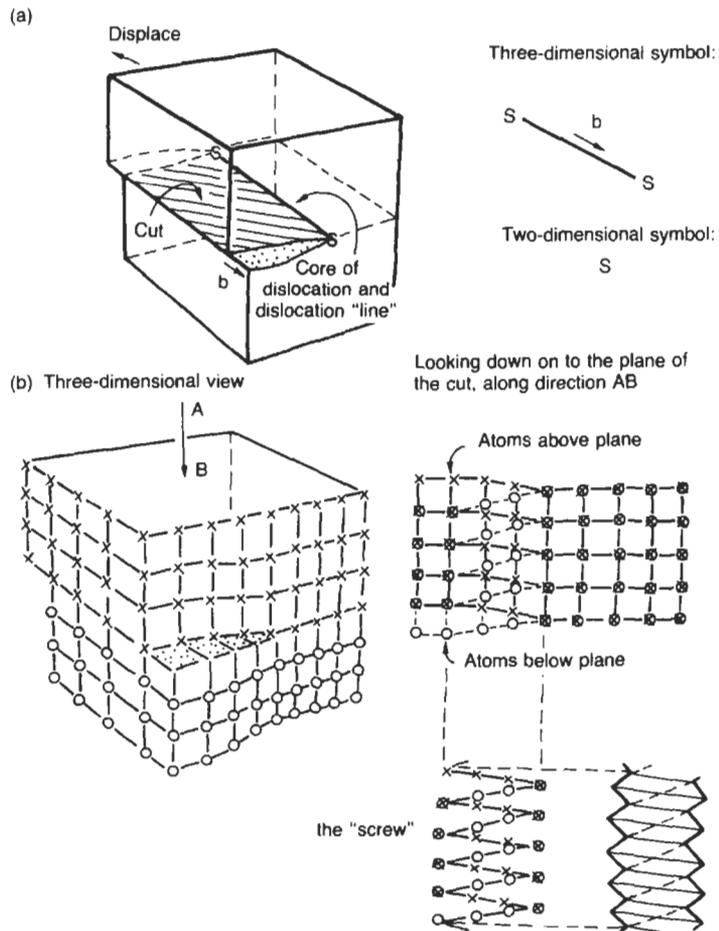


Fig. 9.7. A screw dislocation, (a) viewed from a continuum standpoint and (b) showing the atom positions.

which this dislocation works can be likened to the way in which a ballroom carpet can be moved across a large dance floor simply by moving rucks along the carpet – a very much easier process than pulling the whole carpet across the floor at one go.

In making the edge dislocation of Fig. 9.3 we could, after making the cut, have displaced the lower part of the crystal under the upper part in a direction *parallel* to the bottom of the cut, instead of normal to it. Figure 9.7 shows the result; it, too, is a dislocation, called a *screw dislocation* (because it converts the planes of atoms into a helical surface, or screw). Like an edge dislocation, it produces plastic strain when it

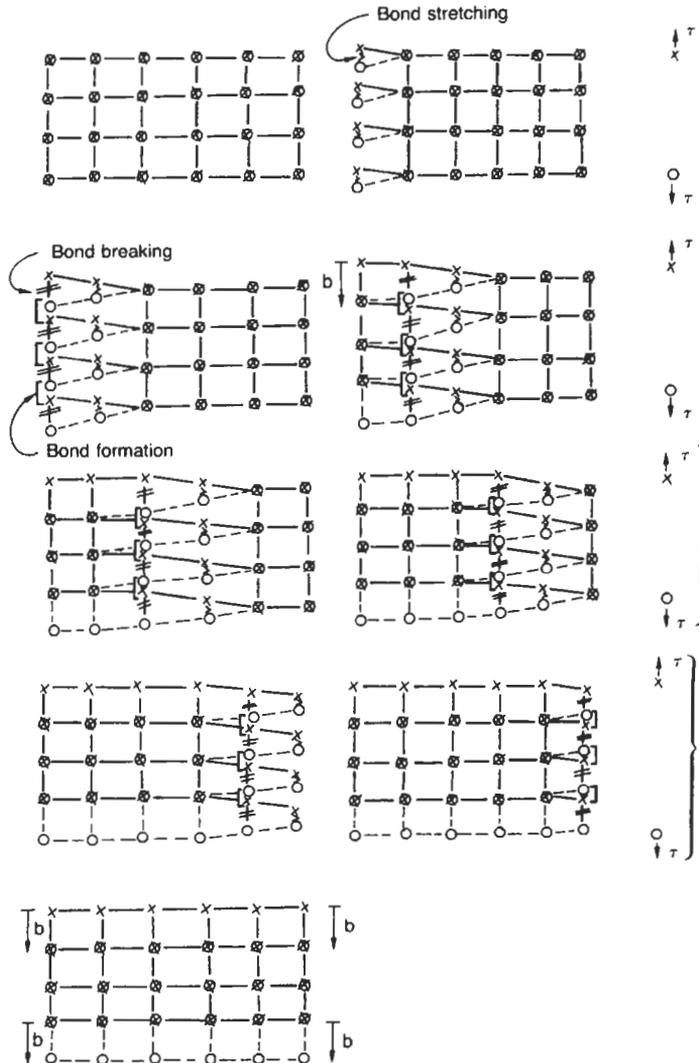

**Fig. 9.8.** Sequence showing how a screw dislocation moves through a crystal causing the lower half of the crystal (o) to slip by a distance  $b$  under the upper half (x).

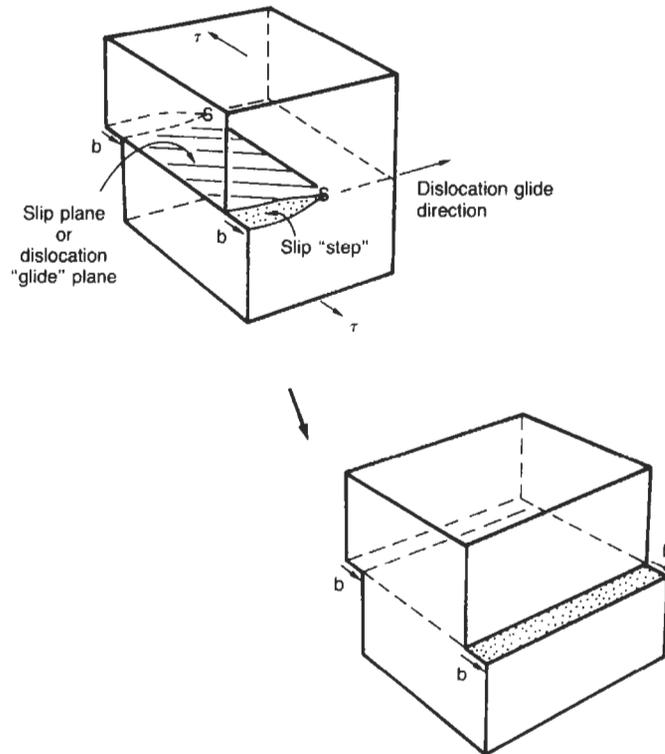


Fig. 9.9. Screw-dislocation conventions.


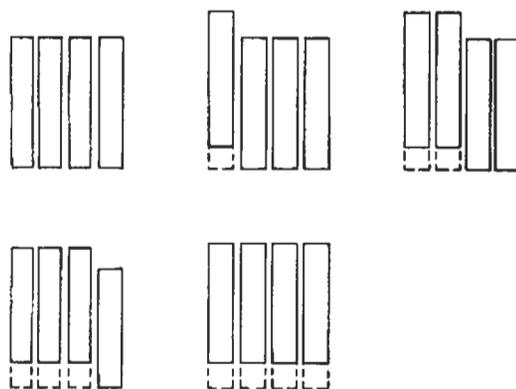


Fig. 9.10. The 'planking' analogy of the screw dislocation. Imagine four planks resting side by side on a factory floor. It is much easier to slide them across the floor one at a time than all at the same time.

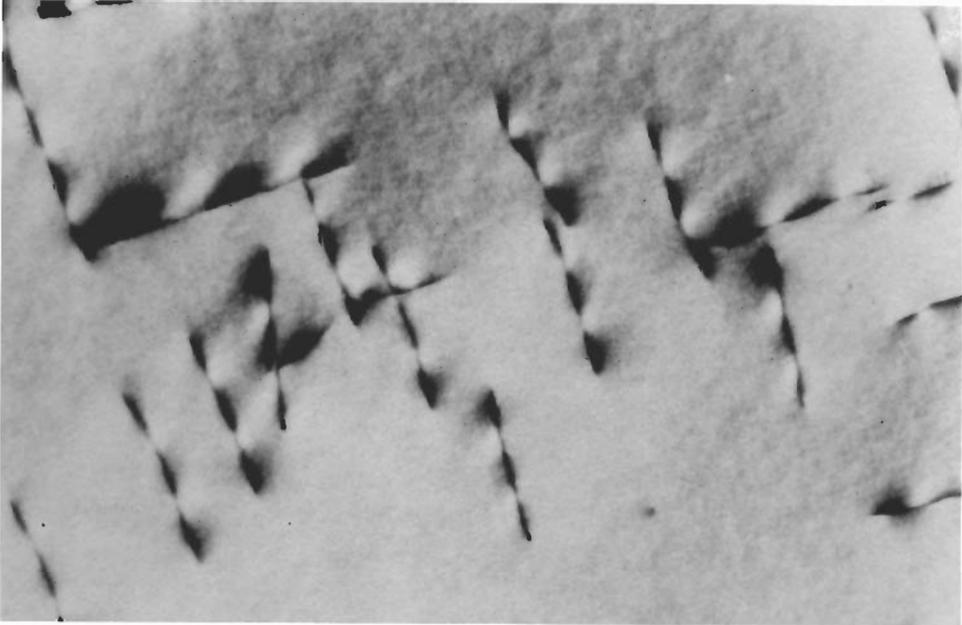

**Fig. 9.11.** An electron microscope picture of dislocation lines in stainless steel. The picture was taken by firing electrons through a very thin slice of steel about 100 nm thick. The dislocation lines here are only about 1000 atom diameters long because they have been 'chopped off' where they meet the top and bottom surfaces of the thin slice. But a sugar-cube-sized piece of any engineering alloy contains about  $10^5$  km of dislocation line. (Courtesy of Dr. Peter Southwick.)

moves (Figs 9.8, 9.9, 9.10). Its geometry is a little more complicated but its properties are otherwise just like those of the edge. Any dislocation, in a real crystal, is either a screw or an edge; or can be thought of as little steps of each. Dislocations can be seen by electron microscopy. Figure 9.11 shows an example.

### The force acting on a dislocation

A shear stress ( $\tau$ ) exerts a force on a dislocation, pushing it through the crystal. For yielding to take place, this force must be great enough to overcome the *resistance* to the motion of the dislocation. This resistance is due to intrinsic friction opposing dislocation motion, plus contributions from alloying or work-hardening; they are discussed in detail in the next chapter. Here we show that the magnitude of the force is  $\tau b$  per unit length of dislocation.

We prove this by a virtual work calculation. We equate the work done by the applied stress when the dislocation moves completely through the crystal to the work done against the force  $f$  opposing its motion (Fig. 9.12). The upper part is displaced relative to the lower by the distance  $b$ , and the applied stress does work  $(\tau l_1 l_2) \times b$ . In moving

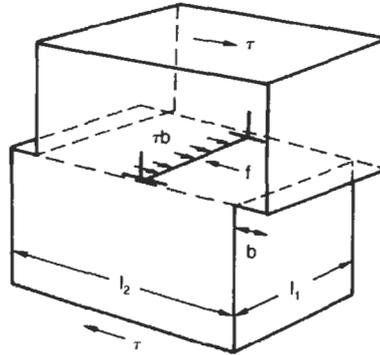


Fig. 9.12. The force acting on a dislocation.

through the crystal, the dislocation travels a distance  $l_2$ , doing work against the resistance,  $f$  per unit length, as it does so; this work is  $fl_1l_2$ . Equating the two gives

$$\tau b = f. \quad (9.2)$$

This result holds for any dislocation – edge, screw or a mixture of both.

### Other properties of dislocations

There are two remaining properties of dislocations that are important in understanding the plastic deformation of materials. These are:

- Dislocations always glide on crystallographic planes, as we might imagine from our earlier drawings of edge-dislocation motion. In f.c.c. crystals, for example, the dislocations glide on {111} planes, and therefore plastic shearing takes place on {111} in f.c.c. crystals.
- The atoms near the core of a dislocation are displaced from their proper positions and thus have a higher energy. In order to keep the total energy as low as possible, the dislocation tries to be as short as possible – it behaves as if it had a *line tension*,  $T$ , like a rubber band. Very roughly, the strains at a dislocation core are of order  $1/2$ ; the stresses are therefore of order  $G/2$  (Chapter 8) so the energy per unit volume of core is  $G/8$ . If we take the core radius to be equal to the atom size  $b$ , its volume, per unit length, is  $\pi b^2$ . The line tension is the energy per unit length (just as a surface tension is an energy per unit area), giving

$$T = \frac{\pi}{8} Gb^2 \approx \frac{Gb^2}{2}, \quad (9.3)$$

where  $G$  is the shear modulus. In absolute terms,  $T$  is small (we should need  $\approx 10^8$  dislocations to hold an apple up) but it is large in relation to the size of a

The diagram shows a horizontal line representing a dislocation. At each end of the line, there is a small vertical tick mark and a horizontal arrow pointing outwards, labeled with the letter 'T'. In the center of the line, there is a horizontal arrow pointing to the right, labeled with the equation  $T \approx \frac{Gb^2}{2}$ .

**Fig. 9.13.** The line tension in a dislocation.

dislocation, and has an important bearing on the way in which obstacles obstruct the motion of dislocations.

We shall be looking in the next chapter at how we can use our knowledge of how dislocations work and how they behave in order to understand how materials deform plastically, and to help us design stronger materials.

### Further reading

- A. H. Cottrell, *The Mechanical Properties of Matter*, Wiley, 1964, Chap. 9.
- D. Hull, *Introduction to Dislocations*, 2nd edition, Pergamon Press, 1975.
- W. T. Read, Jr., *Dislocations in Crystals*, McGraw Hill, 1953.
- J. P. Hirth and J. Lothe, *Theory of Dislocations*, McGraw Hill, 1968.

# Chapter 10

## Strengthening methods, and plasticity of polycrystals

---

### Introduction

We showed in the last chapter that:

- (a) crystals contain dislocations;
- (b) a shear stress  $\tau$ , applied to the slip plane of a dislocation, exerts a force  $\tau b$  per unit length of the dislocation trying to push it forward;
- (c) when dislocations move, the crystal deforms plastically – that is, it yields.

In this chapter we examine ways of increasing the resistance to motion of a dislocation; it is this which determines the *dislocation yield strength* of a single isolated crystal, of a metal or a ceramic. But bulk engineering materials are aggregates of many crystals, or *grains*. To understand the plasticity of such an aggregate, we have to examine also how the individual crystals interact with each other. This lets us calculate the *polycrystal yield strength* – the quantity that enters engineering design.

### Strengthening mechanisms

A crystal yields when the force  $\tau b$  (per unit length) exceeds  $f$ , the *resistance* (a force per unit length) opposing the motion of a dislocation. This defines the dislocation yield strength

$$\tau_y = \frac{f}{b}. \quad (10.1)$$

Most crystals have a certain *intrinsic* strength, caused by the bonds between the atoms which have to be broken and reformed as the dislocation moves. Covalent bonding, particularly, gives a very large *intrinsic lattice resistance*,  $f_i$  per unit length of dislocation. It is this that causes the enormous strength and hardness of diamond, and the carbides, oxides, nitrides and silicates which are used for abrasives and cutting tools. But pure metals are very soft: they have a very low lattice resistance. Then it is useful to increase  $f$  by *solid solution strengthening*, by *precipitate* or *dispersion* strengthening, or by *work-hardening*, or by any combination of the three. Remember, however, that there is an upper limit to the yield strength: it can never exceed the ideal strength (Chapter 9). In practice, only a few materials have strengths that even approach it.

## Solid solution hardening

A good way of hardening a metal is simply to make it impure. Impurities go into solution in a solid metal just as sugar dissolves in tea. A good example is the addition of zinc to copper to make the *alloy* called brass. The zinc atoms replace copper atoms to form a *random substitutional solid solution*. At room temperature Cu will dissolve up to 30% Zn in this way. The Zn atoms are bigger than the Cu atoms, and, in squeezing into the Cu structure, generate stresses. These stresses 'roughen' the slip plane, making it harder for dislocations to move; they increase the resistance  $f$ , and thereby increase the dislocation yield strength,  $\tau_y$  (eqn. (10.1)). If the contribution to  $f$  given by the solid solution is  $f_{ss}$  then  $\tau_y$  is increased by  $f_{ss}/b$ . In a solid solution of concentration  $C$ , the spacing of dissolved atoms on the slip plane (or on any other plane, for that matter) varies as  $C^{-1/2}$ ; and the smaller the spacing, the 'rougher' is the slip plane. As a result,  $\tau_y$  increases about parabolically (i.e. as  $C^{1/2}$ ) with solute concentration (Fig. 10.1). Single-phase brass, bronze, and stainless steels, and many other metallic alloys, derive their strength in this way.

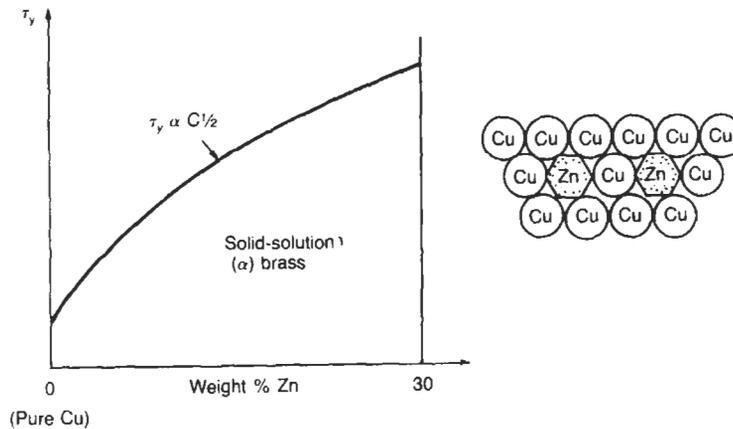


Fig. 10.1. Solid solution hardening.

## Precipitate and dispersion strengthening

If an impurity (copper, say) is dissolved in a metal or ceramic (aluminium, for instance) at a high temperature, and the alloy is cooled to room temperature, the impurity may *precipitate* as small particles, much as sugar will crystallise from a saturated solution when it is cooled. An alloy of Al containing 4% Cu ('Duralumin'), treated in this way, gives very small, closely spaced precipitates of the hard compound  $\text{CuAl}_2$ . Most steels are strengthened by precipitates of carbides, obtained in this way.\*

---


\*The optimum precipitate is obtained by a more elaborate *heat treatment*: the alloy is *solution heat-treated* (heated to dissolve the impurity), *quenched* (cooled fast to room temperature, usually by dropping it into oil or water) and finally *tempered* or *aged* for a controlled time and at a controlled temperature (to cause the precipitate to form).

Small particles can be introduced into metals or ceramics in other ways. The most obvious is to mix a dispersoid (such as an oxide) into a powdered metal (aluminium and lead are both treated in this way), and then compact and sinter the mixed powders.

Either approach distributes small, hard particles in the path of a moving dislocation. Figure 10.2 shows how they obstruct its motion. The stress  $\tau$  has to push the dislocation between the obstacles. It is like blowing up a balloon in a bird cage: a very large pressure is needed to bulge the balloon between the bars, though once a large enough bulge is formed, it can easily expand further. The *critical configuration* is the semicircular one (Fig. 10.2(c)): here the force  $\tau bL$  on one segment is just balanced by the force  $2T$  due to the line tension, acting on either side of the bulge. The dislocation escapes (and yielding occurs) when

$$\tau_y = \frac{2T}{bL} \tag{10.2}$$

The obstacles thus exert a resistance of  $f_0 = 2T/L$ . Obviously, the greatest hardening is produced by *strong, closely spaced precipitates* or dispersions (Fig. 10.2).

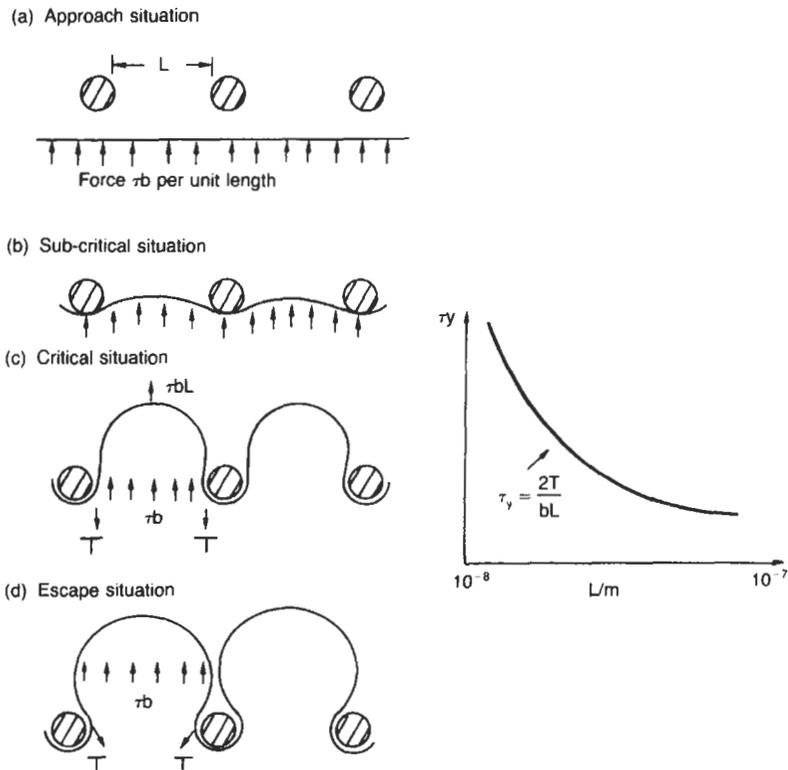

**Fig. 10.2.** How dispersed precipitates help prevent the movement of dislocations, and help prevent plastic flow of materials.

## Work-hardening

When crystals yield, dislocations move through them. Most crystals have several slip planes: the f.c.c. structure, which slips on {111} planes (Chapter 5), has four, for example. Dislocations on these intersecting planes interact, and obstruct each other, and accumulate in the material.

The result is *work-hardening*: the steeply rising stress-strain curve after yield, shown in Chapter 8. All metals and ceramics work-harden. It can be a nuisance: if you want to roll thin sheet, work-hardening quickly raises the yield strength so much that you have to stop and *anneal* the metal (heat it up to remove the accumulated dislocations) before you can go on. But it is also useful: it is a potent strengthening method, which can be added to the other methods to produce strong materials.

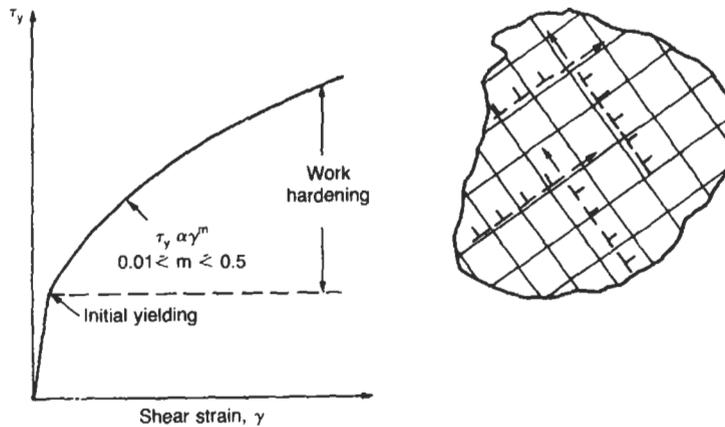


Fig. 10.3. Collision of dislocations leads to work-hardening.

The analysis of work-hardening is difficult. Its contribution  $f_{wh}$  to the total dislocation resistance  $f$  is considerable and increases with strain (Fig. 10.3).

## The dislocation yield strength

It is adequate to assume that the strengthening methods contribute in an additive way to the strength. Then


$$\tau_y = \frac{f_i}{b} + \frac{f_{ss}}{b} + \frac{f_0}{b} + \frac{f_{wh}}{b}. \quad (10.3)$$

Strong materials either have a high intrinsic strength,  $f_i$  (like diamond), or they rely on the superposition of solid solution strengthening  $f_{ss}$ , obstacles  $f_0$  and work-hardening  $f_{wh}$  (like high-tensile steels). But before we can use this information, one problem

remains: we have calculated the yield strength of an *isolated crystal in shear*. We want the yield strength of a *polycrystalline aggregate in tension*.

### Yield in polycrystals

The crystals, or *grains*, in a polycrystal fit together exactly but their crystal orientations differ (Fig. 10.4). Where they meet, at *grain boundaries*, the crystal structure is disturbed, but the atomic bonds across the boundary are numerous and strong enough that the boundaries do not usually weaken the material.

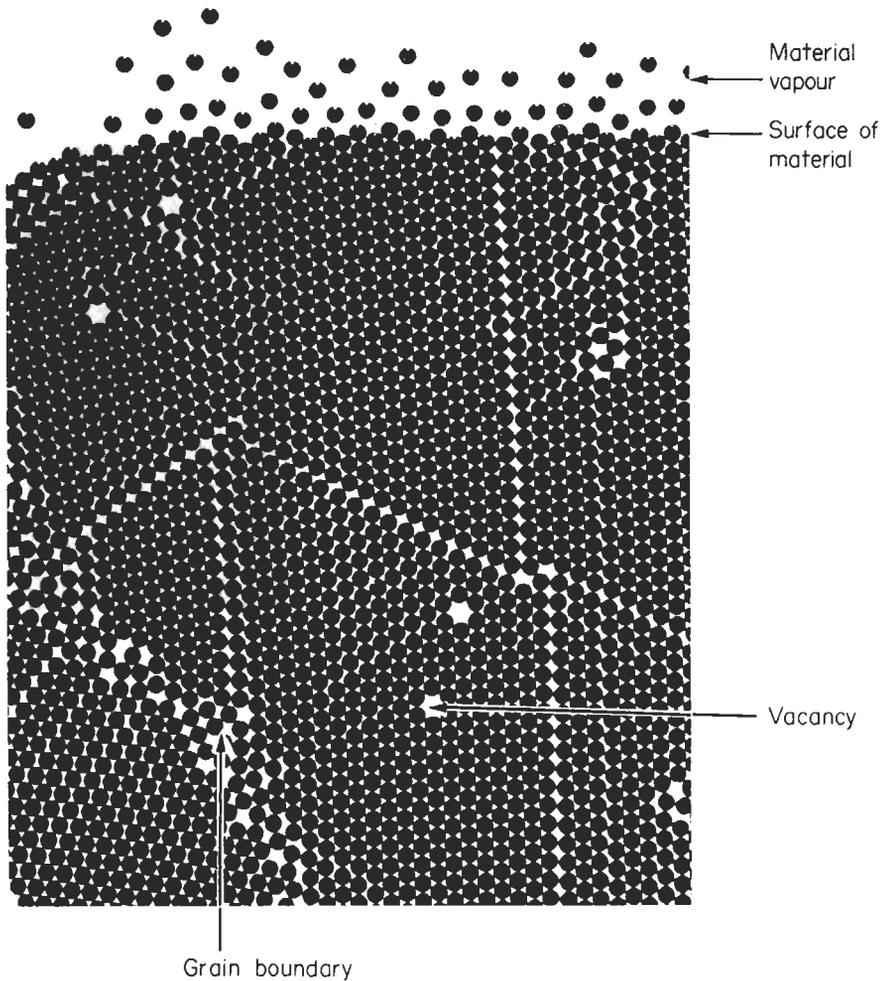

**Fig. 10.4.** Ball bearings can be used to simulate how atoms are packed together in solids. Our photograph shows a ball-bearing model set up to show what the *grain boundaries* look like in a polycrystalline material. The model also shows up another type of defect – the *vacancy* – which is caused by a missing atom.

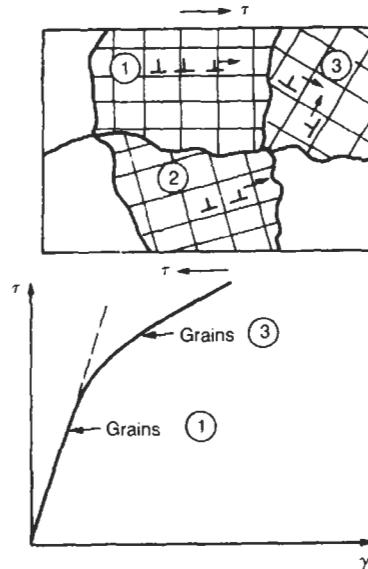


Fig. 10.5. The progressive nature of yielding in a polycrystalline material.

Let us now look at what happens when a polycrystalline component begins to yield (Fig. 10.5). Slip begins in grains where there are slip planes as nearly parallel to  $\tau$  as possible, e.g. grain (1). Slip later spreads to grains like (2) which are not so favourably oriented, and lastly to the worst oriented grains like (3). Yielding does not take place all at once, therefore, and there is no sharp polycrystalline yield point on the stress–strain curve. Further, gross (total) yielding does not occur at the dislocation–yield strength  $\tau_{y\prime}$  because not all the grains are oriented favourably for yielding. The gross–yield strength is higher, by a factor called the Taylor factor, which is calculated (with difficulty) by averaging the stress over all possible slip planes; it is close to 1.5.

But we want the tensile yield strength,  $\sigma_y$ . A tensile stress  $\sigma$  creates a shear stress in the material that has a maximum value of  $\tau = \sigma/2$ . (We show this in Chapter 11 where we resolve the tensile stress onto planes within the material.) To calculate  $\sigma_y$  from  $\tau_{y\prime}$  we combine the Taylor factor with the resolution factor to give

$$\sigma_y = 3\tau_{y\prime} \quad (10.4)$$

$\sigma_y$  is the quantity we want: the yield strength of bulk, polycrystalline solids. It is larger than the dislocation shear strength  $\tau_{y\prime}$  (by the factor 3) but is proportional to it. So all the statements we have made about increasing  $\tau_{y\prime}$  apply unchanged to  $\sigma_y$ .

A whole science of alloy design for high strength has grown up in which alloys are blended and heat-treated to achieve maximum  $\tau_{y\prime}$ . Important components that are strengthened in this way range from lathe tools ('high-speed' steels) to turbine blades ('Nimonic' alloys based on nickel). We shall have more to say about strong solids when

we come to look at how materials are *selected* for a particular job. But first we must return to a discussion of plasticity at the non-atomistic, or continuum, level.

### Further reading

- A. H. Cottrell, *The Mechanical Properties of Matter*, Wiley, 1964, Chap. 9.
- R. W. K. Honeycombe, *The Plastic Deformation of Metals*, Arnold, 1968.

# Chapter 11

## Continuum aspects of plastic flow

---

### Introduction

Plastic flow occurs by shear. Dislocations move when the shear stress on the slip plane exceeds *the dislocation yield strength*  $\tau_y$  of a single crystal. If this is averaged over all grain-orientations and slip planes, it can be related to *the tensile yield strength*  $\sigma_y$  of a polycrystal by  $\sigma_y = 3\tau_y$  (Chapter 10). But in solving problems of plasticity, it is more useful to define *the shear yield strength*  $k$  of a polycrystal. It is equal to  $\sigma_y/2$ , and differs from  $\tau_y$  because it is an average shear-resistance over all orientations of slip plane. When a structure is loaded, the planes on which shear will occur can often be identified or guessed, and the collapse load calculated approximately by requiring that the stress exceed  $k$  on these planes.

In this chapter we show that  $k = \sigma_y/2$ , and use  $k$  to relate the hardness to the yield strength of a solid. We then examine tensile instabilities which appear in the drawing of metals and polymers.

### The onset of yielding and the shear yield strength, $k$

A tensile stress applied to a piece of material will create a shear stress at an angle to the tensile stress. Let us examine the stresses in more detail. Resolving forces in Fig. 11.1 gives the shearing force as

$$F \sin \theta.$$

The area over which this force acts in shear is

$$\frac{A}{\cos \theta}$$

and thus the shear stress,  $\tau$ , is

$$\begin{aligned} \tau &= \frac{F \sin \theta}{A/\cos \theta} = \frac{F}{A} \sin \theta \cos \theta \\ &= \sigma \sin \theta \cos \theta. \end{aligned} \tag{11.1}$$

If we plot this against  $\theta$  as in Fig. 11.2 we find a maximum  $\tau$  at  $\theta = 45^\circ$  to the tensile axis. This means that *the highest value of the shear stress is found at  $45^\circ$  to the tensile axis, and has a value of  $\sigma/2$ .*

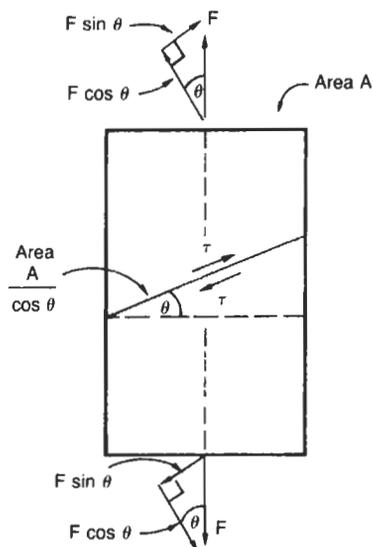


Fig. 11.1. A tensile stress,  $F/A$ , produces a shear stress,  $\tau$ , on an inclined plane in the stressed material.

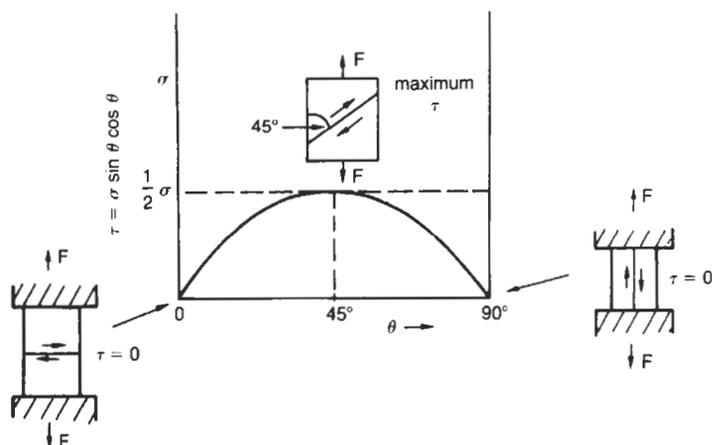


Fig. 11.2. Shear stresses in a material have their maximum value on planes at  $45^\circ$  to the tensile axis.

Now, from what we have said in Chapters 9 and 10, if we are dealing with a single crystal, the crystal will *not* in fact slip on the  $45^\circ$  plane – it will slip on the nearest lattice plane to the  $45^\circ$  plane on which dislocations can glide (Fig. 11.3). In a polycrystal, neighbouring grains each yield on their nearest-to- $45^\circ$  slip planes. On a microscopic scale, slip occurs on a zig-zag path; but the *average* slip path is at  $45^\circ$  to the tensile axis. The shear stress on this plane when yielding occurs is therefore  $\tau = \sigma_y/2$ , and we define this as the shear yield strength  $k$ :

$$k = \sigma_y/2. \tag{11.2}$$

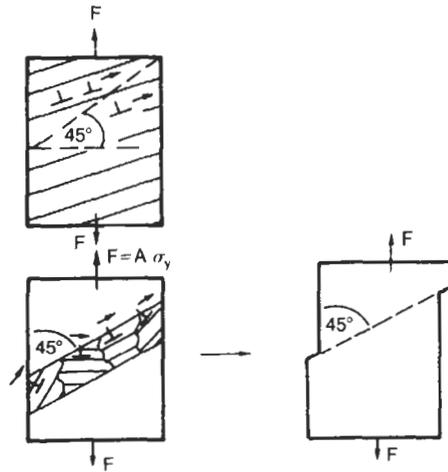


Fig. 11.3. In a polycrystalline material the average slip path is at 45° to the tensile axis.

*Example: Approximate calculation of the hardness of solids.* This concept of shear yielding – where we ignore the details of the grains in our polycrystal and treat the material as a *continuum* – is useful in many respects. For example, we can use it to calculate the loads that would make our material yield for all sorts of quite complicated geometries.

A good example is the problem of the *hardness indenter* that we referred to in the hardness test in Chapter 8. Then, we stated that the hardness

$$H = \frac{F}{A} = 3\sigma_y$$

(with a correction factor for materials that work-harden appreciably – most do). For simplicity, let us assume that our material does not work-harden; so that as the indenter is pushed into the material, the yield strength does not change. Again, for simplicity, we will consider a two-dimensional model. (A real indenter, of course, is three-dimensional, but the result is, for practical purposes, the same.)

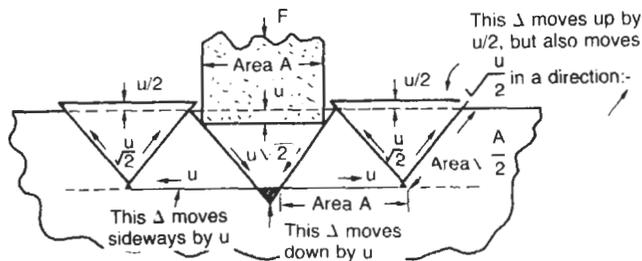


Fig. 11.4. The plastic flow of material under a hardness indenter – a simplified two-dimensional visualisation.

As we press a flat indenter into the material, shear takes place on the  $45^\circ$  planes of maximum shear stress shown in Fig. 11.4, at a value of shear stress equal to  $k$ . By equating the work done by the force  $F$  as the indenter sinks a distance  $u$  to the work done against  $k$  on the shear planes, we get:

$$Fu = 2 \times \frac{Ak}{\sqrt{2}} \times u\sqrt{2} + 2 \times Ak \times u + 4 \times \frac{Ak}{\sqrt{2}} \times \frac{u}{\sqrt{2}}.$$

This simplifies to

$$F = 6Ak$$

from which

$$\frac{F}{A} = 6k = 3\sigma_y.$$

But  $F/A$  is the hardness,  $H$ ; so

$$H = 3\sigma_y \tag{11.3}$$

(Strictly, shear occurs not just on the shear planes we have drawn, but on a myriad of  $45^\circ$  planes near the indenter. If our assumed geometry for slip is wrong it can be shown rigorously by a theorem called the *upper-bound* theorem that the value we get for  $F$  at yield – the so-called ‘limit’ load – is always on the high side.)

Similar treatments can be used for all sorts of two-dimensional problems: for calculating the plastic collapse load of structures of complex shape, and for analysing metal-working processes like forging, rolling and sheet drawing.

## Plastic instability: necking in tensile loading

We now turn to the other end of the stress–strain curve and explain why, in tensile straining, materials eventually start to *neck*, a name for *plastic instability*. It means that flow becomes localised across one section of the specimen or component, as shown in Fig. 11.5, and (if straining continues) the material fractures there. Plasticine necks readily; chewing gum is very resistant to necking.

We analyse the instability by noting that if a force  $F$  is applied to the end of the specimen of Fig. 11.5, then any section must carry this load. But is it capable of doing so? Suppose one section deforms a little more than the rest, as the figure shows. Its section is less, and the stress in it is therefore larger than elsewhere. If work-hardening has raised the yield strength enough, the reduced section can still carry the force  $F$ ; but if it has not, plastic flow will become localised at the neck and the specimen will fail there. Any section of the specimen can carry a force  $A\sigma$ , where  $A$  is its area, and  $\sigma$  its current strength. If  $A\sigma$  increases with strain, the specimen is

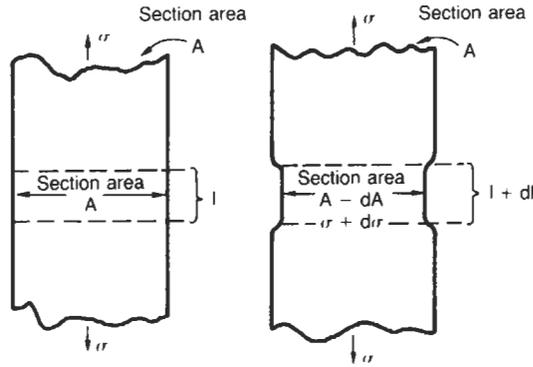


Fig. 11.5. The formation of a neck in a bar of material which is being deformed plastically.

stable. If it decreases, it is unstable and will neck. The critical condition for the start of necking is that

$$A\sigma = F = \text{constant.}$$

Then

$$A d\sigma + \sigma dA = 0$$

or

$$\frac{d\sigma}{\sigma} = -\frac{dA}{A}.$$

But volume is conserved during plastic flow, so

$$-\frac{dA}{A} = \frac{dl}{l} = d\epsilon$$

(prove this by differentiating  $Al = \text{constant}$ ). So

$$\frac{d\sigma}{\sigma} = d\epsilon$$

or

$$\frac{d\sigma}{d\epsilon} = \sigma. \quad (11.4)$$

This equation is given in terms of true stress and true strain. As we said in Chapter 8, tensile data are usually given in terms of nominal stress and strain. From Chapter 8:

$$\sigma = \sigma_n (1 + \epsilon_n),$$

$$\epsilon = \ln(1 + \epsilon_n).$$

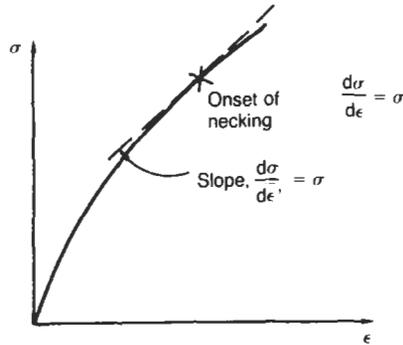


Fig. 11.6. The condition for necking.

If these are differentiated and substituted into the necking equation we get

$$\frac{d\sigma_n}{d\epsilon_n} = 0. \quad (11.5)$$

In other words, on the point of instability, the *nominal* stress–strain curve is at its maximum as we know experimentally from Chapter 8.

To see what is going on physically, it is easier to return to our first condition. At low stress, if we make a little neck, the material in the neck will work-harden and will be able to carry the extra stress it has to stand because of its smaller area; load will therefore be continuous, and the material will be stable. At high stress, the *rate of work-hardening* is less as the true stress–true strain curve shows: i.e. the slope of the  $\sigma/\epsilon$  curve is less. Eventually, we reach a point at which, when we make a neck, the work-hardening is only *just* enough to stand the extra stress. This is the point of necking, with

$$\frac{d\sigma}{d\epsilon} = \sigma.$$

At still higher *true* stress,  $d\sigma/d\epsilon$ , the rate of work-hardening decreases further, becoming insufficient to maintain stability – the extra stress in the neck can no longer be accommodated by the work-hardening produced by making the neck, and the neck grows faster and faster, until final fracture takes place.

#### Consequences of plastic instability

Plastic instability is very important in processes like deep drawing sheet metal to form car bodies, cans, etc. Obviously we must ensure that the materials and press designs are chosen carefully to *avoid* instability.

Mild steel is a good material for deep drawing in the sense that it flows a great deal before necking starts. It can therefore be drawn very deeply without breaking (Fig. 11.7).

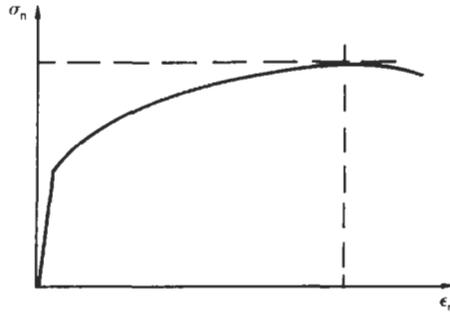


Fig. 11.7. Mild steel can be drawn out a lot before it fails by necking.

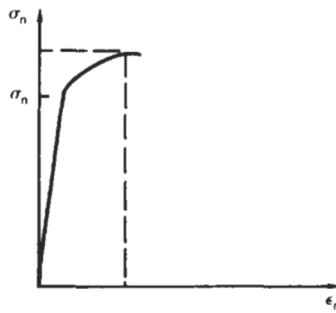


Fig. 11.8. Aluminium alloy quickly necks when it is drawn out.

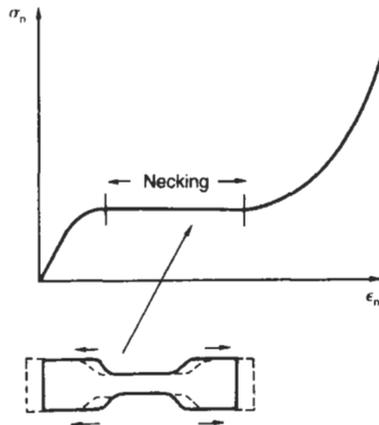


Fig. 11.9. Polythene forms a *stable neck* when it is drawn out; drawn polythene is very strong.

Aluminium alloy is much less good (Fig. 11.8) – it can only be drawn a little before instabilities form. Pure aluminium is not nearly as bad, but is much too *soft* to use for most applications.

Polythene shows a kind of necking that does *not* lead to fracture. Figure 11.9 shows its  $\sigma_n/\epsilon_n$  curve. At quite low stress

$$\frac{d\sigma_n}{d\epsilon_n}$$

becomes zero and necking begins. However, the neck never becomes *unstable* – it simply grows in length – because at high strain the material work-hardens considerably, and is able to support the increased stress at the reduced cross-section of the neck. This odd behaviour is caused by the lining up of the polymer chains in the neck along the direction of the neck – and for this sort of reason *drawn* (i.e. ‘fully necked’) polymers can be made to be very strong indeed – much stronger than the undrawn polymers.

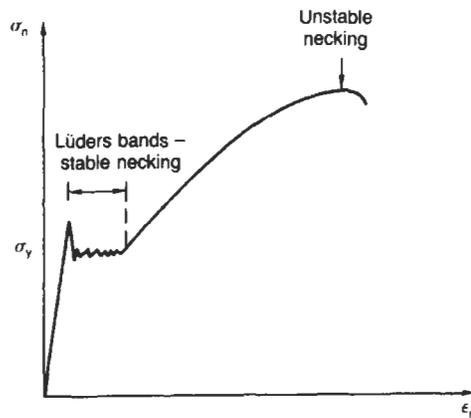


Fig. 11.10. Mild steel often shows both stable and unstable necks.

Finally, mild steel can sometimes show an instability like that of polythene. If the steel is annealed, the stress/strain curve looks like that in Fig. 11.10. A stable neck, called a Lüders Band, forms and propagates (as it did in polythene) without causing fracture because the strong work-hardening of the later part of the stress/strain curve prevents this. Lüders Bands are a problem when sheet steel is pressed because they give lower precision and disfigure the pressing.

### Further reading

- A. H. Cottrell, *The Mechanical Properties of Matter*, Wiley, 1964, Chap. 10.
- C. R. Calladine, *Engineering Plasticity*, Pergamon Press, 1969.
- W. A. Backofen, *Deformation Processing*, Addison-Wesley, 1972.
- R. Hill, *The Mathematical Theory of Plasticity*, Oxford University Press, 1950.

# Chapter 12

## Case studies in yield-limited design

---

### Introduction

We now examine three applications of our understanding of plasticity. The first (material selection for a spring) requires that there be *no plasticity whatever*. The second (material selection for a pressure vessel) typifies plastic design of a large structure. It is unrealistic to expect no plasticity: there will always be some, at bolt holes, loading points, or changes of section. The important thing is that yielding should not spread entirely through any section of the structure – that is, that *plasticity must not become general*. Finally, we examine an instance (the rolling of metal strip) in which yielding is deliberately induced, to give *large-strain plasticity*.

### CASE STUDY 1: ELASTIC DESIGN: MATERIALS FOR SPRINGS

Springs come in many shapes and have many purposes. One thinks of axial springs (a rubber band, for example), leaf springs, helical springs, spiral springs, torsion bars. Regardless of their shape or use, the best materials for a spring of minimum volume is that with the greatest value of  $\sigma_y^2/E$ . Here  $E$  is Young's modulus and  $\sigma_y$  the failure strength of the material of the spring: its yield strength if ductile, its fracture strength or modulus of rupture if brittle. Some materials with high values of this quantity are listed in Table 12.1.

**Table 12.1** Materials for springs

	$E$ (GN m <sup>-2</sup> )	$\sigma_y$ (MN m <sup>-2</sup> )	$\sigma_y^2/E$ (MJ m <sup>-3</sup> )	$\sigma_y/E$
Brass (cold-rolled)	120	638	3.38	$5.32 \times 10^{-3}$
Bronze (cold-rolled)		640	3.41	$5.33 \times 10^{-3}$
Phosphor bronze		770	4.94	$6.43 \times 10^{-3}$
Beryllium copper		1380	15.9	$11.5 \times 10^{-3}$
Spring steel	200	1300	8.45	$6.5 \times 10^{-3}$
Stainless steel (cold-rolled)		1000	5.0	$5.0 \times 10^{-3}$
Nimonic (high-temp. spring)		614	1.9	$3.08 \times 10^{-3}$

The argument, at its simplest, is as follows. The primary function of a spring is that of storing elastic energy and – when required – releasing it again. The elastic energy stored per unit volume in a block of material stressed uniformly to a stress  $\sigma$  is:

$$U^{el} = \frac{\sigma^2}{2E}$$

It is this that we wish to maximise. The spring will be damaged if the stress  $\sigma$  exceeds the yield stress or failure stress  $\sigma_y$ ; the constraint is  $\sigma \leq \sigma_y$ . So the maximum energy density is

$$U^{el} = \frac{\sigma_y^2}{2E}$$

Torsion bars and leaf springs are less efficient than axial springs because some of the material is not fully loaded: the material at the neutral axis, for instance, is not loaded at all. Consider – since we will need the equations in a moment – the case of a leaf spring.

### The leaf spring

Even leaf springs can take many different forms, but all of them are basically elastic beams loaded in bending. A rectangular section elastic beam, simply supported at both ends, loaded centrally with a force  $F$ , deflects by an amount

$$\delta = \frac{Fl^3}{4Ebt^3} \quad (12.1)$$

ignoring self-weight (Fig. 12.1). Here  $l$  is the length of the beam,  $t$  its thickness,  $b$  its width, and  $E$  is the modulus of the material of which it is made. The elastic energy stored in the spring, per unit volume, is

$$U^{el} = \frac{1}{2} \frac{F\delta}{btl} = \frac{F^2 l^2}{8Eb^2 t^4} \quad (12.2)$$

Figure 12.2 shows that the stress in the beam is zero along the neutral axis at its centre, and is a maximum at the surface, at the mid-point of the beam (because the bending moment is biggest there). The maximum surface stress is given by

$$\sigma = \frac{3Fl}{2bt^2}. \quad (12.3)$$

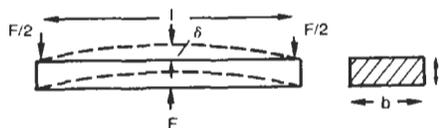


Fig. 12.1. A leaf spring under load.

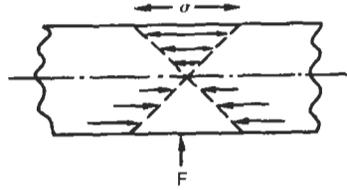


Fig. 12.2. Stresses inside a leaf spring.

Now, to be successful, a spring must not undergo a permanent set during use: it must always 'spring' back. The condition for this is that the maximum stress (eqn. (12.3)) always be less than the yield stress:

$$\frac{3Fl}{2bt^2} < \sigma_y \tag{12.4}$$

Eliminating  $t$  between this and eqn. (12.2) gives

$$U^{el} = \frac{1}{18} \left( \frac{\sigma_y^2}{E} \right)$$

This equation says: if in service a spring has to undergo a given deflection,  $\delta$ , under a force  $F$ , the ratio of  $\sigma_y^2/E$  must be high enough to avoid a permanent set. This is why we have listed values of  $\sigma_y^2/E$  in Table 12.1: the best springs are made of materials with high values of this quantity. For this reason spring materials are heavily strengthened (see Chapter 10): by solid solution strengthening plus work-hardening (cold-rolled, single-phase brass and bronze), solid solution and precipitate strengthening (spring steel), and so on. Annealing any spring material removes the work-hardening, and may cause the precipitate to coarsen (increasing the particle spacing), reducing  $\sigma_y$  and making the material useless as a spring.

**Example:** *Springs for a centrifugal clutch.* Suppose that you are asked to select a material for a spring with the following application in mind. A spring-controlled clutch like that shown in Fig. 12.3 is designed to transmit 20 horse power at 800rpm; the

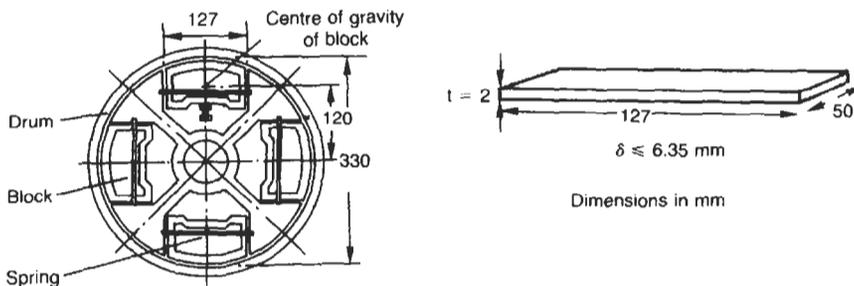


Fig. 12.3. Leaf springs in a centrifugal clutch.

clutch is to begin to pick up load at 600 rpm. The blocks are lined with Ferodo or some other friction material. When properly adjusted, the maximum deflection of the springs is to be 6.35 mm (but the friction pads may wear, and larger deflections may occur; this is a standard problem with springs – almost always, they must withstand occasional extra deflections without losing their sets).

### Mechanics

The force on the spring is

$$F = Mr\omega^2 \quad (12.5)$$

where  $M$  is the mass of the block,  $r$  the distance of the centre of gravity of the block from the centre of rotation, and  $\omega$  the angular velocity. The *net* force the block exerts on the clutch rim at full speed is

$$Mr(\omega_2^2 - \omega_1^2) \quad (12.6)$$

where  $\omega_2$  and  $\omega_1$  correspond to the angular velocities at 800 and 600 rpm (the *net* force must be zero for  $\omega_2 = \omega_1$ , at 600 rpm). The full power transmitted is given by

$$4\mu_s Mr(\omega_2^2 - \omega_1^2) \times \text{distance moved per second by inner rim of clutch at full speed,}$$

i.e.

$$\text{power} = 4\mu_s Mr(\omega_2^2 - \omega_1^2) \times \omega_2 r \quad (12.7)$$

where  $\mu_s$  is the coefficient of static friction.  $r$  is specified by the design (the clutch cannot be too big) and  $\mu_s$  is a constant (partly a property of the clutch-lining material). Both the power and  $\omega_2$  and  $\omega_1$  are specified in eqn. (12.7), so  $M$  is specified also; and finally the maximum force on the spring, too, is determined by the design from  $F = Mr\omega_1^2$ . The requirement that this force deflect the beam by only 6.35 mm with the linings just in contact is what determines the thickness,  $t$ , of the spring via eqn. (12.1) ( $l$  and  $b$  are fixed by the design).

### Metallic materials for the clutch springs

Given the spring dimensions ( $t = 2$  mm,  $b = 50$  mm,  $l = 127$  mm) and given  $\delta \leq 6.35$  mm, all specified by design, which material should we use? Eliminating  $F$  between eqns (12.1) and (12.4) gives

$$\frac{\sigma_y}{E} > \frac{6\delta t}{l^2} = \frac{6 \times 6.35 \times 2}{127 \times 127} = 4.7 \times 10^{-3}. \quad (12.8)$$

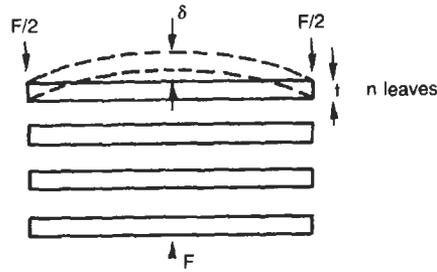


Fig. 12.4. Multi-leaved springs (schematic).

As well as seeking materials with high values of  $\sigma_y^2/E$ , we must also ensure that the material we choose – if it is to have the dimensions specified above and also deflect through 6.35 mm without yielding – meets the criterion of eqn. (12.8).

Table 12.1 shows that spring steel, the cheapest material listed, is adequate for this purpose, but has a worryingly small safety factor to allow for wear of the linings. Only the expensive beryllium–copper alloy, of all the metals shown, would give a significant safety factor ( $\sigma_y/E = 11.5 \times 10^{-3}$ ).

In many designs, the mechanical requirements are such that single springs of the type considered so far would yield even if made from beryllium copper. This commonly arises in the case of suspension springs for vehicles, etc., where both large  $\delta$  ('soft' suspensions) and large  $F$  (good load-bearing capacity) are required. The solution then can be to use multi-leaf springs (Fig. 12.4).  $t$  can be made *small* to give large  $\delta$  without yield according to

$$\left(\frac{\sigma_y}{E}\right) > \frac{6\delta t}{l^2}, \quad (12.9)$$

whilst the lost load-carrying capacity resulting from small  $t$  can be made up by having several leaves combining to support the load.

### Non-metallic materials


Finally, materials other than the metals originally listed in Table 12.1 can make good springs. Glass, or fused silica, with  $\sigma_y/E$  as large as  $58 \times 10^{-3}$  is excellent, *provided* it operates under protected conditions where it cannot be scratched or suffer impact loading (it has long been used for galvanometer suspensions). Nylon is good – provided the forces are low – having  $\sigma_y/E \approx 22 \times 10^{-3}$ , and it is widely used in household appliances and children's toys (you probably brushed your teeth with little nylon springs this morning). Leaf springs for heavy trucks are now being made of CFRP: the value of  $\sigma_y/E$  ( $6 \times 10^{-3}$ ) is similar to that of spring steel, and the weight saving compensates for the higher cost. CFRP is always worth examining where an innovative use of materials might offer advantages.

**CASE STUDY 2: PLASTIC DESIGN: MATERIALS FOR A PRESSURE VESSEL**

We shall now examine material selection for a pressure vessel able to contain a gas at pressure  $p$ , first minimising the *weight*, and then the *cost*. We shall seek a design that will not fail by plastic collapse (i.e. general yield). But we must be cautious: structures can also fail by *fast fracture*, by *fatigue*, and by *corrosion* superimposed on these other modes of failure. We shall discuss these in Chapters 13, 15 and 23. Here we shall assume that plastic collapse is our only problem.

**Pressure vessel of minimum weight**

The body of an aircraft, the hull of a spacecraft, the fuel tank of a rocket: these are examples of pressure vessels which must be as light as possible.

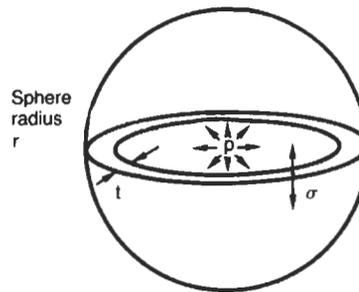

**Fig. 12.5.** Thin-walled spherical pressure vessel.

The stress in the vessel wall (Fig. 12.5) is:

$$\sigma = \frac{pr}{2t}. \quad (12.10)$$

$r$ , the radius of the pressure vessel, is fixed by the design. For safety,  $\sigma \leq \sigma_y/S$ , where  $S$  is the safety factor. The vessel mass is

$$M = 4\pi r^2 t \rho \quad (12.11)$$

so that

$$t = \frac{M}{4\pi r^2 \rho}. \quad (12.12)$$

Substituting for  $t$  in eqn. (12.8) we find that

$$\frac{\sigma_y}{S} \geq \frac{pr}{2} \frac{4\pi r^2 \rho}{M} = \frac{2\pi p r^3 \rho}{M}. \quad (12.13)$$

**Table 12.2** Materials for pressure vessels

Material	$\sigma_y$ (MN m <sup>-2</sup> )	$\rho$ (Mg m <sup>-3</sup> )	$\bar{p}$ (UK£ (US\$) tonne <sup>-1</sup> )	$\frac{\rho}{\sigma_y} \times 10^3$	$\frac{\bar{p}\rho}{\sigma_y} \times 10^6$
Reinforced concrete	200	2.5	160 (240)	13	2.1
Alloy steel (pressure-vessel steel)	1000	7.8	500 (750)	7.8	3.9
Mild steel	220	7.8	300 (450)	36	10.8
Aluminium alloy	400	2.7	1100 (1650)	6.8	7.5
Fibreglass	200	1.8	2000 (3000)	9.0	18
CFRP	600	1.5	50,000 (75,000)	2.5	125

From eqn. (12.11) we have, for the mass,

$$M = S2\pi pr^3 \left( \frac{\rho}{\sigma_y} \right) \quad (12.14)$$

so that for the lightest vessel we require the smallest value of  $(\rho/\sigma_y)$ . Table 12.2 gives values of  $\rho/\sigma_y$  for candidate materials.

By far the lightest pressure vessel is that made of CFRP. Aluminium alloy and pressure-vessel steel come next. Reinforced concrete or mild steel results in a very heavy vessel.

#### Pressure vessel of minimum cost

If the cost of the material is  $\bar{p}$  UK£(US\$) tonne<sup>-1</sup> then the material cost of the vessel is

$$\bar{p}M = \text{constant } \bar{p} \left( \frac{\rho}{\sigma_y} \right). \quad (12.15)$$

Thus material costs are minimised by minimising  $\bar{p}(\rho/\sigma_y)$ . Data are given in Table 12.2.

The proper choice of material is now a quite different one. Reinforced concrete is now the best choice – that is why many water towers, and pressure vessels for nuclear reactors, are made of reinforced concrete. After that comes pressure-vessel steel – it offers the best compromise of both price and weight. CFRP is very expensive.

### CASE STUDY 3: LARGE-STRAIN PLASTICITY – ROLLING OF METALS

*Forging, sheet drawing and rolling* are metal-forming processes by which the section of a billet or slab is reduced by compressive plastic deformation. When a slab is rolled (Fig. 12.6) the section is reduced from  $t_1$  to  $t_2$  over a length  $l$  as it passes through the rolls. At first sight, it might appear that there would be no sliding (and thus no friction) between the slab and the rolls, since these move with the slab. But the metal is elongated in the rolling direction, so it speeds up as it passes through the rolls, and

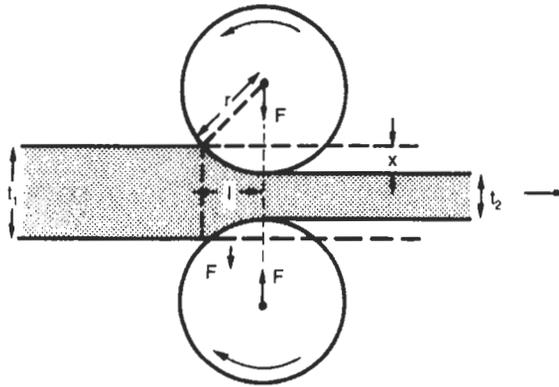


Fig. 12.6. The rolling of metal sheet.

some slipping is inevitable. If the rolls are polished and lubricated (as they are for precision and cold-rolling) the frictional losses are small. We shall ignore them here (though all detailed treatments of rolling include them) and calculate the *rolling torque* for perfectly lubricated rolls.

From the geometry of Fig. 12.6

$$l^2 + (r - x)^2 = r^2$$

or, if  $x = \frac{1}{2}(t_1 - t_2)$  is small (as it almost always is),

$$l = \sqrt{r(t_1 - t_2)}.$$

The rolling force  $F$  must cause the metal to yield over the length  $l$  and width  $w$  (normal to Fig. 12.6). Thus

$$F = \sigma_y w l.$$

If the reaction on the rolls appears halfway along the length marked  $l$ , as shown on the lower roll, the torque is

$$\begin{aligned} T &= \frac{Fl}{2} \\ &= \frac{\sigma_y w l^2}{2}, \end{aligned}$$

giving

$$T = \frac{\sigma_y w r (t_1 - t_2)}{2}. \quad (12.16)$$

The torque required to drive the rolls increases with yield strength  $\sigma_y$ , so hot-rolling (when  $\sigma_y$  is low – see Chapter 17) takes less power than cold-rolling. It obviously increases with the reduction in section ( $t_1 - t_2$ ). And it increases with roll diameter  $2r$ ; this is one of the reasons why small-diameter rolls, often backed by two or more rolls of larger diameter (simply to stop them bending), are used.

Rolling can be analysed in much more detail to include important aspects which we have ignored: friction, the elastic deformation of the rolls, and the constraint of plane strain imposed by the rolling geometry. But this case study gives an idea of why an understanding of plasticity, and the yield strength, is important in forming operations, both for metals and polymers.

### Further reading

- C. R. Calladine, *Engineering Plasticity*, Pergamon Press, 1969.
- R. Hill, *The Mathematical Theory of Plasticity*, Oxford University Press, 1950.
- W. A. Backofen, *Deformation Processing*, Addison-Wesley, 1972.
- M. F. Ashby, *Materials Selection in Mechanical Design*, Pergamon Press, Oxford, 1992.
- M. F. Ashby and D. Cebon, *Case Studies in Materials Selection*, Granta Design, Cambridge, 1996.



## **D. Fast fracture, toughness and fatigue**

---



# Chapter 13

## Fast fracture and toughness

---

### Introduction

Sometimes, structures which were properly designed to avoid both excessive elastic deflection and plastic yielding fail in a catastrophic way by *fast fracture*. Common to these failures – of things like welded ships, welded bridges and gas pipelines and pressure vessels under large internal pressures – is the presence of cracks, often the result of imperfect welding. Fast fracture is caused by the growth – at the speed of sound in the material – of existing cracks that suddenly became unstable. Why do they do this?

### Energy criterion for fast fracture

If you blow up a balloon, energy is stored in it. There is the energy of the compressed gas in the balloon, and there is the elastic energy stored in the rubber membrane itself. As you increase the pressure, the total amount of elastic energy in the system increases.

If we then introduce a flaw into the system, by poking a pin into the inflated balloon, the balloon will explode, and all this energy will be released. The membrane fails by fast fracture, *even though well below its yield strength*. But if we introduce a flaw of the same dimensions into a system with *less* energy in it, as when we poke our pin into a *partially* inflated balloon, the flaw is stable and fast fracture does not occur. Finally, if we blow up the punctured balloon progressively, we eventually reach a pressure at which it suddenly bursts. In other words, we have arrived at a *critical* balloon pressure at which our pin-sized flaw is just unstable, and fast fracture *just* occurs. Why is this?

To make the flaw grow, say by 1 mm, we have to tear the rubber to create 1 mm of new crack surface, and this consumes energy: the tear energy of the rubber per unit area  $\times$  the area of surface torn. If the work done by the gas pressure inside the balloon, plus the release of elastic energy from the membrane itself, is less than this energy the tearing simply cannot take place – it would infringe the laws of thermodynamics.

We can, of course, increase the energy in the system by blowing the balloon up a bit more. The crack or flaw will remain stable (i.e. it will not grow) until the system (balloon plus compressed gas) has stored in it enough energy that, if the crack advances, *more energy is released than is absorbed*. There is, then, a *critical pressure* for fast fracture of a pressure vessel containing a crack or flaw of a given size.

All sorts of accidents (the sudden collapsing of bridges, sudden explosion of steam boilers) have occurred – and still do – due to this effect. In all cases, the critical stress – above which enough energy is available to provide the tearing energy needed to

make the crack advance – was exceeded, taking the designer completely by surprise. But how do we calculate this critical stress?

From what we have said already, we can write down an energy balance which must be met if the crack is to advance, and fast fracture is to occur. Suppose a crack of length  $a$  in a material of thickness  $t$  advances by  $\delta a$ , then we require that: work done by loads  $\geq$  change of elastic energy + energy absorbed at the crack tip, i.e.

$$\delta W \geq \delta U^{\text{el}} + G_c t \delta a \quad (13.1)$$

where  $G_c$  is the energy absorbed per unit area of crack (*not* unit area of new surface), and  $t\delta a$  is the crack area.

$G_c$  is a material property – it is the energy absorbed in making unit area of crack, and we call it the *toughness* (or, sometimes, the ‘critical strain energy release rate’). Its units are energy  $\text{m}^{-2}$  or  $\text{J m}^{-2}$ . A high toughness means that it is hard to make a crack propagate (as in copper, for which  $G_c \approx 10^6 \text{ J m}^{-2}$ ). Glass, on the other hand, cracks very easily;  $G_c$  for glass is only  $\approx 10 \text{ J m}^{-2}$ .

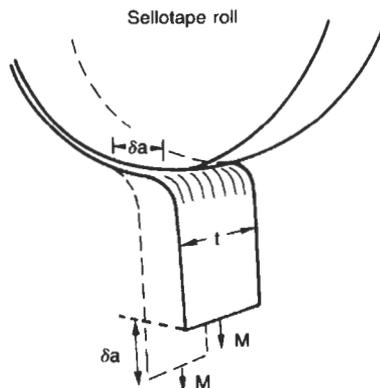


Fig. 13.1. How to determine  $G_c$  for Sellotape adhesive.

This same quantity  $G_c$  measures the strength of adhesives. You can measure it for the adhesive used on sticky tape (like Sellotape) by hanging a weight on a partly peeled length while supporting the roll so that it can freely rotate (hang it on a pencil) as shown in Fig. 13.1. Increase the load to the value  $M$  that just causes rapid peeling (= fast fracture). For this geometry, the quantity  $\delta U^{\text{el}}$  is small compared to the work done by  $M$  (the tape has comparatively little ‘give’) and it can be neglected. Then, from our energy formula,

$$\delta W = G_c t \delta a$$

for fast fracture. In our case,

$$Mg\delta a = G_c t \delta a,$$

$$Mg = G_c t,$$

and therefore,

$$G_c = \frac{Mg}{t}.$$

Typically,  $t = 2 \text{ cm}$ ,  $M = 1 \text{ kg}$  and  $g \approx 10 \text{ m s}^{-2}$ , giving

$$G_c \approx 500 \text{ J m}^{-2}.$$

This is a reasonable value for adhesives, and a value bracketed by the values of  $G_c$  for many polymers.

Naturally, in most cases, we cannot neglect  $\delta U^{\text{el}}$ , and must derive more general relationships. Let us first consider a cracked plate of material loaded so that the displacements at the boundary of the plate are fixed. This is a common mode of loading a material – it occurs frequently in welds between large pieces of steel, for example – and is one which allows us to calculate  $\delta U^{\text{el}}$  quite easily.

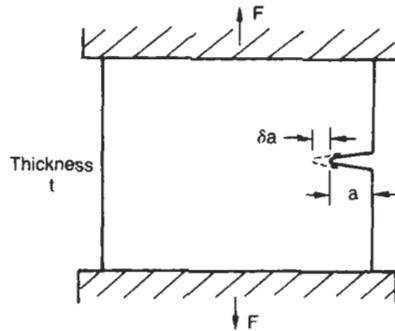


Fig. 13.2. Fast fracture in a fixed plate.

### Fast fracture at fixed displacements

The plate shown in Fig. 13.2 is clamped under tension so that its upper and lower ends are fixed. Since the ends cannot move, the forces acting on them can do no work, and  $\delta W = 0$ . Accordingly, our energy formula gives, for the onset of fast fracture,

$$-\delta U^{\text{el}} = G_c t \delta a. \quad (13.2)$$

Now, as the crack grows into the plate, it allows the material of the plate near the crack to *relax*, so that it becomes less highly stressed, and *loses* elastic energy.  $\delta U^{\text{el}}$  is thus *negative*, so that  $-\delta U^{\text{el}}$  is *positive*, as it must be since  $G_c$  is defined positive. We can estimate  $\delta U^{\text{el}}$  in the way shown in Fig. 13.3.

Let us examine a small cube of material of unit volume inside our plate. Due to the load  $F$  this cube is subjected to a stress  $\sigma$ , producing a strain  $\epsilon$ . Each unit cube therefore

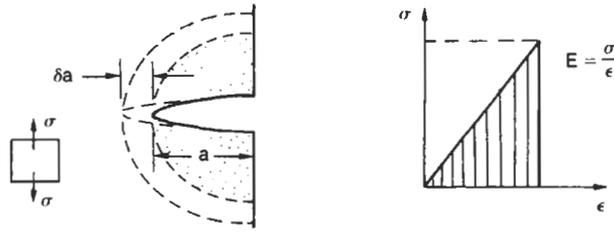


Fig. 13.3. The release of stored strain energy as a crack grows.

has strain energy  $U^{\text{el}}$  of  $\frac{1}{2}\sigma\epsilon$ , or  $\sigma^2/2E$ . If we now introduce a crack of length  $a$ , we can consider that the material in the dotted region relaxes (to zero stress) so as to lose all its strain energy. The energy change is

$$U^{\text{el}} = -\frac{\sigma^2}{2E} \frac{\pi a^2 t}{2}.$$

As the crack spreads by length  $\delta a$ , we can calculate the appropriate  $\delta U^{\text{el}}$  as

$$\delta U^{\text{el}} = \frac{dU^{\text{el}}}{da} \delta a = -\frac{\sigma^2}{2E} \frac{2\pi a t}{2} \delta a.$$

The critical condition (eqn. (13.2)) then gives

$$\frac{\sigma^2 \pi a}{2E} = G_c$$

at onset of fast fracture.

Actually, our assumption about the way in which the plate material relaxes is obviously rather crude, and a rigorous mathematical solution of the elastic stresses and strains around the crack indicates that our estimate of  $\delta U^{\text{el}}$  is too low by exactly a factor of 2. Thus, correctly, we have

$$\frac{\sigma^2 \pi a}{E} = G_c,$$

which reduces to

$$\sigma \sqrt{\pi a} = \sqrt{E G_c} \quad (13.3)$$

at fast fracture.

### Fast fracture at fixed loads

Another, obviously very common way of loading a plate of material, or any other component for that matter, is simply to hang weights on it (fixed loads) (Fig. 13.4). Here the situation is a little more complicated than it was in the case of fixed displacements.

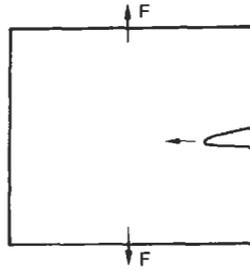


Fig. 13.4. Fast fracture of a dead-loaded plate.

As the crack grows, the plate becomes less *stiff*, and relaxes so that the applied forces move and do work.  $\delta W$  is therefore finite and positive. However,  $\delta U^{el}$  is now positive also (it turns out that some of  $\delta W$  goes into increasing the strain energy of the plate) and our final result for fast fracture is in fact found to be unchanged.

### The fast-fracture condition

Let us now return to our condition for the onset of fast fracture, knowing it to be general\* for engineering structures

$$\sigma\sqrt{\pi a} = \sqrt{EG_c}.$$

The left-hand side of our equation says that *fast fracture will occur when, in a material subjected to a stress  $\sigma$ , a crack reaches some critical size  $a$ : or, alternatively, when material containing cracks of size  $a$  is subjected to some critical stress  $\sigma$* . The right-hand side of our result *depends on material properties only*;  $E$  is obviously a material constant, and  $G_c$ , the energy required to generate unit area of crack, again must depend only on the basic properties of our material. Thus, the important point about the equation is that *the critical combination of stress and crack length at which fast fracture commences is a material constant*.

The term  $\sigma\sqrt{\pi a}$  crops up so frequently in discussing fast fracture that it is usually abbreviated to a single symbol,  $K$ , having units  $\text{MN m}^{-\frac{1}{2}}$ ; it is called, somewhat unclearly, the *stress intensity factor*. Fast fracture therefore occurs when

$$K = K_c$$

where  $K_c (= \sqrt{EG_c})$  is the *critical stress intensity factor*, more usually called the *fracture toughness*.

To summarise:

$$G_c = \text{toughness (sometimes, critical strain energy release rate). Usual units: } \text{kJ m}^{-2};$$

---

\*But see note at end of this chapter.

$K_c = \sqrt{EG_c}$  = fracture toughness (sometimes: critical stress intensity factor). Usual units:  $\text{MN m}^{-\frac{1}{2}}$ ;

$K = \sigma\sqrt{\pi a}$  = stress intensity factor\*. Usual units:  $\text{MN m}^{-\frac{1}{2}}$ .

Fast fracture occurs when  $K = K_c$ .

### Data for $G_c$ and $K_c$

$K_c$  can be determined experimentally for any material by inserting a crack of known length  $a$  into a piece of the material and loading until fast fracture occurs.  $G_c$  can be derived from the data for  $K_c$  using the relation  $K_c = \sqrt{EG_c}$ . Figures 13.5 and 13.6 and Table 13.1 show experimental data for  $K_c$  and  $G_c$  for a wide range of metals, polymers, ceramics and composites. The values of  $K_c$  and  $G_c$  range considerably, from the least tough materials, like ice and ceramics, to the toughest, like ductile metals; polymers have intermediate toughness,  $G_c$ , but low fracture toughness,  $K_c$  (because their *moduli* are low). However, reinforcing polymers to make *composites* produces materials having good fracture toughnesses. Finally, although most metals are tough at or above room

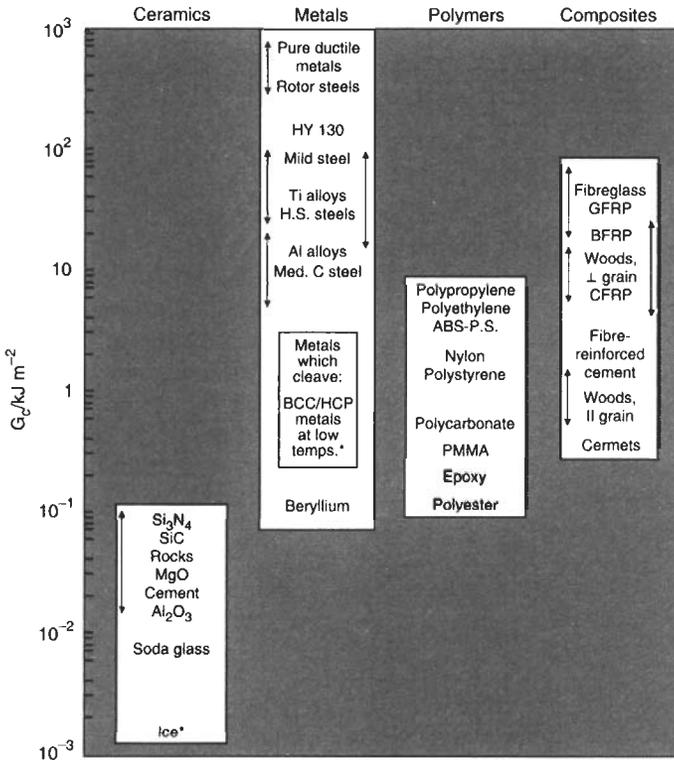


Fig. 13.5. Toughness,  $G_c$  (values at room temperature unless starred).

\*But see note at end of this chapter.

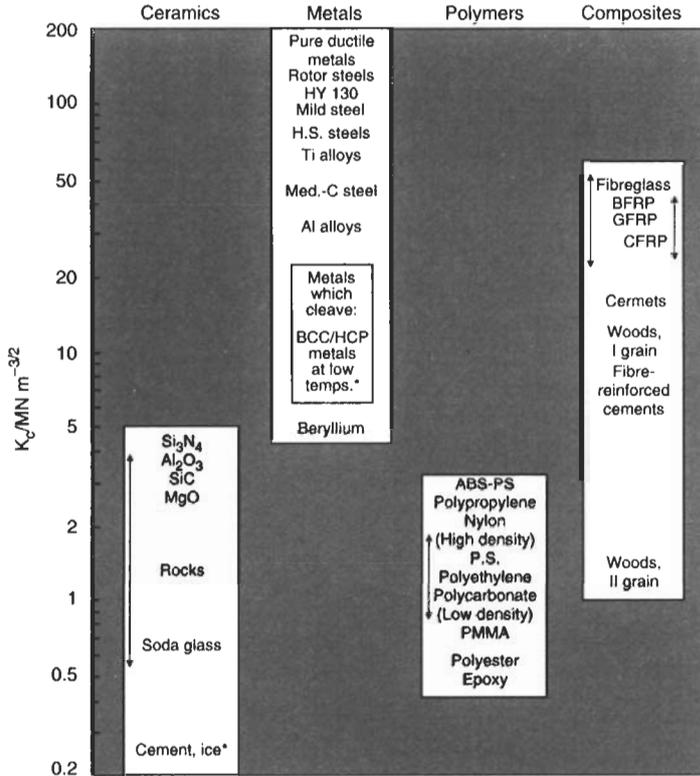


Fig. 13.6. Fracture toughness,  $K_c$  (values at room temperature unless starred).

temperature, when many (e.g. b.c.c. metals like steels, or h.c.p. metals) are cooled sufficiently, they become quite brittle as the data show.

Obviously these figures for toughness and fracture toughness are extremely important – ignorance of such data has led, and can continue to lead, to engineering disasters of the sort we mentioned at the beginning of this chapter. But just how do these large variations between various materials arise? Why *is* glass so brittle and annealed copper so tough? We shall explain why in Chapter 14.

#### A note on the Stress Intensity, $K$

On pp. 134 and 135 we showed that

$$K = \sigma \sqrt{\pi a} = \sqrt{EG_c}$$

at onset of fast fracture. Strictly speaking, this result is valid only for a crack through the centre of a wide plate of material. In practice, the problems we encounter seldom

**Table 13.1** Toughness,  $G_c$ , and fracture toughness,  $K_{Ic}$ 

Material	$G_c$ (kJ/m <sup>2</sup> )	$K_{Ic}$ (MN/m <sup>3/2</sup> )
Pure ductile metals (e.g. Cu, Ni, Ag, Al)	100–1000	100–350
Rotor steels (A533; Discalloy)	220–240	204–214
Pressure-vessel steels (HY130)	150	170
High-strength steels (HSS)	15–118	50–154
Mild steel	100	140
Titanium alloys (Ti6Al4V)	26–114	55–115
GFRPs	10–100	20–60
Fibreglass (glassfibre epoxy)	40–100	42–60
Aluminium alloys (high strength–low strength)	8–30	23–45
CFRPs	5–30	32–45
Common woods, crack $\perp$ to grain	8–20	11–13
Boron-fibre epoxy	17	46
Medium-carbon steel	13	51
Polypropylene	8	3
Polyethylene (low density)	6–7	1
Polyethylene (high density)	6–7	2
ABS polystyrene	5	4
Nylon	2–4	3
Steel-reinforced cement	0.2–4	10–15
Cast iron	0.2–3	6–20
Polystyrene	2	2
Common woods, crack $\parallel$ to grain	0.5–2	0.5–1
Polycarbonate	0.4–1	1.0–2.6
Cobalt/tungsten carbide cermets	0.3–0.5	14–16
PMMA	0.3–0.4	0.9–1.4
Epoxy	0.1–0.3	0.3–0.5
Granite (Westerly Granite)	0.1	3
Polyester	0.1	0.5
Silicon nitride, Si <sub>3</sub> N <sub>4</sub>	0.1	4–5
Beryllium	0.08	4
Silicon carbide SiC	0.05	3
Magnesia, MgO	0.04	3
Cement/concrete, unreinforced	0.03	0.2
Calcite (marble, limestone)	0.02	0.9
Alumina, Al <sub>2</sub> O <sub>3</sub>	0.02	3–5
Shale (oilshale)	0.02	0.6
Soda glass	0.01	0.7–0.8
Electrical porcelain	0.01	1
Ice	0.003	0.2*

\*Values at room temperature unless starred.

satisfy this geometry, and a numerical correction to  $\sigma\sqrt{\pi a}$  is required to get the strain energy calculation right. In general we write:

$$K = Y \sigma \sqrt{\pi a},$$

where  $Y$  is the numerical correction factor. Values of  $Y$  can be found from tables in standard reference books such as that listed under Further Reading. However,

provided the crack length  $a$  is small compared to the width of the plate  $W$ , it is usually safe to assume that  $Y \approx 1$ .

### Further reading

- R. W. Hertzberg, *Deformation and Fracture Mechanics of Engineering Materials*, 4th edition, 1996.  
B. R. Lawn and T. R. Wilshaw, *Fracture of Brittle Solids*, Cambridge University Press, 1975, Chap. 3.  
J. F. Knott, *Fundamentals of Fracture Mechanics*, Butterworths, 1973, Chap. 4.  
H. Tada, P. Paris and G. Irwin, *The Stress Analysis of Cracks Handbook*, Del Research Corporation, St Louis, 1973 (for Tabulation of Stress Intensities).

# Chapter 14

## Micromechanisms of fast fracture

---

In Chapter 13 we showed that, if a material contains a crack, and is sufficiently stressed, the crack becomes unstable and grows – at up to the speed of sound in the material – to cause catastrophically rapid fracture, or *fast fracture* at a stress less than the yield stress. We were able to quantify this phenomenon and obtained a relationship for the onset of fast fracture

$$\sigma\sqrt{\pi a} = \sqrt{EG_c}$$

or, in more succinct notation,

$$K = K_c \text{ for fast fracture.}$$

It is helpful to compare this with other, similar, ‘failure’ criteria:

$$\sigma = \sigma_y \text{ for yielding,}$$

$$M = M_p \text{ for plastic collapse,}$$


$$P/A = H \text{ for indentation.}$$

(Here  $M$  is the moment and  $M_p$  the fully-plastic moment of, for instance, a beam;  $P/A$  is the indentation pressure and  $H$  the hardness of, for example, armour plating.) The left-hand side of each of these equations describes the *loading conditions*; the right-hand side is a *material property*. When the left-hand side (which increases with load) equals the right-hand side (which is fixed), failure occurs.

Some materials, like glass, have low  $G_c$  and  $K_c$ , and crack easily; ductile metals have high  $G_c$  and  $K_c$  and are very resistant to fast-fracture; polymers have intermediate  $G_c$ , but can be made tougher by making them into composites; and (finally) many metals, when cold, become brittle – that is,  $G_c$  and  $K_c$  fall with temperature. How can we explain these important observations?

### Mechanisms of crack propagation, 1: ductile tearing

Let us first of all look at what happens when we load a cracked piece of a *ductile* metal – in other words, a metal that can flow readily to give large plastic deformations (like pure copper; or mild steel at, or above, room temperature). If we load the material sufficiently, we can get fracture to take place starting from the crack. If you examine the

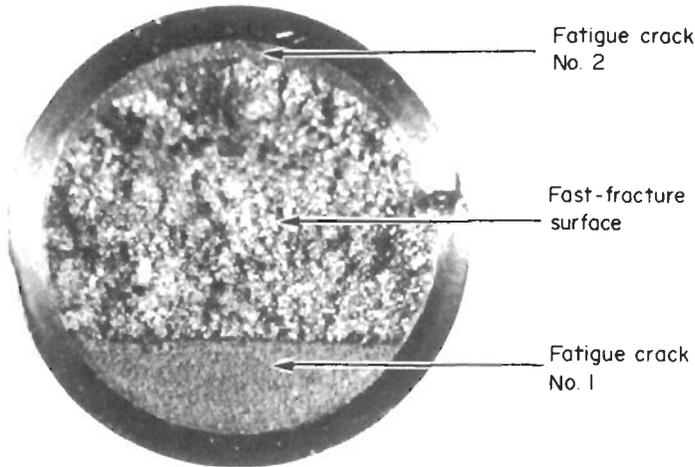

**Fig. 14.1.** Before it broke, this steel bolt held a seat onto its mounting at Milan airport. Whenever someone sat down, the lower part of the cross-section went into tension, causing a crack to grow there by *metal fatigue* (Chapter 15; crack No. 1). When someone got up again, the upper part went into tension, causing fatigue crack No. 2 to grow. Eventually the bolt failed by fast fracture from the larger of the two fatigue cracks. The victim was able to escape with the fractured bolt!

surfaces of the metal after it has fractured (Fig. 14.1) you see that the fracture surface is extremely rough, indicating that a great deal of plastic work has taken place. Let us explain this observation. Whenever a crack is present in a material, the stress close to the crack,  $\sigma_{\text{local}}$ , is greater than the average stress  $\sigma$  applied to the piece of material; the crack has the effect of *concentrating* the stress. Mathematical analysis shows that the local stress ahead of a *sharp* crack in an elastic material is

$$\sigma_{\text{local}} = \sigma + \sigma \sqrt{\frac{a}{2r}}. \quad (14.1)$$

The closer one approaches to the tip of the crack, the higher the local stress becomes, until at some distance  $r_y$  from the tip of the crack the stress reaches the yield stress,  $\sigma_y$ , of the material, and plastic flow occurs (Fig. 14.2). The distance  $r_y$  is easily calculated by setting  $\sigma_{\text{local}} = \sigma_y$  in eqn. (14.1). Assuming  $r_y$  to be small compared to the crack length,  $a$ , the result is

$$\begin{aligned} r_y &= \frac{\sigma^2 a}{2\sigma_y^2} \\ &= \frac{K^2}{2\pi\sigma_y^2}. \end{aligned} \quad (14.2)$$

The crack propagates when  $K$  is equal to  $K_c$ ; the width of the *plastic zone*,  $r_y$ , is then given by eqn. (14.2) with  $K$  replaced by  $K_c$ . Note that the zone of plasticity shrinks

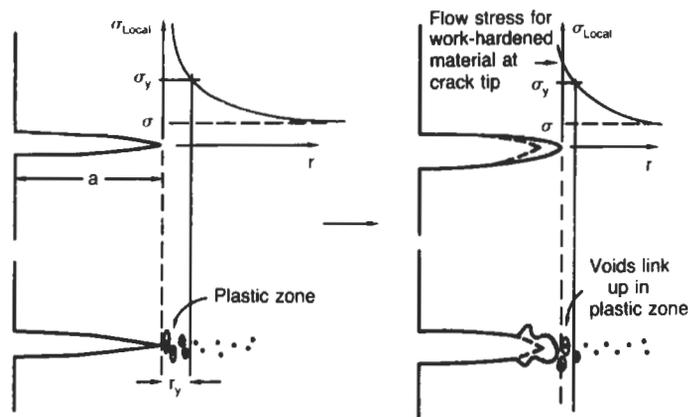


Fig. 14.2. Crack propagation by ductile tearing.

rapidly as  $\sigma_y$  increases: cracks in soft metals have a large plastic zone; cracks in hard ceramics have a small zone, or none at all.

Even when nominally pure, most metals contain tiny *inclusions* (or particles) of chemical compounds formed by reaction between the metal and impurity atoms. Within the plastic zone, plastic flow takes place around these inclusions, leading to elongated cavities, as shown in Fig. 14.2. As plastic flow progresses, these cavities link up, and the crack advances by means of this *ductile tearing*. The plastic flow at the crack tip naturally turns our initially sharp crack into a *blunt* crack, and it turns out from the stress mathematics that this *crack blunting* decreases  $\sigma_{\text{local}}$  so that, at the crack tip itself,  $\sigma_{\text{local}}$  is just sufficient to keep on plastically deforming the work-hardened material there, as the diagram shows.

The important thing about crack growth by ductile tearing is that *it consumes a lot of energy by plastic flow*; the bigger the plastic zone, the more energy is absorbed. High energy absorption means that  $G_c$  is high, and so is  $K_c$ . This is why ductile metals are so tough. Other materials, too, owe their toughness to this behaviour – plasticine is one, and some polymers also exhibit toughening by processes similar to ductile tearing.

## Mechanisms of crack propagation, 2: cleavage

If you now examine the fracture surface of something like a ceramic, or a glass, you see a very different state of affairs. Instead of a very rough surface, indicating massive local plastic deformation, you see a rather featureless, flat surface suggesting little or no plastic deformation. How is it that cracks in ceramics or glasses can spread without plastic flow taking place? Well, the local stress ahead of the crack tip, given by our formula

$$\sigma_{\text{local}} = \sigma + \sigma \sqrt{\frac{a}{2r}},$$

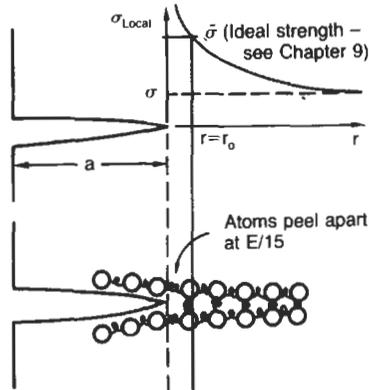


Fig. 14.3. Crack propagation by cleavage.

can clearly approach very high values very near to the crack tip *provided that blunting of our sharp crack tip does not occur*. As we showed in Chapter 8, ceramics and glasses have very high yield strengths, and thus very little plastic deformation takes place at crack tips in these materials. Even allowing for a small degree of crack blunting, the local stress at the crack tip is still in excess of the ideal strength and is thus large enough to literally break apart the interatomic bonds there; the crack then spreads between a pair of atomic planes giving rise to an atomically flat surface by *cleavage*. The energy required simply to break the interatomic bonds is *much* less than that absorbed by ductile tearing in a tough material, and this is why materials like ceramics and glasses are so brittle. It is also why some steels become brittle and fail like glass, at low temperatures – as we shall now explain.

At low temperatures metals having b.c.c. and h.c.p. structures become brittle and fail by cleavage, even though they may be tough at or above room temperature. In fact, only those metals with an f.c.c. structure (like copper, lead, aluminium) remain unaffected by temperature in this way. In metals not having an f.c.c. structure, the motion of dislocations is assisted by the *thermal agitation* of the atoms (we shall talk in more detail about *thermally activated* processes in Chapter 18). At lower temperatures this thermal agitation is less, and the dislocations cannot move as easily as they can at room temperature in response to a stress – the intrinsic lattice resistance (Chapter 10) increases. The result is that the yield strength rises, and the plastic zone at the crack tip shrinks until it becomes so small that the fracture mechanism changes from ductile tearing to cleavage. This effect is called the *ductile-to-brittle transition*; for steels it can be as high as  $\approx 0^\circ\text{C}$ , depending on the composition of the steel; steel structures like ships, bridges and oil rigs are much more likely to fail in winter than in summer.

A somewhat similar thing happens in many polymers at the *glass-rubber transition* that we mentioned in Chapter 6. Below the transition these polymers are much more brittle than above it, as you can easily demonstrate by cooling a piece of rubber or polyethylene in liquid nitrogen. (Many other polymers, like epoxy resins, have low  $G_c$  values at all temperatures simply because they are heavily cross-linked at all temperatures by *covalent* bonds and the material does not flow at the crack tip to cause blunting.)

## Composites, including wood

As Figs. 13.5 and 13.6 show, composites are tougher than ordinary polymers. The low toughness of materials like epoxy resins, or polyester resins, can be enormously increased by reinforcing them with carbon fibre or glass fibre. But why is it that putting a second, equally (or more) brittle material like graphite or glass into a brittle polymer makes a tough composite? The reason is the *fibres act as crack stoppers* (Fig. 14.4).

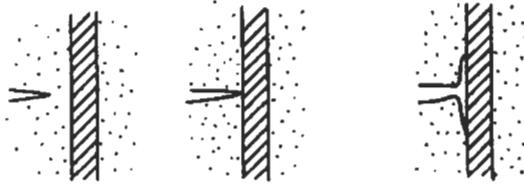


Fig. 14.4. Crack stopping in composites.

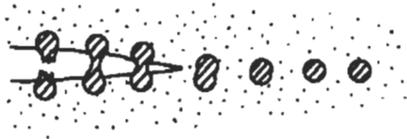


Fig. 14.5. Rubber-toughened polymers.

The sequence in the diagram shows what happens when a crack runs through the brittle matrix towards a fibre. As the crack reaches the fibre, the stress field just ahead of the crack separates the matrix from the fibre over a small region (a process called *debonding*) and the crack is blunted so much that its motion is *arrested*. Naturally, this only works if the crack is running normal to the fibres: wood is very tough across the grain, but can be split easily (meaning that  $G_c$  is low) along it. One of the reasons why fibre composites are so useful in engineering design – in addition to their high *stiffnesses* that we talked about in Chapter 6 – is their high *toughness* produced in this way. Of course, there are other ways of making polymers tough. The addition of small particles ('fillers') of various sorts to polymers can modify their properties considerably. Rubber-toughened polymers (like ABS), for example, derive their toughness from the small rubber particles they contain. A crack intersects and stretches them as shown in Fig. 14.5. The particles act as little springs, clamping the crack shut, and thereby increasing the load needed to make it propagate.

## Avoiding brittle alloys

Let us finally return to the toughnesses of metals and alloys, as these are by far the most important class of materials for highly stressed applications. Even at, or above, room

temperature, when nearly all common pure metals are tough, alloying of these metals with other metals or elements (e.g. with carbon to produce steels) can reduce the toughness. This is because alloying increases the resistance to dislocation motion (Chapter 10), raising the yield strength and causing the plastic zone to shrink. A more marked decrease in toughness can occur if enough impurities are added to make precipitates of chemical *compounds* formed between the metal and the impurities. These compounds can often be very brittle and, if they are present in the shape of extended plates (e.g. sigma-phase in stainless steel; graphite in cast iron), cracks can spread along the plates, leading to brittle fracture. Finally, heat treatments of alloys like steels can produce different *crystal structures* having great hardness (but also therefore great brittleness because crack blunting cannot occur). A good example of such a material is high-carbon steel after quenching into water from bright red heat: it becomes as brittle as glass. Proper heat treatment, following suppliers' specifications, is essential if materials are to have the properties you want. You will see an example of the unexpected results of faulty heat treatment in a Case Study given in Chapter 16.

### Further reading

- B. R. Lawn and T. R. Wilshaw, *Fracture of Brittle Solids*, Cambridge University Press, 1975, Chaps. 6 and 7.  
J. F. Knott, *Fundamentals of Fracture Mechanics*, Butterworths, 1973, Chap. 8.

# Chapter 15

## Fatigue failure

---

### Introduction

In the last two chapters we examined the conditions under which a crack was stable, and would not grow, and the condition


$$K = K_c$$

under which it would propagate catastrophically by fast fracture. If we know the maximum size of crack in the structure we can then choose a working load at which fast fracture will not occur.

But cracks can form, and grow slowly, at loads lower than this, if either the stress is cycled or if the environment surrounding the structure is corrosive (most are). The first process of slow crack growth – *fatigue* – is the subject of this chapter. The second – *corrosion* – is discussed later, in Chapters 21 to 24.

More formally: *if a component or structure is subjected to repeated stress cycles, like the loading on the connecting rod of a petrol engine or on the wings of an aircraft – it may*

Table 15.1

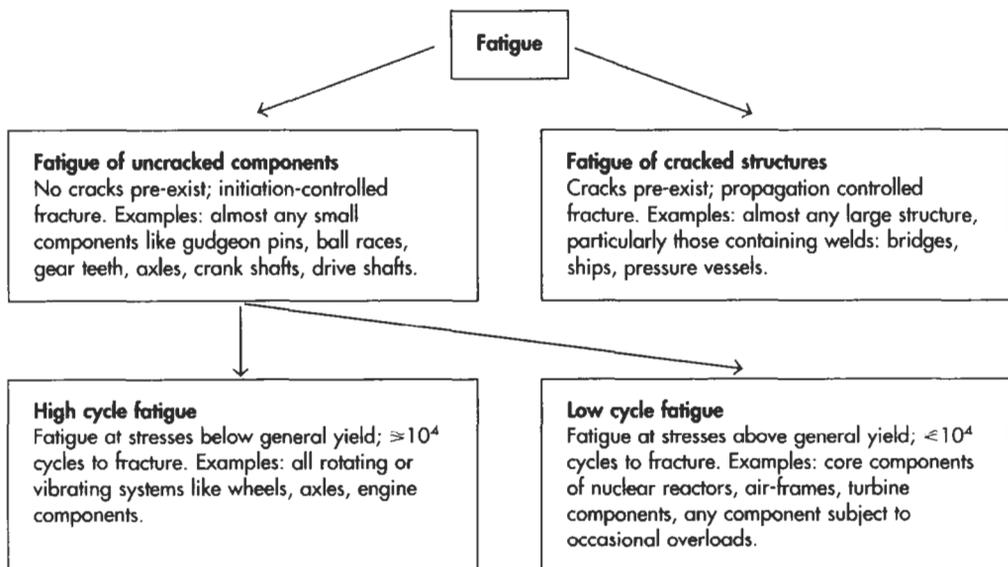

fail at stresses well below the tensile strength,  $\sigma_{ts}$ , and often below the yield strength,  $\sigma_y$ , of the material. The processes leading to this failure are termed 'fatigue'. When the clip of your pen breaks, when the pedals fall off your bicycle, when the handle of the refrigerator comes away in your hand, it is usually fatigue which is responsible.

We distinguish three categories of fatigue (Table 15.1).

### Fatigue behaviour of uncracked components

Tests are carried out by cycling the material either in tension (compression) or in rotating bending (Fig. 15.1). The stress, in general, varies sinusoidally with time,

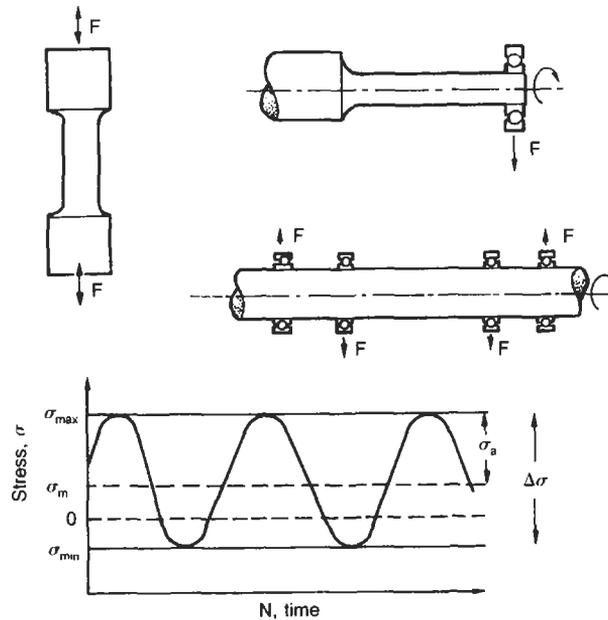


Fig. 15.1. Fatigue testing.

though modern servo-hydraulic testing machines allow complete control of the wave shape.

We define:

$$\Delta\sigma = \sigma_{\max} - \sigma_{\min}; \quad \sigma_m = \frac{\sigma_{\max} + \sigma_{\min}}{2}; \quad \sigma_a = \frac{\sigma_{\max} - \sigma_{\min}}{2}$$

where  $N$  = number of fatigue cycles and  $N_f$  = number of cycles to failure. We will consider fatigue under zero mean stress ( $\sigma_m = 0$ ) first, and later generalise the results to non-zero mean stress.

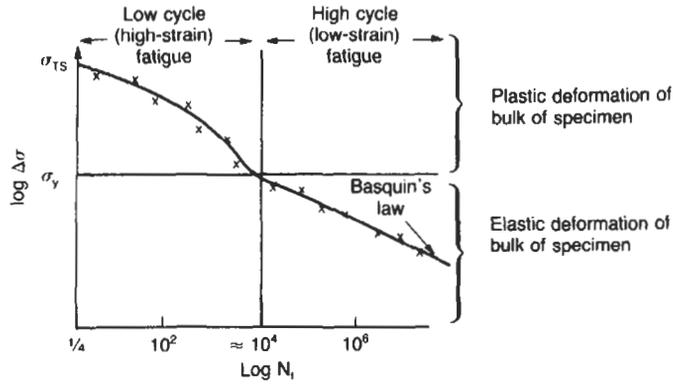


Fig. 15.2. Initiation-controlled high-cycle fatigue – Basquin’s Law.

For *high-cycle fatigue of uncracked components*, where neither  $\sigma_{\max}$  nor  $|\sigma_{\min}|$  are above the yield stress, it is found empirically that the experimental data can be fitted to an equation of form

$$\Delta\sigma N_f^a = C_1. \tag{15.1}$$

This relationship is called *Basquin’s Law*. Here,  $a$  is a constant (between  $\frac{1}{8}$  and  $\frac{1}{5}$  for most materials) and  $C_1$  is a constant also.

For *low-cycle fatigue of un-cracked components* where  $\sigma_{\max}$  or  $|\sigma_{\min}|$  are above  $\sigma_y$  Basquin’s Law no longer holds, as Fig. 15.2 shows. But a linear plot is obtained if the plastic strain range  $\Delta\epsilon^{Pl}$ , defined in Fig. 15.3, is plotted, on logarithmic scales, against the cycles to failure,  $N_f$  (Fig. 15.4). This result is known as the *Coffin–Manson Law*:

$$\Delta\epsilon^{Pl} N_f^b = C_2 \tag{15.2}$$

where  $b$  (0.5 to 0.6) and  $C_2$  are constants.

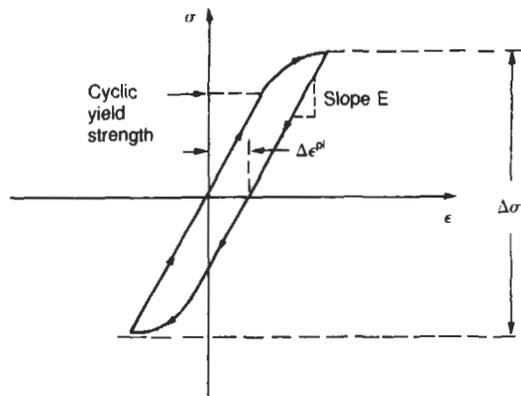


Fig. 15.3. The plastic strain range,  $\Delta\epsilon^{Pl}$ , in low-cycle fatigue.

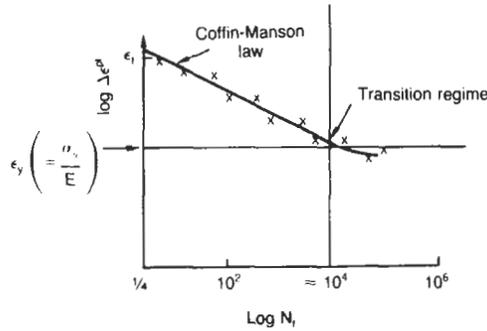


Fig. 15.4. Initiation-controlled low-cycle fatigue – the Coffin–Manson Law.

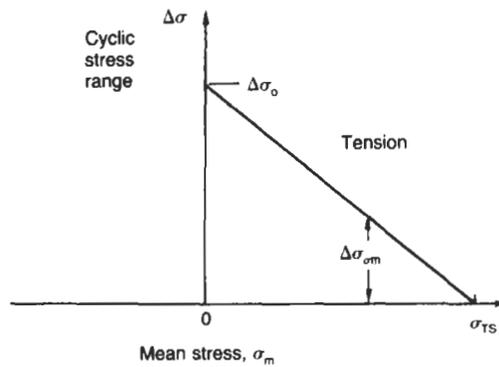


Fig. 15.5. Goodman’s Rule – the effect of a tensile mean stress on initiation-controlled fatigue.

These two laws (given data for  $a$ ,  $b$ ,  $C_1$  and  $C_2$ ) adequately describe the fatigue failure of unnotched components, cycled at constant amplitude about a mean stress of zero. What do we do when  $\Delta\sigma$ , and  $\sigma_m$ , vary?

When material is subjected to a mean tensile stress (i.e.  $\sigma_m > 0$ ) the stress range must be decreased to preserve the same  $N_f$  according to *Goodman’s Rule* (Fig. 15.5)

$$\Delta\sigma_{\sigma m} = \Delta\sigma_0 \left( 1 - \frac{\sigma_m}{\sigma_{TS}} \right). \tag{15.3}$$

(Here  $\Delta\sigma_0$  is the cyclic stress range for failure in  $N_f$  cycles under zero mean stress, and  $\Delta\sigma_{\sigma m}$  is the same thing for a mean stress of  $\sigma_m$ .) Goodman’s Rule is empirical, and does not always work – then tests simulating service conditions must be carried out, and the results used for the final design. But preliminary designs are usually based on this rule.

When, in addition,  $\Delta\sigma$  varies during the lifetime of a component, the approach adopted is to sum the damage according to *Miner’s Rule* of *cumulative damage*:

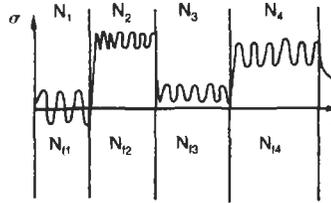


Fig. 15.6. Summing damage due to initiation-controlled fatigue.

$$\sum_i \frac{N_i}{N_{fi}} = 1. \quad (15.4)$$

Here  $N_{fi}$  is the number of cycles to fracture under the stress cycle in region  $i$ , and  $N_i/N_{fi}$  is the fraction of the lifetime used up after  $N_i$  cycles in that region. Failure occurs when the sum of the fractions is unity (eqn. (15.4)). This rule, too, is an empirical one. It is widely used in design against fatigue failure; but if the component is a critical one, Miner's Rule should be checked by tests simulating service conditions.

### Fatigue behaviour of cracked components

Large structures – particularly welded structures like bridges, ships, oil rigs, nuclear pressure vessels – always contain cracks. All we can be sure of is that the initial length of these cracks is less than a given length – the length we can reasonably detect when we check or examine the structure. To assess the safe life of the structure we need to know how long (for how many cycles) the structure can last before one of these cracks grows to a length at which it propagates catastrophically.

Data on fatigue crack propagation are gathered by cyclically loading specimens containing a sharp crack like that shown in Fig. 15.7. We define

$$\Delta K = K_{\max} - K_{\min} = \Delta\sigma\sqrt{\pi a}$$

The cyclic stress intensity  $\Delta K$  increases with time (at constant load) because the crack grows in tension. It is found that the crack growth per cycle,  $da/dN$ , increases with  $\Delta K$  in the way shown in Fig. 15.8.

In the steady-state régime, the crack growth rate is described by

$$\frac{da}{dN} = A\Delta K^m \quad (15.5)$$

where  $A$  and  $m$  are material constants. Obviously, if  $a_0$  (the initial crack length) is given, and the final crack length ( $a_f$ ) at which the crack becomes unstable and runs rapidly is

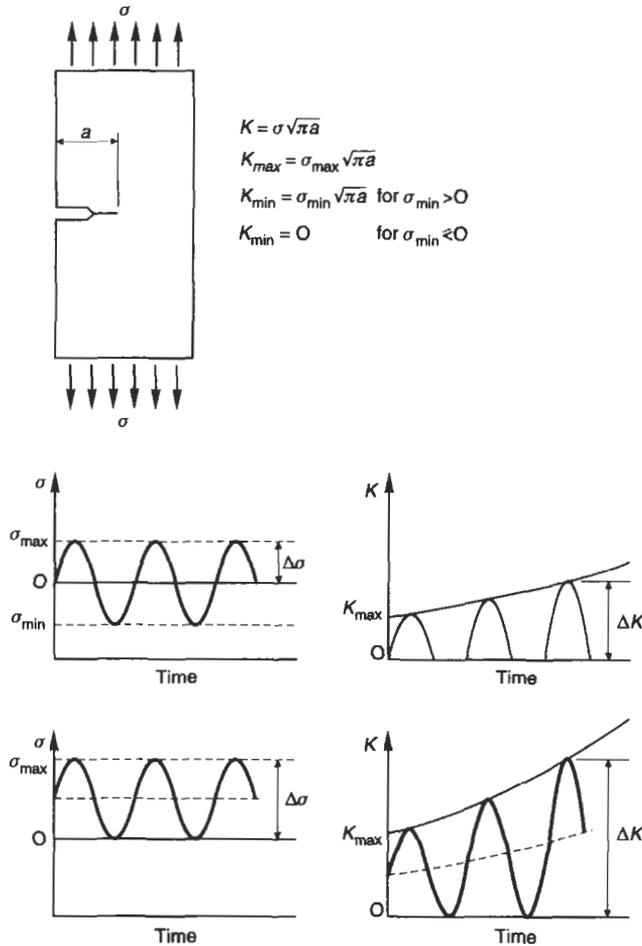


Fig. 15.7. Fatigue-crack growth in pre-cracked components.

known or can be calculated, then the safe number of cycles can be estimated by integrating the equation

$$N_f = \int_0^{N_f} dN = \int_{a_0}^{a_f} \frac{da}{A(\Delta K)^m} \quad (15.6)$$

remembering that  $\Delta K = \Delta\sigma \sqrt{\pi a}$ . Case Study 3 of Chapter 16 gives a worked example of this method of estimating fatigue life.

### Fatigue mechanisms

Cracks grow in the way shown in Fig. 15.9. In a pure metal or polymer (left-hand diagram), the tensile stress produces a plastic zone (Chapter 14) which makes the crack

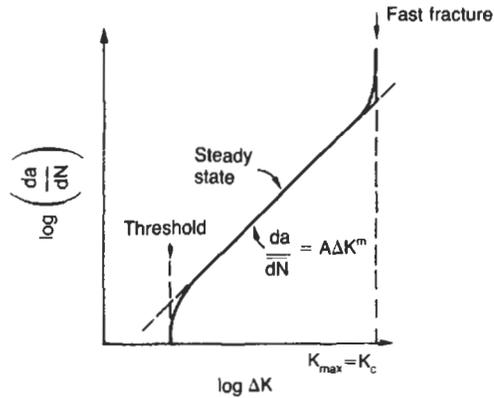


Fig. 15.8. Fatigue crack-growth rates for pre-cracked material.

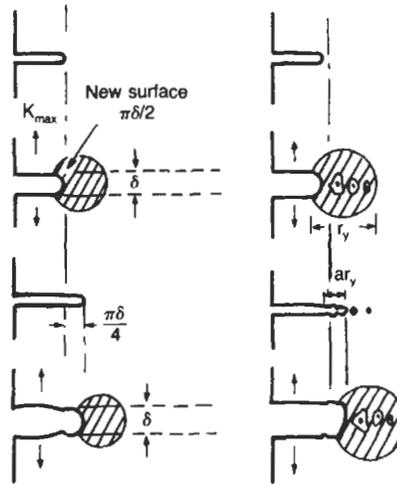


Fig. 15.9. How fatigue cracks grow.

tip stretch open by the amount  $\delta$ , creating new surface there. As the stress is removed the crack closes and the new surface folds forward, extending the crack (roughly, by  $\delta$ ). On the next cycle the same thing happens again, and the crack inches forward, roughly at  $da/dN \approx \delta$ . Note that the crack cannot grow when the stress is compressive because the crack faces come into contact and carry the load (crack closure).

We mentioned in Chapter 14 that real engineering alloys always have little inclusions in them. Then (right-hand diagram of Fig. 15.9), within the plastic zone, holes form and link with each other, and with the crack tip. The crack now advances a little faster than before, aided by the holes.

In *pre-cracked structures* these processes determine the fatigue life. In uncracked components subject to *low-cycle fatigue*, the general plasticity quickly roughens the

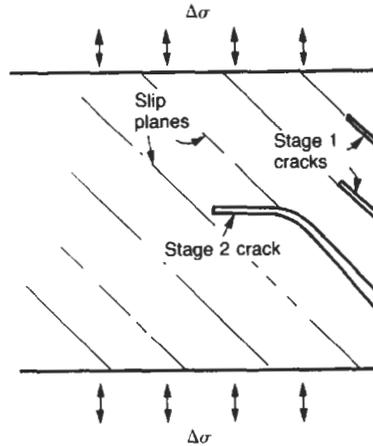


Fig. 15.10. How cracks form in low-cycle fatigue. Once formed, they grow as shown in Fig. 15.9.

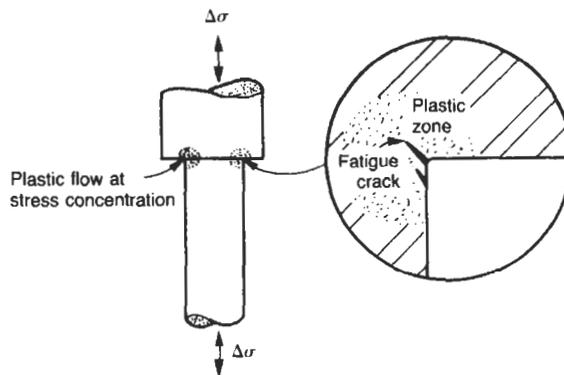


Fig. 15.11. How cracks form in high-cycle fatigue.

surface, and a crack forms there, propagating first along a slip plane ('Stage 1' crack) and then, by the mechanism we have described, normal to the tensile axis (Fig. 15.10).

High-cycle fatigue is different. When the stress is below general yield, almost all of the life is taken up in initiating a crack. Although there is no *general* plasticity, there is *local* plasticity wherever a notch or scratch or change of section concentrates stress. A crack ultimately initiates in the zone of one of these stress concentrations (Fig. 15.11) and propagates, slowly at first, and then faster, until the component fails. For this reason, sudden changes of section or scratches are very dangerous in high-cycle fatigue, often reducing the fatigue life by orders of magnitude.

## Further reading

R. W. Hertzberg, *Deformation and Fracture Mechanics of Engineering Materials*, 4th edition, Wiley, 1996.

J. F. Knott, *Fundamentals of Fracture Mechanics*, Butterworths, 1973, Chap. 9.

T. V. Duggan and J. Byrne, *Fatigue as a Design Criterion*, Macmillan, 1977.

# Chapter 16

## Case studies in fast fracture and fatigue failure

### Introduction

In this third set of Case Studies we examine three instances in which failure by crack-propagation was, or could have become, a problem. The first is the analysis of an ammonia tank that failed by fast fracture. The second concerns a common problem: the checking, for safety reasons, of cylinders designed to hold gas at high pressure. The last is a fatigue problem: the safe life of a reciprocating engine known to contain a large crack.

### CASE STUDY 1: FAST FRACTURE OF AN AMMONIA TANK

Figure 16.1 shows part of a steel tank which came from a road tank vehicle. The tank consisted of a cylindrical shell about 6 m long. A hemispherical cap was welded to each end of the shell with a circumferential weld. The tank was used to transport liquid ammonia. In order to contain the liquid ammonia the pressure had to be equal to the saturation pressure (the pressure at which a mixture of liquid and vapour is in equilibrium). The saturation pressure increases rapidly with temperature: at 20°C the absolute pressure is 8.57 bar; at 50°C it is 20.33 bar. The *gauge* pressure at 50°C is 19.33 bar, or  $1.9 \text{ MN m}^{-2}$ . Because of this the tank had to function as a pressure vessel. The maximum operating pressure was  $2.07 \text{ MN m}^{-2}$  gauge. This allowed the tank to be used safely to 50°C, above the maximum temperature expected in even a hot climate.

While liquid was being unloaded from the tank a fast fracture occurred in one of the circumferential welds and the cap was blown off the end of the shell. In order to decant

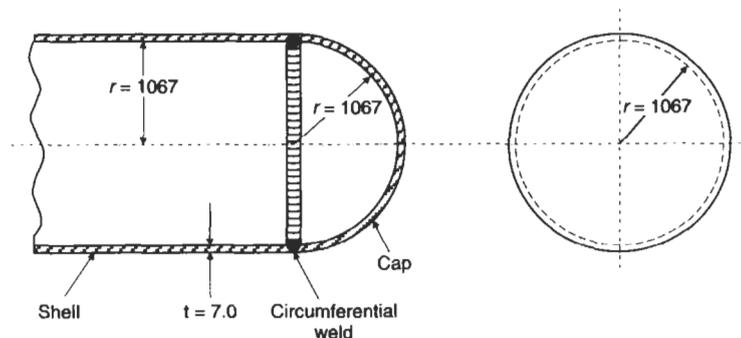


Fig. 16.1. The weld between the shell and the end cap of the pressure vessel. Dimensions in mm.

the liquid the space above the liquid had been pressurised with ammonia gas using a compressor. The normal operating pressure of the compressor was  $1.83 \text{ MN m}^{-2}$ ; the maximum pressure (set by a safety valve) was  $2.07 \text{ MN m}^{-2}$ . One can imagine the effect on nearby people of this explosive discharge of a large volume of highly toxic vapour.

### Details of the failure

The geometry of the failure is shown in Fig. 16.2. The initial crack, 2.5 mm deep, had formed in the heat-affected zone between the shell and the circumferential weld. The defect went some way around the circumference of the vessel. The cracking was intergranular, and had occurred by a process called stress corrosion cracking (see Chapter 23). The final fast fracture occurred by transgranular cleavage (see Chapter 14). This indicates that the heat-affected zone must have had a very low fracture toughness. In this case study we predict the critical crack size for fast fracture using the fast fracture equation.

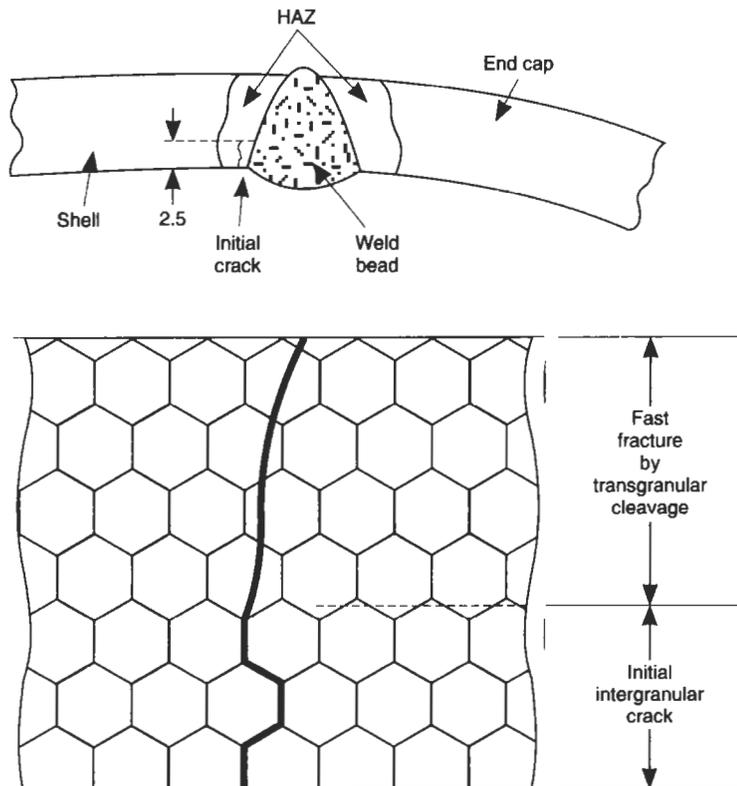


Fig. 16.2. The geometry of the failure. Dimensions in mm.

### Material properties

The tank was made from high-strength low-alloy steel with a yield strength of  $712 \text{ MN m}^{-2}$  and a fracture toughness of  $80 \text{ MN m}^{-3/2}$ . The heat from the welding process had altered the structure of the steel in the heat-affected zone to give a much greater yield strength ( $940 \text{ MN m}^{-2}$ ) but a much lower fracture toughness ( $39 \text{ MN m}^{-3/2}$ ).

### Calculation of critical stress for fast fracture

The longitudinal stress  $\sigma$  in the wall of a cylindrical pressure vessel containing gas at pressure  $p$  is given by

$$\sigma = \frac{pr}{2t},$$

provided that the wall is thin ( $t \ll r$ ).  $p = 1.83 \text{ MN m}^{-2}$ ,  $r = 1067 \text{ mm}$  and  $t = 7 \text{ mm}$ , so  $\sigma = 140 \text{ MN m}^{-2}$ . The fast fracture equation is

$$Y\sigma\sqrt{\pi a} = K_c.$$

Because the crack penetrates a long way into the wall of the vessel, it is necessary to take into account the correction factor  $Y$  (see Chapter 13). Figure 16.3 shows that  $Y = 1.92$  for our crack. The critical stress for fast fracture is given by

$$\sigma = \frac{K_c}{Y\sqrt{\pi a}} = \frac{39}{1.92\sqrt{\pi \cdot 0.0025}} = 229 \text{ MN m}^{-2}.$$

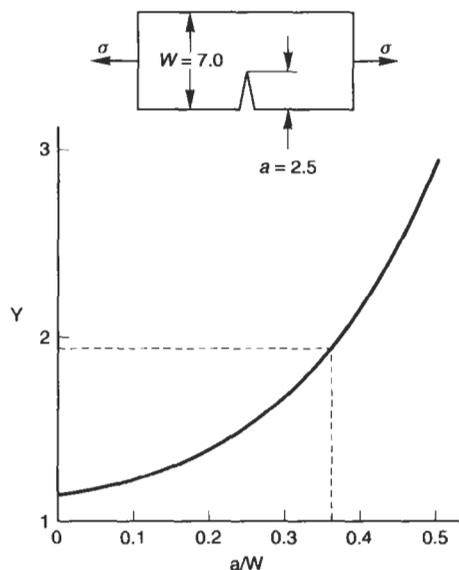


Fig. 16.3.  $Y$  value for the crack. Dimensions in mm.

The critical stress is 64% greater than the longitudinal stress. However, the change in section from a cylinder to a sphere produces something akin to a stress concentration; when this is taken into account the failure is accurately predicted.

### Conclusions and recommendations

This case study provides a good example of the consequences of having an inadequate fracture toughness. However, even if the heat-affected zone had a high toughness, the crack would have continued to grow through the wall of the tank by stress-corrosion cracking until fast fracture occurred. The critical crack size would have been greater, but failure would have occurred eventually. The only way of avoiding failures of this type is to prevent stress corrosion cracking in the first place.

## CASE STUDY 2: COMPRESSED AIR TANKS FOR A SUPERSONIC WIND TUNNEL

The supersonic wind tunnels in the Aerodynamic Laboratory at Cambridge University are powered by a bank of twenty large cylindrical pressure vessels. Each time the tunnels are used, the vessels are slowly charged by compressors, and then quickly discharged through a tunnel. How should we go about designing and checking pressure vessels of this type to make sure they are safe?

### Criteria for design of safe pressure vessels

First, the pressure vessel must be safe from plastic collapse: that is, the stresses must everywhere be below general yield. Second, it must not fail by fast fracture: if the largest cracks it could contain have length  $2a$  (Fig. 16.4), then the stress intensity  $K \approx \sigma\sqrt{\pi a}$  must everywhere be less than  $K_c$ . Finally, it must not fail by fatigue: the slow growth of a crack to the critical size at which it runs.

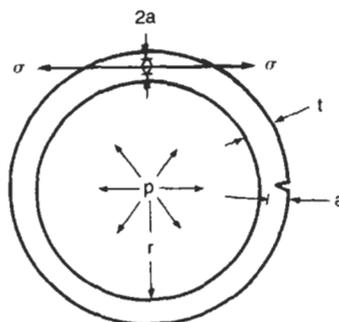


Fig. 16.4. Cracks in the wall of a pressure vessel.

The hoop stress  $\sigma$  in the wall of a cylindrical pressure vessel containing gas at pressure  $p$  is given by

$$\sigma = \frac{pr}{t},$$

provided that the wall is thin ( $t \ll r$ ).

For general yielding,

$$\sigma = \sigma_y.$$

For fast fracture,

$$\sigma\sqrt{\pi a} = K_c.$$

### Failure by general yield or fast fracture

Figure 16.5 shows the loci of general yielding and fast fracture plotted against crack size. The yield locus is obviously independent of crack size, and is simply given by  $\sigma = \sigma_y$ . The locus of fast fracture can be written as

$$\sigma = \frac{K_c}{\sqrt{\pi}} \left( \frac{1}{\sqrt{a}} \right),$$

which gives a curved relationship between  $\sigma$  and  $a$ . If we pressurise our vessel at point A on the graph, the material will yield *before* fast fracture; this yielding can be detected by strain gauges and disaster avoided. If we pressurise at point B, fast fracture will occur at a stress less than  $\sigma_y$ , without warning and with catastrophic consequences; the point where the two curves cross defines a critical flaw size at which fracture by general yield and by fast fracture coincide. Obviously, if we know that the size of the largest flaw in our vessel is less than this critical value, our vessel will be safe (although we

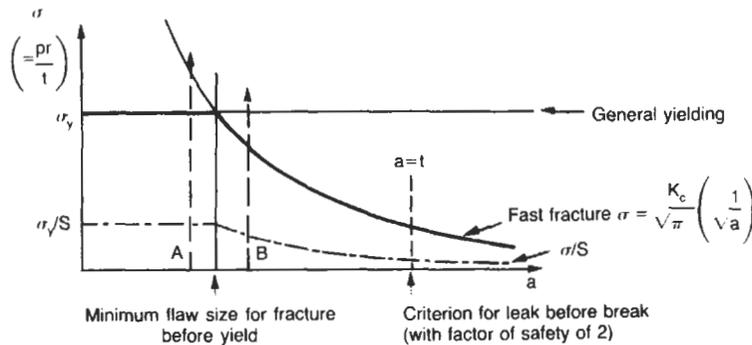


Fig. 16.5. Fracture modes for a cylindrical pressure vessel.

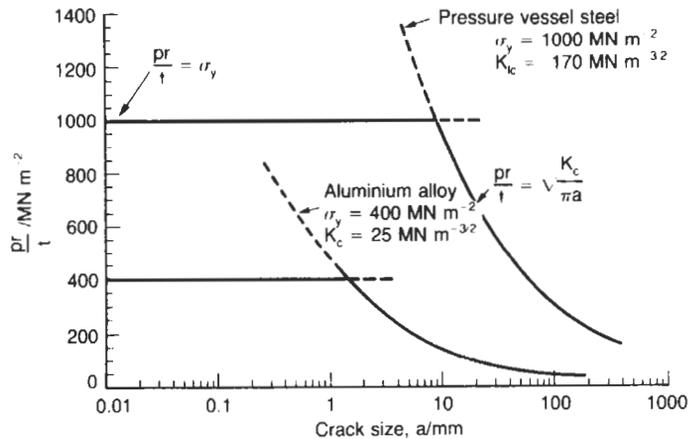


Fig. 16.6. Design against yield and fast fracture for a cylindrical pressure vessel.

should also, of course, build in an appropriate safety factor  $S$  as well – as shown by the dash – dot line on Fig. 16.5).

Figure 16.6 shows the general yield and fast fracture loci for a pressure-vessel steel and an aluminium alloy. The critical flaw size in the steel is  $\approx 9$  mm; that in the aluminium alloy is  $\approx 1$  mm. It is easy to detect flaws of size 9 mm by ultrasonic testing, and pressure-vessel steels can thus be accurately tested non-destructively for safety – vessels with cracks larger than 9 mm would not be passed for service. Flaws of 1 mm size cannot be measured so easily or accurately, and thus aluminium is less safe to use.

### Failure by fatigue

In the case of a pressure vessel subjected to *cyclic loading* (as here) cracks can grow by fatigue and a vessel initially passed as safe may subsequently become unsafe due to this crack growth. The probable extent of crack growth can be determined by making fatigue tests on pre-cracked pieces of steel of the same type as that used in the pressure vessel, and the safe vessel lifetime can be estimated by the method illustrated in Case Study 3.

### Extra safety: leak before break

It is worrying that a vessel which is safe when it enters service may become unsafe by slow crack growth – either by fatigue or by stress corrosion. If the consequences of catastrophic failure are very serious, then additional safety can be gained by designing the vessel so that it will *leak before it breaks* (like the partly inflated balloon of Chapter 13). Leaks are easy to detect, and a leaking vessel can be taken out of service and repaired. How do we formulate this leak-before-break condition?

If the critical flaw size for fast fracture is less than the wall thickness ( $t$ ) of the vessel, then fast fracture can occur with no warning. But suppose the critical size ( $2a_{\text{crit}}$ ) is

greater than  $t$  – then gas will leak out through the crack before the crack is big enough to run. To be on the safe side we shall take

$$2a_{\text{crit}} = 2t.$$

The stress is defined by

$$\sigma\sqrt{\pi a_{\text{crit}}} = K_c$$

so that the permissible stress is

$$\sigma = \frac{K_c}{\sqrt{\pi t}}$$

as illustrated on Fig. 16.5.

There is, of course, a penalty to be paid for this extra safety: either the pressure must be lowered, or the section of the pressure vessel increased – often substantially.

### Pressure testing

In many applications a pressure vessel may be tested for safety simply by hydraulic testing to a pressure that is higher – typically 1.5 to 2 times higher – than the normal operating pressure. Steam boilers (Fig. 16.7) are tested in this way, usually once a year. If failure does not occur at twice the working pressure, then the normal operating stress is at most one-half that required to produce fast fracture. If failure *does* occur under




**Fig. 16.7.** A pressure vessel in action – the boiler of the articulated steam locomotive *Merddin Emrys*, built in 1879 and still hauling passengers on the Festiniog narrow-gauge railway in North Wales.

hydraulic test nobody will get hurt because the stored energy in compressed water is small. Periodic testing is vital because cracks in a steam boiler will grow by fatigue, corrosion, stress corrosion and so on.

### CASE STUDY 3: THE SAFETY OF THE STRETHAM ENGINE

The Stretham steam pumping engine (Fig. 16.8) was built in 1831 as part of an extensive project to drain the Fens for agricultural use. In its day it was one of the largest beam engines in the Fens, having a maximum power of 105 horsepower at 15 rpm (it could

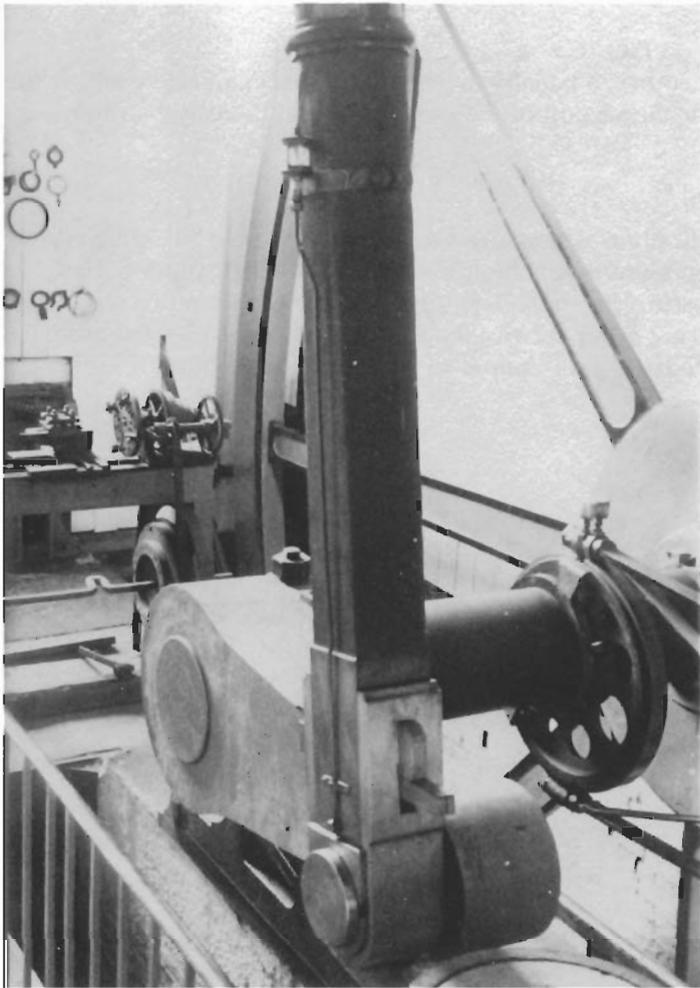

**Fig. 16.8.** Part of the Stretham steam pumping engine. In the foreground are the crank and the lower end of the connecting rod. Also visible are the flywheel (with separate spokes and rim segments, all pegged together), the eccentric drive to the valve-gear and, in the background, an early treadle-driven lathe for on-the-spot repairs.

lift 30 tons of water per revolution, or 450 tons per minute); it is now the sole surviving steam pump of its type in East Anglia.\*

The engine could still be run for demonstration purposes. Suppose that you are called in to assess its safety. We will suppose that a crack 2 cm deep has been found in the connecting rod – a cast-iron rod, 21 feet long, with a section of  $0.04 \text{ m}^2$ . Will the crack grow under the cyclic loads to which the connecting rod is subjected? And what is the likely life of the structure?

### Mechanics

The stress in the crank shaft is calculated approximately from the power and speed as follows. Bear in mind that approximate calculations of this sort may be in error by up to a factor of 2 – but this makes no difference to the conclusions reached below. Referring to Fig. 16.9:

$$\begin{aligned} \text{Power} &= 105 \text{ horsepower} \\ &= 7.8 \times 10^4 \text{ J s}^{-1}, \\ \text{Speed} &= 15 \text{ rpm} = 0.25 \text{ rev s}^{-1}, \\ \text{Stroke} &= 8 \text{ feet} = 2.44 \text{ m}, \end{aligned}$$

Force  $\times 2 \times \text{stroke} \times \text{speed} \approx \text{power}$ ,

$$\therefore \text{Force} \approx \frac{7.8 \times 10^4}{2 \times 2.44 \times 0.25} \approx 6.4 \times 10^4 \text{ N}.$$

Nominal stress in the connecting rod =  $F/A = 6.4 \times 10^4 / 0.04 = 1.6 \text{ MN m}^{-2}$  approximately.

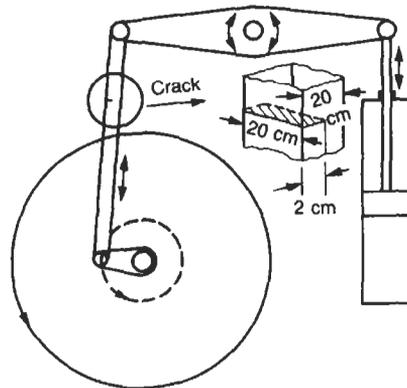


Fig. 16.9. Schematic of the Strettham engine.

---

\*Until a couple of centuries ago much of the eastern part of England which is now called East Anglia was a vast area of desolate marshes, or fens, which stretched from the North Sea as far inland as Cambridge.

## Failure by fast fracture

For cast iron,  $K_c = 18 \text{ MN m}^{-\frac{3}{2}}$ .

First, could the rod fail by fast fracture? The stress intensity is:

$$K = \sigma\sqrt{\pi a} = 1.6\sqrt{\pi \cdot 0.02} \text{ MN m}^{-\frac{3}{2}} = 0.40 \text{ MN m}^{-\frac{3}{2}}$$

It is so much less than  $K_c$  that there is no risk of fast fracture, even at peak load.

## Failure by fatigue

The growth of a fatigue crack is described by

$$\frac{da}{dN} = A(\Delta K)^m \quad (16.1)$$

For cast iron,

$$A = 4.3 \times 10^{-8} \text{ m (MN m}^{-\frac{3}{2}})^{-4},$$

$$m = 4.$$

We have that

$$\Delta K = \Delta\sigma\sqrt{\pi a}$$

where  $\Delta\sigma$  is the range of the tensile stress (Fig. 16.10). Although  $\Delta\sigma$  is constant (at constant power and speed),  $\Delta K$  increases as the crack grows. Substituting in eqn. (16.1) gives

$$\frac{da}{dN} = A\Delta\sigma^4\pi^2 a^2$$

and

$$dN = \frac{1}{(A\Delta\sigma^4\pi^2)} \frac{da}{a^2}.$$

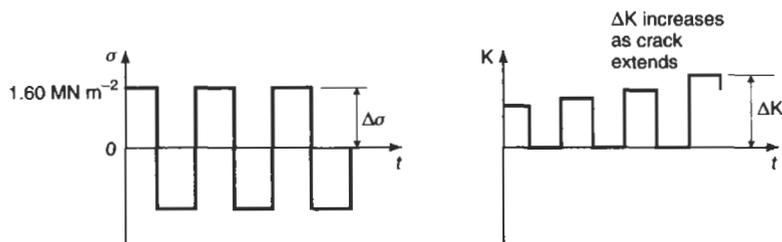


Fig. 16.10. Crack growth by fatigue in the Strettham engine.

Integration gives the number of cycles to grow the crack from  $a_1$  to  $a_2$ :

$$N = \frac{1}{(A\Delta\sigma^4 \pi^2)} \left\{ \frac{1}{a_1} - \frac{1}{a_2} \right\}$$

for a range of  $a$  small enough that the crack geometry does not change appreciably. Let us work out how long it would take our crack to grow from 2 cm to 3 cm. Then

$$\begin{aligned} N &= \frac{1}{4.3 \times 10^{-8} (1.6)^4 \pi^2} \left\{ \frac{1}{0.02} - \frac{1}{0.03} \right\} \\ &= 5.9 \times 10^6 \text{ cycles.} \end{aligned}$$

This is sufficient for the engine to run for 8 hours on each of 832 open days for demonstration purposes, i.e. to give 8 hours of demonstration each weekend for 16 years. A crack of 3 cm length is still far too small to go critical, and thus the engine will be perfectly safe after the  $5.9 \times 10^6$  cycles. Under demonstration the power delivered will be far less than the full 105 horsepower, and because of the  $\Delta\sigma^4$  dependence of  $N$ , the number of cycles required to make the crack grow to 3 cm might be as much as 30 times the one we have calculated.

The estimation of the total lifetime of the structure is more complex – substantial crack growth will make the crack geometry change significantly; this will have to be allowed for in the calculations by incorporating a correction factor,  $Y$ .

### Conclusion and recommendation

A simple analysis shows that the engine is likely to be safe for limited demonstration use for a considerable period. After this period, continued use can only be sanctioned by regular inspection of the growing crack, or by using a more sophisticated analysis.

### Further reading

- J. F. Knott, *Fundamentals of Fracture Mechanics*, Butterworths, 1973.
- T. V. Duggan and J. Byrne, *Fatigue as a Design Criterion*, Macmillan, 1977.
- R. W. Hertzberg, *Deformation and Fracture Mechanics of Engineering Materials*, 4th edition, Wiley, 1996.
- S. P. Timoshenko and J. N. Goodier, *Theory of Elasticity*, 3rd edition, McGraw Hill, 1970.



## **E. Creep deformation and fracture**

---



# Chapter 17

## Creep and creep fracture

### Introduction

So far we have concentrated on mechanical properties at room temperature. Many structures – particularly those associated with energy conversion, like turbines, reactors, steam and chemical plant – operate at much higher temperatures.

At room temperature, most metals and ceramics deform in a way which depends on stress but which, for practical purposes, is independent of time:

$$\epsilon = f(\sigma) \text{ elastic/plastic solid.}$$

As the temperature is raised, loads which give no permanent deformation at room temperature cause materials to *creep*. Creep is slow, continuous deformation with time:

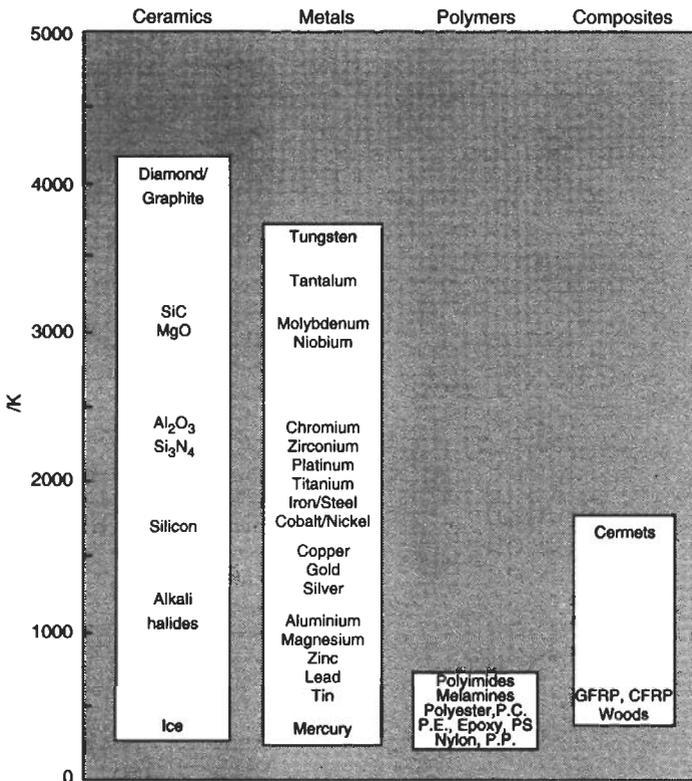


Fig. 17.1. Melting or softening temperature.

the strain, instead of depending only on the stress, now depends on temperature and time as well:

$$\epsilon = f(\sigma, t, T) \text{ creeping solid.}$$

It is common to refer to the former behaviour as 'low-temperature' behaviour, and the latter as 'high-temperature'. But what is a 'low' temperature and what is a 'high' temperature? Tungsten, used for lamp filaments, has a very high melting point – well over 3000°C. Room temperature, for tungsten, is a very low temperature. If made hot enough, however, tungsten will creep – that is the reason that lamps ultimately burn out. Tungsten lamps run at about 2000°C – this, for tungsten, is a high temperature. If you examine a lamp filament which has failed, you will see that it has sagged under its own weight until the turns of the coil have touched – that is, it has deformed by creep.

Figure 17.1 and Table 17.1 give melting points for metals and ceramics and softening temperatures for polymers. Most metals and ceramics have high melting points and, because of this, they start to creep only at temperatures well above room temperature

**Table 17.1** Melting or softening<sup>(S)</sup> temperature

<i>Material</i>	<i>T (K)</i>	<i>Material</i>	<i>T (K)</i>
Diamond, graphite	4000	Gold	1336
Tungsten alloys	3500–3683	Silver	1234
Tantalum alloys	2950–3269	Silica glass	1100 <sup>(S)</sup>
Silicon carbide, SiC	3110	Aluminium alloys	750–933
Magnesia, MgO	3073	Magnesium alloys	730–923
Molybdenum alloys	2750–2890	Soda glass	700–900 <sup>(S)</sup>
Niobium alloys	2650–2741	Zinc alloys	620–692
Beryllia, BeO	2700	Polyimides	580–630 <sup>(S)</sup>
Iridium	2682–2684	Lead alloys	450–601
Alumina, Al <sub>2</sub> O <sub>3</sub>	2323	Tin alloys	400–504
Silicon nitride, Si <sub>3</sub> N <sub>4</sub>	2173	Melamines	400–480 <sup>(S)</sup>
Chromium	2148	Polyesters	450–480 <sup>(S)</sup>
Zirconium alloys	2050–2125	Polycarbonates	400 <sup>(S)</sup>
Platinum	2042	Polyethylene, high-density	300 <sup>(S)</sup>
Titanium alloys	1770–1935	Polyethylene, low-density	360 <sup>(S)</sup>
Iron	1809	Foamed plastics, rigid	300–380 <sup>(S)</sup>
Carbon steels	1570–1800	Epoxy, general purpose	340–380 <sup>(S)</sup>
Cobalt alloys	1650–1768	Polystyrenes	370–380 <sup>(S)</sup>
Nickel alloys	1550–1726	Nylons	340–380 <sup>(S)</sup>
Cermets	1700	Polyurethane	365 <sup>(S)</sup>
Stainless steels	1660–1690	Acrylic	350 <sup>(S)</sup>
Silicon	1683	GFRP	340 <sup>(S)</sup>
Alkali halides	800–1600	CFRP	340 <sup>(S)</sup>
Beryllium alloys	1540–1551	Polypropylene	330 <sup>(S)</sup>
Uranium	1405	Ice	273
Copper alloys	1120–1356	Mercury	235

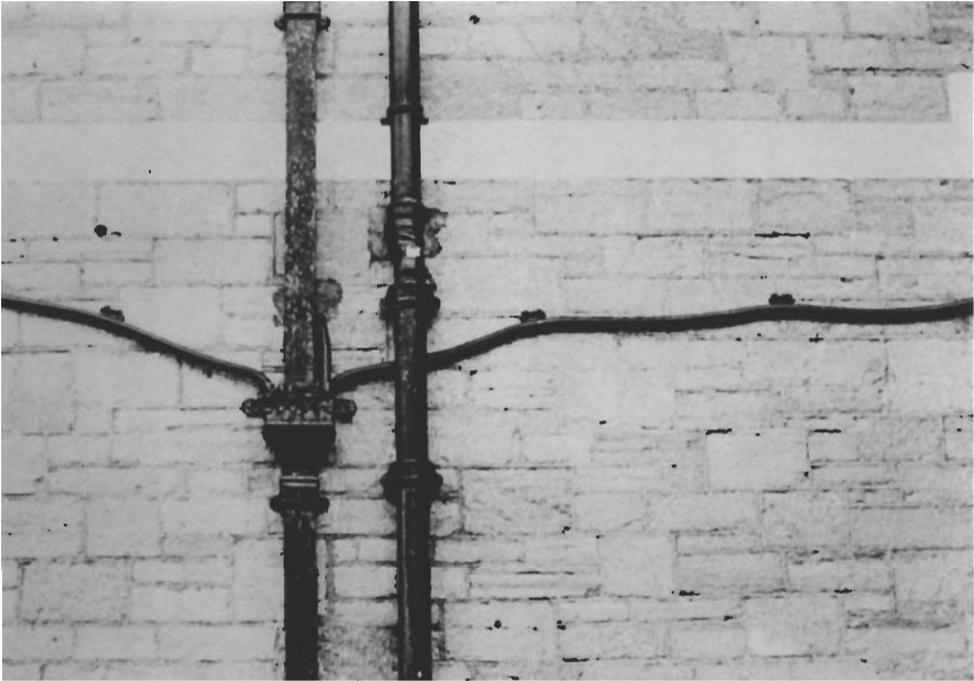


Fig. 17.2. Lead pipes often creep noticeably over the years.

– this is why creep is a less familiar phenomenon than elastic or plastic deformation. But the metal *lead*, for instance, has a melting point of 600 K; room temperature, 300 K, is exactly half its absolute melting point. Room temperature for lead is a high temperature, and it creeps – as Fig. 17.2 shows. And the ceramic *ice* melts at 0°C. ‘Temperate’ glaciers (those close to 0°C) are at a temperature at which ice creeps rapidly – that is why glaciers move. Even the thickness of the Antarctic ice cap, which controls the levels of the earth’s oceans, is determined by the creep-spreading of the ice at about –30°C.


The point, then, is that the temperature at which materials start to creep depends on their melting point. As a general rule, it is found that creep starts when

$$T > 0.3 \text{ to } 0.4T_M \text{ for metals,}$$

$$T > 0.4 \text{ to } 0.5T_M \text{ for ceramics,}$$

where  $T_M$  is the melting temperature in kelvin. However, special alloying procedures can raise the temperature at which creep becomes a problem.

Polymers, too, creep – many of them do so at room temperature. As we said in Chapter 5, most common polymers are not crystalline, and have no well-defined melting point. For them, the important temperature is the glass temperature,  $T_G$ , at which the Van der Waals bonds solidify. Above this temperature, the polymer is in a leathery or rubbery state, and creeps rapidly under load. Below, it becomes hard (and

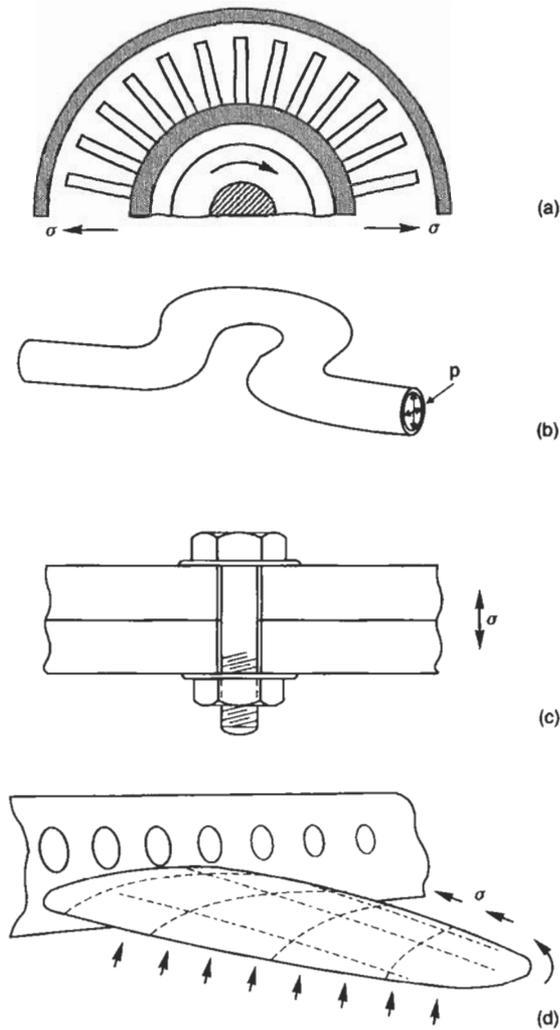

**Fig. 17.3.** Creep is important in four classes of design: (a) displacement-limited, (b) failure-limited, (c) relaxation-limited and (d) buckling-limited.

sometimes brittle) and, for practical purposes, no longer creeps.  $T_G$  is near room temperature for most polymers, so creep is a problem.

In design against creep, we seek the material and the shape which will carry the design loads, without failure, for the design life at the design temperature. The meaning of 'failure' depends on the application. We distinguish four types of failure, illustrated in Fig. 17.3.

- (a) Displacement-limited applications, in which precise dimensions or small clearances must be maintained (as in the discs and blades of turbines).

- (b) Rupture-limited applications, in which dimensional tolerance is relatively unimportant, but fracture must be avoided (as in pressure-piping).
- (c) Stress-relaxation-limited applications in which an initial tension relaxes with time (as in the pretensioning of cables or bolts).
- (d) Buckling-limited applications, in which slender columns or panels carry compressive loads (as in the upper wing skin of an aircraft, or an externally pressurised tube).

To tackle any of these we need *constitutive equations* which relate the strain-rate  $\dot{\epsilon}$  or time-to-failure  $t_f$  for the material to the stress  $\sigma$  and temperature  $T$  to which it is exposed. These come next.

## Creep testing and creep curves

Creep tests require careful temperature control. Typically, a specimen is loaded in tension or compression, usually at constant load, inside a furnace which is maintained at a constant temperature,  $T$ . The extension is measured as a function of time. Figure 17.4 shows a typical set of results from such a test. Metals, polymers and ceramics all show creep curves of this general shape.

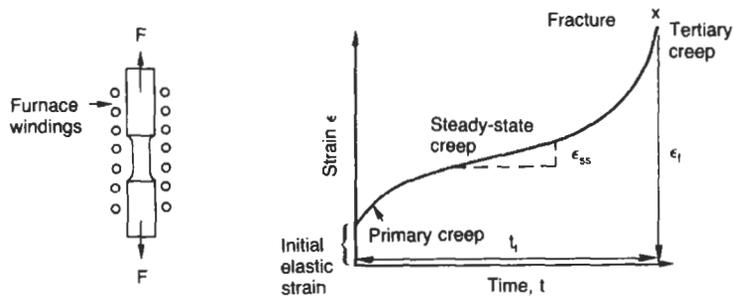


Fig. 17.4. Creep testing and creep curves.

Although the *initial elastic* and the *primary creep* strain cannot be neglected, they occur quickly, and they can be treated in much the way that elastic deflection is allowed for in a structure. But thereafter, the material enters *steady-state*, or *secondary* creep, and the strain increases steadily with time. In designing against creep, it is usually this steady accumulation of strain with time that concerns us most.

By plotting the log of the steady creep-rate,  $\dot{\epsilon}_{ss}$ , against log (stress,  $\sigma$ ), at constant  $T$ , as shown in Fig. 17.5 we can establish that

$$\dot{\epsilon}_{ss} = B\sigma^n \quad (17.1)$$

where  $n$ , the *creep exponent*, usually lies between 3 and 8. This sort of creep is called '*power-law*' creep. (At low  $\sigma$ , a different régime is entered where  $n \approx 1$ ; we shall discuss

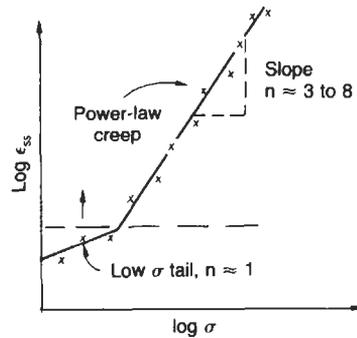


Fig. 17.5. Variation of creep rate with stress.

this low-stress deviation from power-law creep in Chapter 19, but for the moment we shall not comment further on it.)

By plotting the *natural* logarithm ( $\ln$ ) of  $\dot{\epsilon}_{ss}$ , against the reciprocal of the *absolute* temperature ( $1/T$ ) at constant stress, as shown in Fig. 17.6, we find that:

$$\dot{\epsilon}_{ss} = C e^{-(Q/\bar{R}T)}. \quad (17.2)$$

Here  $\bar{R}$  is the Universal Gas Constant ( $8.31 \text{ J mol}^{-1} \text{ K}^{-1}$ ) and  $Q$  is called the *Activation Energy for Creep* – it has units of  $\text{J mol}^{-1}$ . Note that the creep rate increases exponentially with temperature (Fig. 17.6, inset). An increase in temperature of  $20^\circ\text{C}$  can *double* the creep rate.

Combining these two dependences of  $\dot{\epsilon}_{ss}$  gives, finally,

$$\dot{\epsilon}_{ss} = A \sigma^n e^{-(Q/\bar{R}T)} \quad (17.3)$$

where  $A$  is the creep constant. The values of the three constants  $A$ ,  $n$  and  $Q$  characterise the creep of a material; if you know these, you can calculate the strain-rate at any

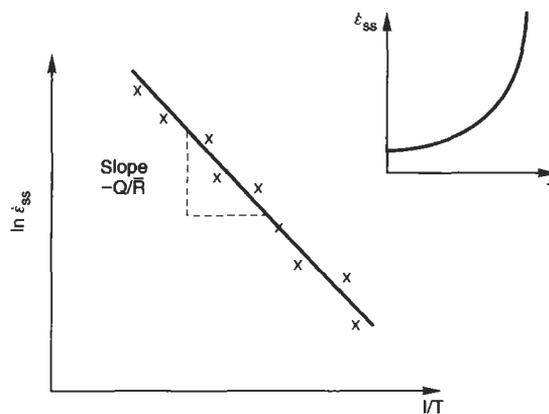


Fig. 17.6. Variation of creep rate with temperature.

temperature and stress by using the last equation. They vary from material to material, and have to be found experimentally.

## Creep relaxation

At constant displacement, creep causes stresses to relax with time. Bolts in hot turbine casings must be regularly tightened. Plastic paper-clips are not, in the long term, as good as steel ones because, even at room temperature, they slowly lose their grip.

The relaxation time (arbitrarily defined as the time taken for the stress to relax to half its original value) can be calculated from the power-law creep data as follows. Consider a bolt which is tightened onto a rigid component so that the initial stress in its shank is  $\sigma_i$ . In this geometry (Fig. 17.3(c)) the length of the shank must remain constant – that is, the *total* strain in the shank  $\epsilon^{\text{tot}}$  must remain constant. But creep strain  $\epsilon^{\text{cr}}$  can *replace* elastic strain  $\epsilon^{\text{el}}$ , causing the stress to relax. At any time  $t$

$$\epsilon^{\text{tot}} = \epsilon^{\text{el}} + \epsilon^{\text{cr}}. \quad (17.4)$$

But

$$\epsilon^{\text{el}} = \sigma/E \quad (17.5)$$

and (at constant temperature)

$$\dot{\epsilon}^{\text{cr}} = B\sigma^n.$$

Since  $\epsilon^{\text{tot}}$  is constant, we can differentiate eqn. (17.4) with respect to time and substitute the other two equations into it to give

$$\frac{1}{E} \frac{d\sigma}{dt} = -B\sigma^n. \quad (17.6)$$

Integrating from  $\sigma = \sigma_i$  at  $t = 0$  to  $\sigma = \sigma$  at  $t = t$  gives

$$\frac{1}{\sigma^{n-1}} - \frac{1}{\sigma_i^{n-1}} = (n-1)BEt. \quad (17.7)$$

Figure 17.7 shows how the initial elastic strain  $\sigma_i/E$  is slowly replaced by creep strain, and the stress in the bolt relaxes. If, as an example, it is a casing bolt in a large turbo-generator, it will have to be retightened at intervals to prevent steam leaking from the turbine. The time interval between retightening,  $t_r$ , can be calculated by evaluating the time it takes for  $\sigma$  to fall to (say) one-half of its initial value. Setting  $\sigma = \sigma_i/2$  and rearranging gives

$$t_r = \frac{(2^{n-1} - 1)}{(n-1)BE\sigma_i^{n-1}}. \quad (17.8)$$

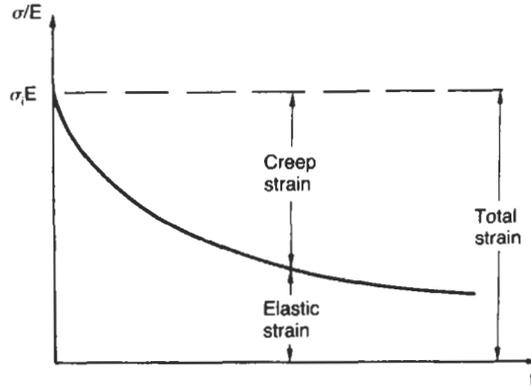


Fig. 17.7. Replacement of elastic strain by creep strain with time at high temperature.

Experimental values for  $n$ ,  $A$  and  $Q$  for the material of the bolt thus enable us to decide how often the bolt will need retightening. Note that overtightening the bolt does not help because  $t_r$  decreases rapidly as  $\sigma_i$  increases.

### Creep damage and creep fracture

During creep, damage, in the form of internal cavities, accumulates. The damage first appears at the start of the Tertiary Stage of the creep curve and grows at an increasing rate thereafter. The shape of the Tertiary Stage of the creep curve (Fig. 17.4) reflects this: as the cavities grow, the section of the sample decreases, and (at constant load) the stress goes up. Since  $\dot{\epsilon} \propto \sigma^n$ , the creep rate goes up even faster than the stress does (Fig. 17.8).

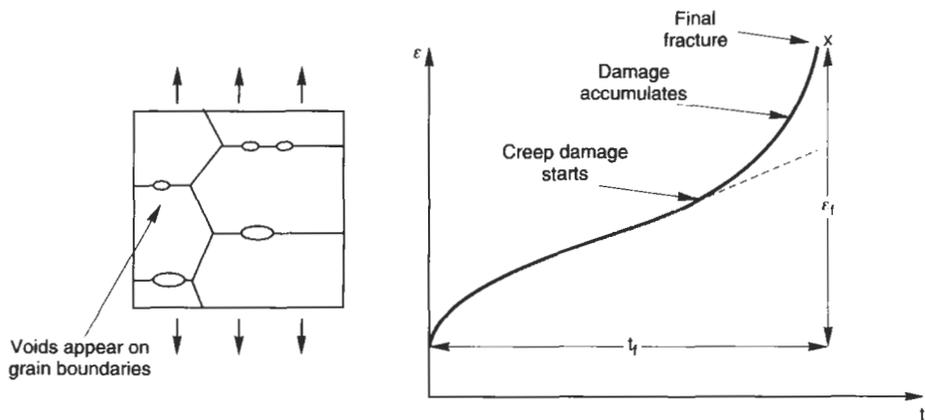


Fig. 17.8. Creep damage.

It is not surprising – since creep causes creep fracture – that the time-to-failure,  $t_f$ , is described by a constitutive equation which looks very like that for creep itself:

$$t_f = A' \sigma^{-m} e^{+(Q/\bar{R}T)}$$

Here  $A'$ ,  $m$  and  $Q$  are the creep-failure constants, determined in the same way as those for creep (the exponents have the opposite sign because  $t_f$  is a time whereas  $\dot{\epsilon}_{ss}$  is a rate).

In many high-strength alloys this creep damage appears early in life and leads to failure after small creep strains (as little as 1%). In high-temperature design it is important to make sure:

- that the *creep strain*  $\epsilon^{cr}$  during the design life is acceptable;
- that the *creep ductility*  $\epsilon_f^{cr}$  (strain to failure) is adequate to cope with the acceptable creep strain;
- that the *time-to-failure*,  $t_f$ , at the design loads and temperatures is longer (by a suitable safety factor) than the design life.

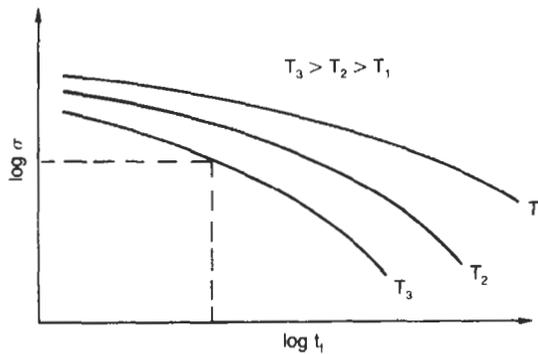


Fig. 17.9. Creep-rupture diagram.

Times-to-failure are normally presented as *creep-rupture* diagrams (Fig. 17.9). Their application is obvious: if you know the stress and temperature you can read off the life; if you wish to design for a certain life at a certain temperature, you can read off the design stress.

### Creep-resistant materials

From what we have said so far it should be obvious that the first requirement that we should look for in choosing materials that are resistant to creep is that they should have high melting (or softening) temperatures. If the material can then be used at less than 0.3 of its melting temperature creep will not be a problem. If it has to be used above this temperature, various alloying procedures can be used to increase creep resistance. To

understand these, we need to know more about the mechanisms of creep – the subject of the next two chapters.

### Further reading

- I. Finnie and W. R. Heller, *Creep of Engineering Materials*, McGraw Hill, 1959.
- J. Hult, *Creep in Engineering Structures*, Blaisdell, 1966.
- P. C. Powell, *Engineering with Polymers*, Chapman and Hall, 1983.
- R. B. Seymour, *Polymers for Engineering Applications*, ASM International, 1987.

# Chapter 18

## Kinetic theory of diffusion

---

### Introduction

We saw in the last chapter that the rate of steady-state creep,  $\dot{\epsilon}_{ss}$ , varies with temperature as

$$\dot{\epsilon}_{ss} = Ce^{-(Q/\bar{R}T)}. \quad (18.1)$$

Here  $Q$  is the activation energy for creep ( $\text{J mol}^{-1}$  or, more usually,  $\text{kJ mol}^{-1}$ ),  $\bar{R}$  is the universal gas constant ( $8.31 \text{ J mol}^{-1} \text{ K}^{-1}$ ) and  $T$  is the absolute temperature (K). This is an example of *Arrhenius's Law*. Like all good laws, it has great generality. Thus it applies not only to the rate of creep, but also to the rate of oxidation (Chapter 21), the rate of corrosion (Chapter 23), the rate of diffusion (this chapter), even to the rate at which bacteria multiply and milk turns sour. It states that the *rate of the process (creep, corrosion, diffusion, etc.) increases exponentially with temperature* (or, equivalently, that the time for a given amount of creep, or of oxidation, *decreases exponentially with temperature*) in the way shown in Fig. 18.1. It follows that, if the rate of a process which follows Arrhenius's Law is plotted on a  $\log_e$  scale against  $1/T$ , a straight line with a slope of  $-Q/\bar{R}$  is obtained (Fig. 18.2). The value of  $Q$  characterises the process – a feature we have already used in Chapter 17.

In this chapter we discuss the origin of Arrhenius's Law and its application to *diffusion*. In the next, we examine how it is that the rate of diffusion determines that of creep.

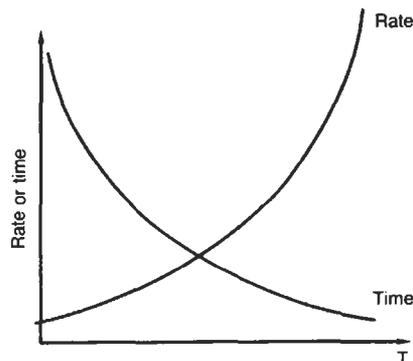


Fig. 18.1. Consequences of Arrhenius's Law.

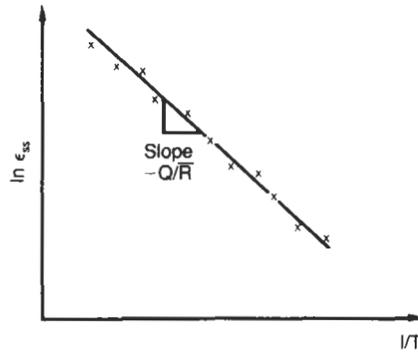


Fig. 18.2. Creep rates follow Arrhenius's Law.

## Diffusion and Fick's Law

First, what do we mean by *diffusion*? If we take a dish of water and drop a blob of ink very gently into the middle of it, the ink will spread sideways into the water. Measure the distance from the initial blob to the edge of the dish by the coordinate  $x$ . Provided the water is stagnant, the spreading of the ink is due to the movement of ink molecules by random exchanges with the water molecules. Because of this, the ink molecules move from regions where they are concentrated to regions where they are less concentrated; put another way: the ink diffuses down the ink *concentration gradient*. This behaviour is described by *Fick's first law of diffusion*:

$$J = -D \frac{dc}{dx}. \quad (18.2)$$

Here  $J$  is the number of ink molecules diffusing down the concentration gradient *per second per unit area*; it is called the *flux* of molecules (Fig. 18.3). The quantity  $c$  is the concentration of ink molecules in the water, defined as the *number of ink molecules per unit volume* of the ink–water solution; and  $D$  is the *diffusion coefficient* for ink in water – it has units of  $\text{m}^2 \text{s}^{-1}$ .

This diffusive behaviour is not just limited to ink in water – it occurs in all liquids, and more remarkably, in all solids as well. As an example, in the alloy *brass* – a mixture

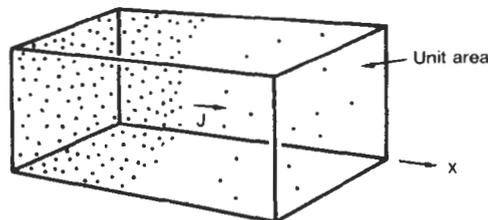


Fig. 18.3. Diffusion down a concentration gradient.

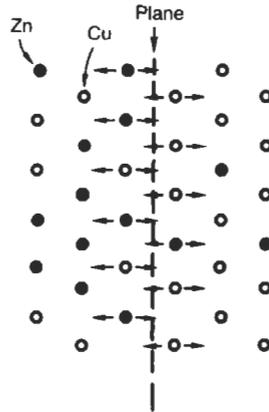


Fig. 18.4. Atom jumps across a plane.

of zinc in copper – zinc atoms diffuse through the solid copper in just the way that ink diffuses through water. Because the materials of engineering are mostly solids, we shall now confine ourselves to talking about diffusion in the solid state.

Physically, diffusion occurs because atoms, even in a solid, are able to move – to jump from one atomic site to another. Figure 18.4 shows a solid in which there is a concentration gradient of black atoms: there are more to the left of the broken line than there are to the right. If atoms jump across the broken line at random, then there will be a *net flux* of black atoms to the right (simply because there are more on the left to jump), and, of course, a net flux of white atoms to the left. Fick's Law describes this. It is derived in the following way.

The atoms in a solid vibrate, or oscillate, about their mean positions, with a frequency  $\nu$  (typically about  $10^{13} \text{ s}^{-1}$ ). The crystal lattice defines these mean positions. At a temperature  $T$ , the average energy (kinetic plus potential) of a vibrating atom is  $3kT$  where  $k$  is Boltzmann's constant ( $1.38 \times 10^{-23} \text{ J atom}^{-1} \text{ K}^{-1}$ ). But this is only the average energy. As atoms (or molecules) vibrate, they collide, and energy is continually transferred from one to another. Although the *average* energy is  $3kT$ , at any instant, there is a certain probability that an atom has more or less than this. A very small fraction of the atoms have, at a given instant, much more – enough, in fact, to jump to a neighbouring atom site. It can be shown from statistical mechanical theory that the probability,  $p$ , that an atom will have, at any instant, an energy  $\geq q$  is

$$p = e^{-q/kT}. \quad (18.3)$$

Why is this relevant to the diffusion of zinc in copper? Imagine two adjacent lattice planes in the brass with two slightly different zinc concentrations, as shown in exaggerated form in Fig. 18.5. Let us denote these two planes as  $A$  and  $B$ . Now for a zinc atom to diffuse from  $A$  to  $B$ , down the concentration gradient, it has to 'squeeze' between the copper atoms (a simplified statement – but we shall elaborate on it in a moment). This is another way of saying: the zinc atom has to overcome an *energy barrier*

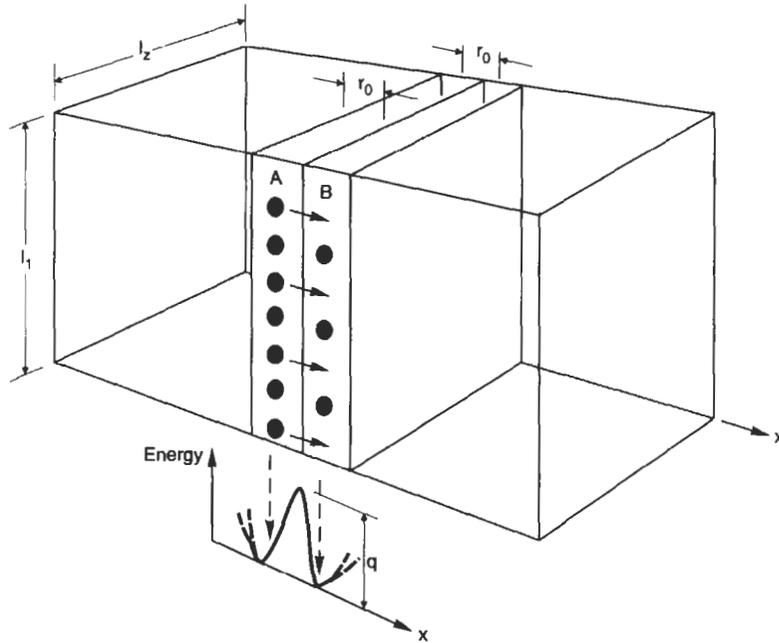


Fig. 18.5. Diffusion requires atoms to cross the energy barrier  $q$ .

of height  $q$ , as shown in Fig. 18.5. Now, the number of zinc atoms in layer  $A$  is  $n_A$ , so that the number of zinc atoms that have enough energy to climb over the barrier from  $A$  to  $B$  at any instant is

$$n_A p = n_A e^{-q/kT}. \quad (18.4)$$

In order for these atoms to *actually* climb over the barrier from  $A$  to  $B$ , they must of course be moving in the right direction. The number of times each zinc atom oscillates towards  $B$  is  $\approx v/6$  per second (there are six possible directions in which the zinc atoms can move in three dimensions, only one of which is from  $A$  to  $B$ ). Thus the *number* of atoms that *actually* jump from  $A$  to  $B$  per second is

$$\frac{v}{6} n_A e^{-q/kT}. \quad (18.5)$$

But, meanwhile, some zinc atoms jump back. If the number of zinc atoms in layer  $B$  is  $n_B$ , the number of zinc atoms that can climb over the barrier from  $B$  to  $A$  per second is

$$\frac{v}{6} n_B e^{-q/kT}. \quad (18.6)$$

Thus the net number of zinc atoms climbing over the barrier per second is

$$\frac{v}{6} (n_A - n_B) e^{-q/kT}. \quad (18.7)$$

The area of the surface across which they jump is  $l_1 l_2$ , so the net *flux* of atoms, using the definition given earlier, is:

$$J = v \frac{(n_A - n_B)}{6l_1 l_2} e^{-q/kT}. \quad (18.8)$$

Concentrations,  $c$ , are related to numbers,  $n$ , by

$$c_A = \frac{n_A}{l_1 l_2 r_0}, \quad c_B = \frac{n_B}{l_1 l_2 r_0} \quad (18.9)$$

where  $c_A$  and  $c_B$  are the zinc concentrations at  $A$  and  $B$  and  $r_0$  is the atom size. Substituting for  $n_A$  and  $n_B$  in eqn. (18.8) gives

$$J = \frac{v}{6} r_0 (c_A - c_B) e^{-q/kT}. \quad (18.10)$$

But  $-(c_A - c_B)/r_0$  is the concentration gradient,  $dc/dx$ . The quantity  $q$  is inconveniently small and it is better to use the larger quantities  $Q = N_A q$  and  $\bar{R} = N_A k$  where  $N_A$  is Avogadro's number. The quantity  $vr_0^2/6$  is usually written as  $D_0$ . Making these changes gives:

$$J = -D_0 e^{-Q/\bar{R}T} \left( \frac{dc}{dx} \right) \quad (18.11)$$

and this is just Fick's law (equation 18.2) with

$$D = D_0 e^{-Q/\bar{R}T}. \quad (18.12)$$

This method of writing  $D$  emphasises its exponential dependence on temperature, and gives a conveniently sized activation energy (expressed per mole of diffusing atoms rather than per atom). Thinking again of creep, the thing about eqn. (18.12) is that the exponential dependence of  $D$  on temperature has exactly the same form as the dependence of  $\epsilon_{ss}$  on temperature that we seek to explain.

## Data for diffusion coefficients

Diffusion coefficients are best measured in the following way. A thin layer of a *radioactive isotope* of the diffusing atoms or molecules is plated onto the bulk material (for example, radioactive zinc onto copper). The temperature is raised to the diffusion

Table 18.1 Data for bulk diffusion

Material	$D_0$ (m <sup>2</sup> /s)	Q (kJ/mol)	$Q/\bar{R}T_M$
<i>BCC metals</i>			
Tungsten	$5.0 \times 10^{-4}$	585	19.1
Molybdenum	$5.0 \times 10^{-5}$	405	14.9
Tantalum	$1.2 \times 10^{-5}$	413	16.9
Alpha-iron	$2.0 \times 10^{-4}$	251	16.6
<i>HCP metals</i>			
Zinc	$1.3 \times 10^{-5}$	91.7	15.9
Magnesium	$1.0 \times 10^{-4}$	135	17.5
Titanium	$8.6 \times 10^{-10}$	150	9.3
<i>FCC metals</i>			
Copper	$2.0 \times 10^{-5}$	197	17.5
Aluminium	$1.7 \times 10^{-4}$	142	18.3
Lead	$1.4 \times 10^{-4}$	109	21.8
Gamma-iron	$1.8 \times 10^{-5}$	270	17.9
<i>Oxides</i>			
MgO	$1.4 \times 10^{-6}$	460	17.7
Al <sub>2</sub> O <sub>3</sub>	$3.0 \times 10^{-2}$	556	28.0
FeO	$1.0 \times 10^{-2}$	326	23.9
<i>Interstitial diffusion in iron</i>			
C in $\alpha$ Fe	$2.0 \times 10^{-6}$	84	5.6
C in $\gamma$ Fe	$2.3 \times 10^{-5}$	147	9.7
N in $\alpha$ Fe	$3.0 \times 10^{-7}$	76	5.1
N in $\gamma$ Fe	$9.1 \times 10^{-5}$	168	11.6
H in $\alpha$ Fe	$1.0 \times 10^{-7}$	14	1.0

temperature for a measured time, during which the isotope diffuses into the bulk. The sample is cooled and sectioned, and the concentration of isotope measured as a function of depth by measuring the radiation it emits.  $D_0$  and  $Q$  are calculated from the diffusion profile.

Materials handbooks list data for  $D_0$  and  $Q$  for various atoms diffusing in metals and ceramics; Table 18.1 gives some of the most useful values. Diffusion occurs in polymers, composites and glasses, too, but the data are less reliable.

The last column of Table 18.1 shows the *normalised activation energy*,  $Q/\bar{R}T_M$ , where  $T_M$  is the melting point (in kelvin). It is found that, for a given *class of material* (e.g. f.c.c. metals, or refractory oxides) the diffusion parameter  $D_0$  for mass transport – and this is the one that is important in creep – is roughly constant; and that the activation energy is proportional to the melting temperature  $T_M$  (K) so that  $Q/\bar{R}T_M$ , too, is a constant (which is why creep is related to the melting point). This means that *many* diffusion problems can be solved approximately using the data given in Table 18.2, which shows the average values of  $D_0$  and  $Q/\bar{R}T_M$  for material classes.

**Table 18.2** Average values of  $D_0$  and  $Q/\bar{R}T_M$  for material classes

Material class	$D_0$ ( $m^2/s$ )	$Q/\bar{R}T_M$
BCC metals (W, Mo, Fe below 911°C, etc.)	$1.6 \times 10^{-4}$	17.8
HCP metals (Zn, Mg, Ti, etc.)	$5 \times 10^{-5}$	17.3
FCC metals (Cu, Al, Ni, Fe above 911°C, etc.)	$5 \times 10^{-5}$	18.4
Alkali halides (NaCl, LiF, etc.)	$2.5 \times 10^{-3}$	22.5
Oxides (MgO, FeO, Al <sub>2</sub> O <sub>3</sub> , etc.)	$3.8 \times 10^{-4}$	23.4



## Mechanisms of diffusion

In our discussion so far we have begged the question of just how the atoms in a solid move around when they diffuse. There are several ways in which this can happen. For simplicity, we shall talk only about crystalline solids, although diffusion occurs in amorphous solids as well, and in similar ways.

### Bulk diffusion: interstitial and vacancy diffusion

Diffusion in the bulk of a crystal can occur by two mechanisms. The first is *interstitial* diffusion. Atoms in all crystals have spaces, or *interstices*, between them, and *small* atoms dissolved in the crystal can diffuse around by squeezing between atoms, jumping – when they have enough energy – from one interstice to another (Fig. 18.6). Carbon, a small atom, diffuses through steel in this way; in fact C, O, N, B and H diffuse interstitially in most crystals. These small atoms diffuse very quickly. This is reflected in their exceptionally small values of  $Q/\bar{R}T_M$ , seen in the last column of Table 18.1.

The second mechanism is that of *vacancy* diffusion. When zinc diffuses in brass, for example, the zinc atom (comparable in size to the copper atom) cannot fit into the interstices – the zinc atom has to wait until a *vacancy*, or missing atom, appears next to it before it can move. This is the mechanism by which most diffusion in crystals takes place (Figs. 18.7 and 10.4).

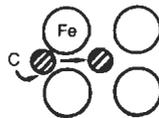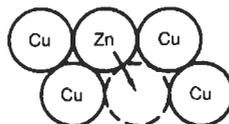**Fig. 18.6.** Interstitial diffusion.**Fig. 18.7.** Vacancy diffusion.

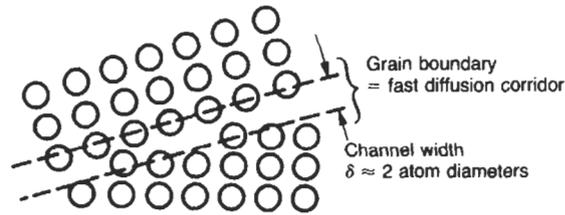


Fig. 18.8. Grain-boundary diffusion.

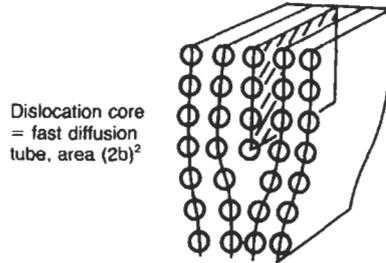


Fig. 18.9. Dislocation-core diffusion.

### Fast diffusion paths: grain boundary and dislocation core diffusion

Diffusion in the bulk crystals may sometimes be *short circuited* by diffusion down grain boundaries or dislocation cores. The boundary acts as a planar channel, about two atoms wide, with a local diffusion rate which can be as much as  $10^6$  times greater than in the bulk (Figs. 18.8 and 10.4). The dislocation core, too, can act as a high conductivity 'wire' of cross-section about  $(2b)^2$ , where  $b$  is the atom size (Fig. 18.9). Of course, their contribution to the total diffusive flux depends also on how many grain boundaries or dislocations there are: when grains are small or dislocations numerous, their contribution becomes important.

But what about creep? In the next chapter we shall see how diffusion can explain creep.

### Further reading

P. G. Shewmon, *Diffusion in Solids*, 2nd edition, TMS Publishers, Warrendale, Penn, USA, 1989.

W. D. Kingery, *Introduction to Ceramics*, Wiley, 1960, Chap. 8.

G. H. Geiger and D. R. Poirier, *Transport Phenomena in Metallurgy*, Addison-Wesley, 1973, Chap. 13.

Smithells' *Metals Reference Book*, 7th edition, Butterworth-Heinemann, 1992 (for diffusion data).

# Chapter 19

## Mechanisms of creep, and creep-resistant materials

---

### Introduction

In Chapter 17 we showed that, when a material is loaded at a high temperature, it creeps, that is, it deforms, continuously and permanently, at a stress that is less than the stress that would cause any permanent deformation at room temperature. In order to understand how we can make engineering materials more resistant to creep deformation and creep fracture, we must first look at how creep and creep-fracture take place on an atomic level, i.e. we must identify and understand the *mechanisms* by which they take place.

There are two mechanisms of creep: *dislocation creep* (which gives power-law behaviour) and *diffusional creep* (which gives linear-viscous creep). The rate of both is usually limited by diffusion, so both follow Arrhenius's Law. Creep fracture, too, depends on diffusion. Diffusion becomes appreciable at about  $0.3T_M$  – that is why materials start to creep above this temperature.

### Creep mechanisms: metals and ceramics

#### Dislocation creep (giving power-law creep)

As we saw in Chapter 10, the stress required to make a crystalline material deform plastically is that needed to make the dislocations in it move. Their movement is resisted by (a) the intrinsic lattice resistance and (b) the obstructing effect of obstacles (e.g. dissolved solute atoms, precipitates formed with undissolved solute atoms, or other dislocations). Diffusion of atoms can 'unlock' dislocations from obstacles in their path, and the movement of these unlocked dislocations under the applied stress is what leads to dislocation creep.

How does this unlocking occur? Figure 19.1 shows a dislocation which cannot glide because a precipitate blocks its path. The glide force  $\tau b$  per unit length, is balanced by the reaction  $f_0$  from the precipitate. But unless the dislocation hits the precipitate at its mid-plane (an unlikely event) there is a component of force left over. It is the component  $\tau b \tan \theta$ , which tries to push the dislocation *out of its slip plane*.

The dislocation cannot *glide* upwards by the shearing of atom planes – the atomic geometry is wrong – but the dislocation *can* move upwards if atoms at the bottom of the half-plane are able to diffuse away (Fig. 19.2). We have come across Fick's Law in which diffusion is driven by differences in *concentration*. A *mechanical* force can do exactly the same thing, and this is what leads to the diffusion of atoms away from the

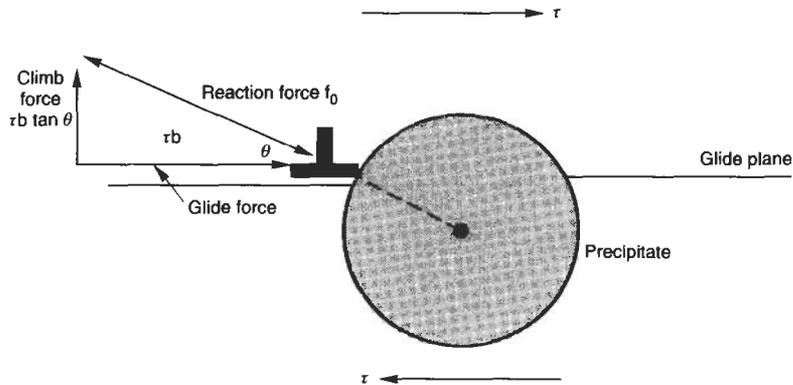


Fig. 19.1. The climb force on a dislocation.

'loaded' dislocation, eating away its extra half-plane of atoms until it can clear the precipitate. The process is called 'climb', and since it requires diffusion, it can occur only when the temperature is above  $0.3T_M$  or so. At the lower end of the creep regime ( $0.3-0.5T_M$ ) core diffusion tends to be the dominant mechanism; at the higher end ( $0.5T_M-0.99T_M$ ) it is bulk diffusion (Fig. 19.2).

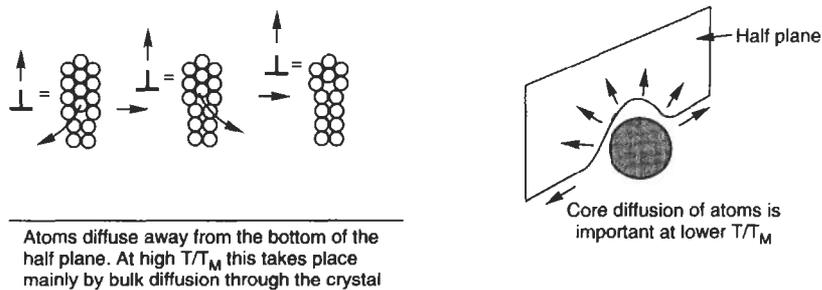


Fig. 19.2. How diffusion leads to climb.

Climb unlocks dislocations from the precipitates which pin them and further slip (or 'glide') can then take place (Fig. 19.3). Similar behaviour takes place for pinning by solute, and by other dislocations. After a little glide, of course, the unlocked dislocations bump into the next obstacles, and the whole cycle repeats itself. This explains the *progressive, continuous*, nature of creep, and the role of diffusion, with diffusion coefficient

$$D = D_0 e^{-Q/RT}$$

explains the dependence of creep rate on *temperature*, with

$$\dot{\epsilon}_{ss} = A\sigma^n e^{-Q/RT} \tag{19.1}$$

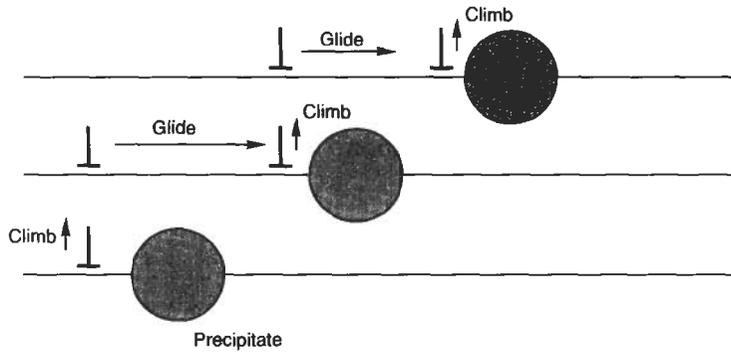


Fig. 19.3. How the climb-glide sequence leads to creep.

The dependence of creep rate on applied *stress*  $\sigma$  is due to the climb force: the higher  $\sigma$ , the higher the climb force  $\tau b \tan \theta$ , the more dislocations become unlocked per second, the more dislocations glide per second, and the higher is the strain rate.

#### Diffusion creep (giving linear-viscous creep)

As the stress is reduced, the rate of power-law creep (eqn. (19.1)) falls quickly (remember  $n$  is between 3 and 8). But creep does not stop; instead, an alternative mechanism takes over. As Fig. 19.4 shows, a polycrystal can extend in response to the applied stress,  $\sigma$ , by grain elongation; here,  $\sigma$  acts again as a mechanical driving force but, this time atoms *diffuse* from one set of the grain faces to the other, and dislocations are not involved. At high  $T/T_M$ , this diffusion takes place through the crystal itself, that

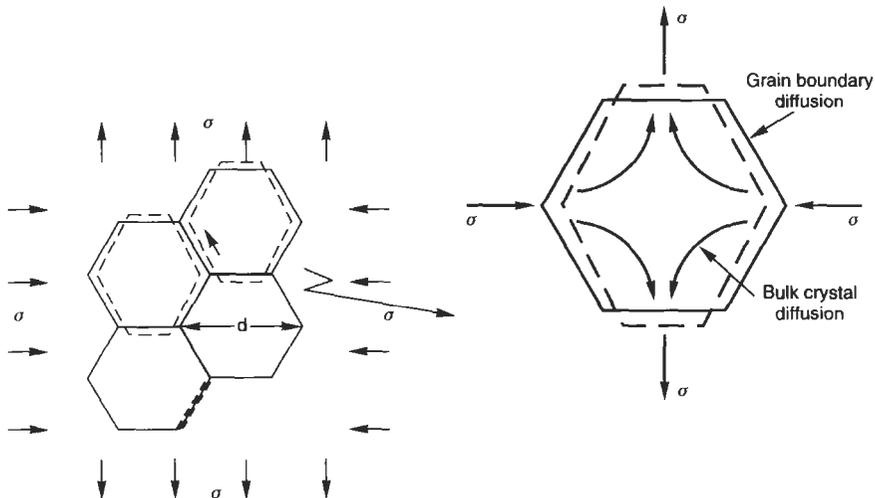


Fig. 19.4. How creep takes place by diffusion.

is, by bulk diffusion. The rate of creep is then obviously proportional to the *diffusion coefficient*  $D$ , (data in Table 18.1) and to the stress  $\sigma$  (because  $\sigma$  drives diffusion in the same way that  $dc/dx$  does in Fick's Law); and the creep rate varies as  $1/d^2$  where  $d$  is the grain size (because when  $d$  gets larger, atoms have to diffuse further). Assembling these facts leads to the constitutive equation

$$\dot{\epsilon}_{ss} = C \frac{D\sigma}{d^2} = \frac{C' \sigma e^{-Q/RT}}{d^2} \quad (19.2)$$

where  $C$  and  $C' = CD_0$  are constants. At lower  $T/T_M$ , when bulk diffusion is slow, grain-boundary diffusion takes over, but the creep rate is still proportional to  $\sigma$ . In order that holes do not open up between the grains, grain-boundary *sliding* is required as an accessory to this process.

### Deformation mechanism diagrams

This competition between mechanisms is conveniently summarised on Deformation Mechanism Diagrams (Figs. 19.5 and 19.6). They show the range of stress and temperature (Fig. 19.5) or of strain-rate and stress (Fig. 19.6) in which we expect to find each sort of creep (they also show where plastic yielding occurs, and where deformation is simply elastic). Diagrams like these are available for many metals and ceramics, and are a useful summary of creep behaviour, helpful in selecting a material for high-temperature applications.

Sometimes creep is desirable. Extrusion, hot rolling, hot pressing and forging are carried out at temperatures at which power-law creep is the dominant mechanism of deformation. Then raising the temperature reduces the pressures required for the operation. The change in forming pressure for a given change in temperature can be calculated from eqn. (19.1).

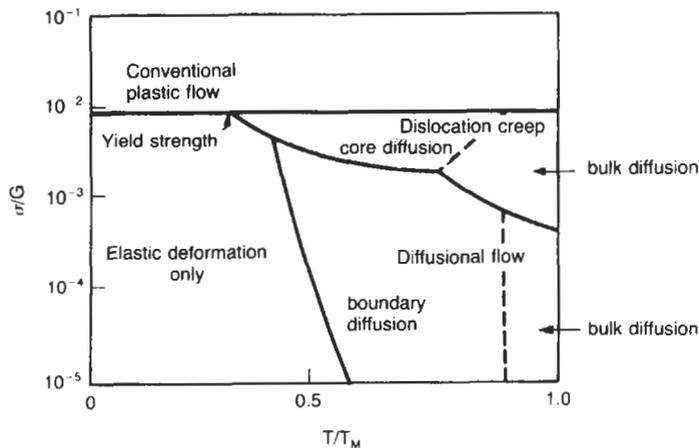


Fig. 19.5. Deformation mechanisms at different stresses and temperatures.

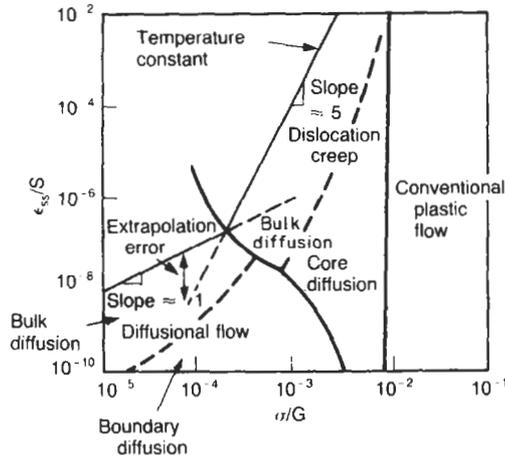


Fig. 19.6. Deformation mechanisms at different strain-rates and stresses.

### Creep fracture

Diffusion, we have seen, gives creep. It also gives creep fracture. If you stretch anything for long enough, it will break. You might think that a creeping material might – like toffee – stretch a long way before breaking in two, but, for crystalline materials, this is very rare. Indeed, creep fracture (in tension) can happen at unexpectedly small strains, often only 2–5%, by the mechanism shown in Fig. 19.7. Voids appear on grain boundaries which lie normal to the tensile stress. These are the boundaries to which atoms diffuse to give diffusional creep, coming from the boundaries which lie parallel to the stress. But if the tensile boundaries have voids on them, they act as sources of atoms too, and in doing so, they grow. The voids cannot support load, so the *stress* rises on the remaining intact bits of boundary, the voids grow more and more quickly, until finally (bang) they link.

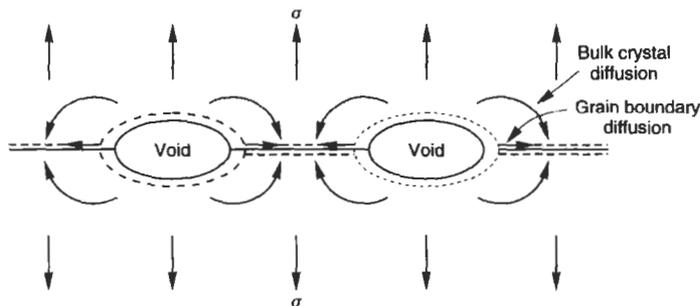


Fig. 19.7. The growth of voids on grain boundaries by diffusion.

The life-time of a component – its time-to failure,  $t_f$  – is related to the rate at which it creeps. As a general rule:

$$\epsilon_{ss} t_f = C$$

where  $C$  is a constant, roughly 0.1. So, knowing the creep rate, the life can be estimated.

Many engineering components (e.g. tie bars in furnaces, super-heater tubes, high-temperature pressure vessels in chemical reaction plants) are expected to withstand moderate creep loads for long times (say 20 years) without failure. The safe loads or pressure they can safely carry are calculated by methods such as those we have just described. But there are dangers. One would like to be able to test new materials for these applications without having to run the tests for 20 years and more. It is thus tempting to speed up the tests by increasing the load to get observable creep in a short test time. Now, if this procedure takes us across the boundary between two different types of mechanism, we shall have problems about extrapolating our test data to the operating conditions. Extrapolation based on power-law creep will be on the dangerous side as shown in Fig. 19.6. So: beware changes of mechanism in long extrapolations.

#### Designing metals and ceramics to resist power-law creep

If you are asked to select, or even to design, a material which will resist power-law creep, the criteria (all based on the ideas of this chapter and the last) are:

- (a) Choose a material with a high melting point, since diffusion (and thus creep-rates) scale as  $T/T_M$ .
- (b) Maximise obstructions to dislocation motion by alloying to give a solid solution and precipitates – as much of both as possible; the precipitates must, of course, be stable at the service temperature.
- (c) Choose, if this is practical, a solid with a large lattice resistance: this means covalent bonding (as in many oxides, and in silicates, silicon carbide, silicon nitride, and related compounds).

Current creep-resistant materials are successful because they satisfy these criteria.

#### Designing metals and ceramics to resist diffusional flow

Diffusional flow is important when grains are small (as they often are in ceramics) and when the component is subject to high temperatures at low loads. To select a material which resists it, you should

- (a) Choose a material with a high melting temperature.
- (b) Arrange that it has a large grain size, so that diffusion distances are long and grain boundaries do not help diffusion much – single crystals are best of all.
- (c) Arrange for precipitates at grain boundaries to impede grain-boundary sliding.

Metallic alloys are usually designed to resist power-law creep: diffusional flow is only rarely considered. One major exception is the range of directionally solidified ('DS') alloys described in the Case Study of Chapter 20: here special techniques are used to obtain very large grains.

Ceramics, on the other hand, often deform predominantly by diffusional flow (because their grains are small, and the high lattice resistance already suppresses power-law creep). Special heat treatments to increase the grain size can make them more creep-resistant.

## Creep mechanisms: polymers

Creep of polymers is a major design problem. The glass temperature  $T_G$ , for a polymer, is a criterion of creep-resistance, in much the way that  $T_M$  is for a metal or a ceramic. For most polymers,  $T_G$  is close to room temperature. Well below  $T_G$ , the polymer is a glass (often containing crystalline regions – Chapter 5) and is a brittle, elastic solid – rubber, cooled in liquid nitrogen, is an example. Above  $T_G$  the Van der Waals bonds within the polymer melt, and it becomes a rubber (if the polymer chains are cross-linked) or a viscous liquid (if they are not). Thermoplastics, which can be moulded when hot, are a simple example; well below  $T_G$  they are elastic; well above, they are viscous liquids, and flow like treacle.

Viscous flow is a sort of creep. Like diffusion creep, its rate increases linearly with stress and exponentially with temperature, with

$$\dot{\epsilon}_{ss} = C\sigma e^{-Q/\bar{R}T} \quad (19.3)$$

where  $Q$  is the activation energy for viscous flow.

The exponential term appears for the same reason as it does in diffusion; it describes the rate at which molecules can slide past each other, permitting flow. The molecules have a lumpy shape (see Fig. 5.9) and the lumps key the molecules together. The activation energy,  $Q$ , is the energy it takes to push one lump of a molecule past that of a neighbouring molecule. If we compare the last equation with that defining the *viscosity* (for the tensile deformation of a viscous material)

$$\eta = \frac{\sigma}{3\dot{\epsilon}} \quad (19.4)$$

we see that the viscosity is

$$\eta = \frac{1}{3C} e^{+Q/\bar{R}T}. \quad (19.5)$$

(The factor 3 appears because the viscosity is defined for shear deformation – as is the shear modulus  $G$ . For tensile deformation we want the viscous equivalent of Young's modulus  $E$ . The answer is  $3\eta$ , for much the same reason that  $E \approx (8/3)G \approx 3G$  – see Chapter 3.) Data giving  $C$  and  $Q$  for polymers are available from suppliers. Then

eqn. (19.3) allows injection moulding or pressing temperatures and loads to be calculated.

The temperature range in which most polymers are used is that near  $T_G$  when they are neither simple elastic solids nor viscous liquids; they are *visco-elastic* solids. If we represent the elastic behaviour by a spring and the viscous behaviour by a dash-pot, then visco-elasticity (at its simplest) is described by a coupled spring and dash-pot (Fig. 19.8). Applying a load causes creep, but at an ever-decreasing rate because the spring takes up the tension. Releasing the load allows slow reverse creep, caused by the extended spring.

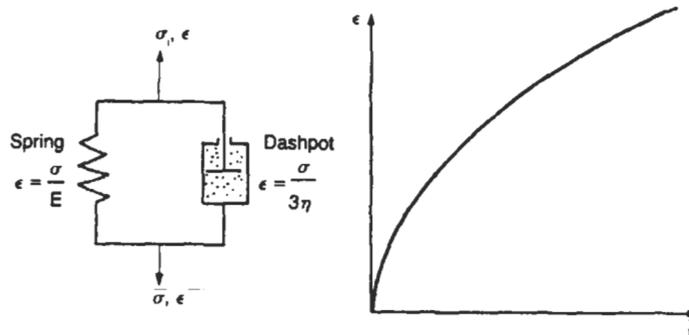


Fig. 19.8. A model to describe creep in polymers.

Real polymers require more elaborate systems of springs and dash-pots to describe them. This approach of *polymer rheology* can be developed to provide criteria for design with structural polymers. At present, this is rarely done; instead, graphical data (showing the creep extension after time  $t$  at stress  $\sigma$  and temperature  $T$ ) are used to provide an estimate of the likely deformation during the life of the structure.

### Designing polymers to resist creep

The glass temperature of a polymer increases with the degree of cross-linking; heavily cross-linked polymers (epoxies, for example) are therefore more creep-resistant at room temperature than those which are less cross-linked (like polyethylene). The viscosity of polymers above  $T_G$  increases with molecular weight, so that the rate of creep there is reduced by having a high molecular weight. Finally, crystalline or partly crystalline polymers (e.g. high-density polyethylene) are more creep-resistant than those which are entirely glassy (e.g. low-density polyethylene).

The creep-rate of polymers is reduced by filling them with glass or silica powders, roughly in proportion to the amount of filler added (PTFE on saucepans and polypropylene used for automobile components are both strengthened in this way). Much better creep resistance is obtained with composites containing continuous fibres (GFRP and CFRP) because much of the load is now carried by the fibres which, being very strong, do not creep at all.

## Selecting materials to resist creep

Classes of industrial applications tend to be associated with certain characteristic temperature ranges. There is the cryogenic range, between  $-273^{\circ}\text{C}$  and roughly room temperature, associated with the use of liquid gases like hydrogen, oxygen, or nitrogen. There is the regime at and near room temperature ( $-20$  to  $+150^{\circ}\text{C}$ ) associated with

**Table 19.1** Temperature ranges and associated materials

<i>Temperature range</i>	<i>Principal materials*</i>	<i>Applications</i>
Cryogenic: $-273$ to $-20^{\circ}\text{C}$	Copper alloys Austenitic (stainless) steels Aluminium alloys	Superconduction Rocket casings, pipework, etc. Liquid $\text{O}_2$ or $\text{N}_2$ equipment
$-20$ to $150^{\circ}\text{C}$	Most polymers (max temp: $60$ to $150^{\circ}\text{C}$ ) Magnesium alloys (up to $150^{\circ}\text{C}$ ) Aluminium alloys (up to $150^{\circ}\text{C}$ ) Monels and steels	Civil construction Household appliances Automotive Aerospace
$150$ to $400^{\circ}\text{C}$	PEEK, PEK, PI, PPD, PTFE and PES (up to $250^{\circ}\text{C}$ ) Fibre-reinforced polymers Copper alloys (up to $400^{\circ}\text{C}$ ) Nickel, monels and nickel-silvers	Food processing Automotive (engine)
$400$ to $575^{\circ}\text{C}$	Low alloy ferritic steels Titanium alloys (up to $450^{\circ}\text{C}$ ) Inconels and nimonics	Heat exchangers Steam turbines Gas turbine compressors
$575$ to $650^{\circ}\text{C}$	Iron-based super-alloys Ferritic stainless steels Austenitic stainless steels Inconels and nimonics	Steam turbines Superheaters Heat exchangers
$650$ to $1000^{\circ}\text{C}$	Austenitic stainless steels Nichromes, nimonics Nickel based super-alloys Cobalt based super-alloys	Gas turbines Chemical and petrochemical reactors Furnace components Nuclear construction
Above $1000^{\circ}\text{C}$	Refractory metals: Mo, W, Ta Alloys of Nb, Mo, W, Ta Ceramics: Oxides $\text{Al}_2\text{O}_3$ , $\text{MgO}$ etc. Nitrides, Carbides: $\text{Si}_3\text{N}_4$ , $\text{SiC}$	Special furnaces Experimental turbines

\* Copper alloys include brasses (Cu–Zn alloys), bronzes (Cu–Sn alloys), cupronickels (Cu–Ni alloys) and nickel-silvers (Cu–Sn–Ni–Pb alloys).

Titanium alloys generally mean those based on Ti–V–Al alloys.

Nickel alloys include monels (Ni–Cu alloys), nichromes (Ni–Cr alloys), nimonics and nickel-based super-alloys (Ni–Fe–Cr–Al–Co–Mo alloys).

Stainless steels include ferritic stainless (Fe–Cr–Ni alloys with  $< 6\%$  Ni) and austenitic stainless (Fe–Cr–Ni alloys with  $> 6.5\%$  Ni).

Low alloy ferritic steels contain up to  $4\%$  of Cr, Mo and V.

conventional mechanical and civil engineering: household appliances, sporting goods, aircraft structures and housing are examples. Above this is the range 150 to 400°C, associated with automobile engines and with food and industrial processing. Higher still are the regimes of steam turbines and superheaters (typically 400 to 650°C) and of gas turbines and chemical reactors (650 to 1000°C). Special applications (lamp filaments, rocket nozzles) require materials which withstand even higher temperatures, extending as high as 2800°C.

Materials have evolved to fill the needs of each of these temperature ranges (Table 19.1). Certain polymers, and composites based on them, can be used in applications up to 250°C, and now compete with magnesium and aluminium alloys and with the much heavier cast irons and steels, traditionally used in those ranges. Temperatures above 400°C require special creep resistant alloys: ferritic steels, titanium alloys (lighter, but more expensive) and certain stainless steels. Stainless steels and ferrous superalloys really come into their own in the temperature range above this, where they are widely used in steam turbines and heat exchangers. Gas turbines require, in general, nickel-based or cobalt-based super-alloys. Above 1000°C, the refractory metals and ceramics become the only candidates. Materials used at high temperatures will, generally, perform perfectly well at lower temperatures too, but are not used there because of cost.

### Further reading

- I. Finnie and W. R. Heller, *Creep of Engineering Materials*, McGraw Hill, 1959.
- H. J. Frost and M. F. Ashby, *Deformation Mechanism Maps*, Pergamon Press, 1982.

# Chapter 20

## The turbine blade – a case study in creep-limited design

---

### Introduction

In the last chapter we saw how a basic knowledge of the mechanisms of creep was an important aid to the development of materials with good creep properties. An impressive example is in the development of materials for the high-pressure stage of a modern aircraft gas turbine. Here we examine the properties such materials must have, the way in which the present generation of materials has evolved, and the likely direction of their future development.

As you may know, the *ideal* thermodynamic efficiency of a heat engine is given by

$$\frac{T_1 - T_2}{T_1} = 1 - \frac{T_2}{T_1} \quad (20.1)$$

where  $T_1$  and  $T_2$  are the absolute temperatures of the heat source and heat sink respectively. Obviously the greater  $T_1$ , the greater the maximum efficiency that can be derived from the engine. In practice the efficiency is a good deal less than ideal, but an increase in combustion temperature in a turbofan engine will, nevertheless, generate an increase in engine efficiency. Figure 20.1 shows the variation in efficiency of a turbofan engine plotted as a function of the turbine inlet temperature. In 1950 a typical aero engine operated at 700°C. The incentive then to increase the inlet temperature was

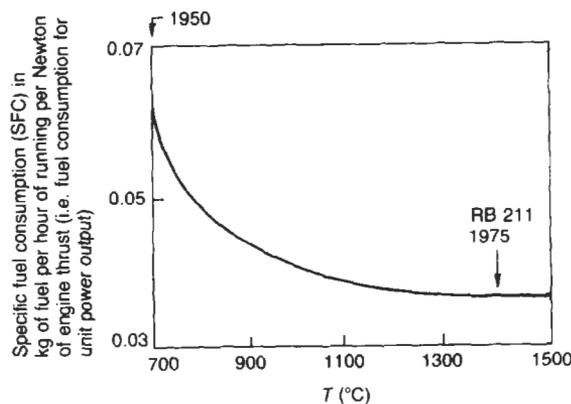


Fig. 20.1. Turbofan efficiency at different inlet temperatures.

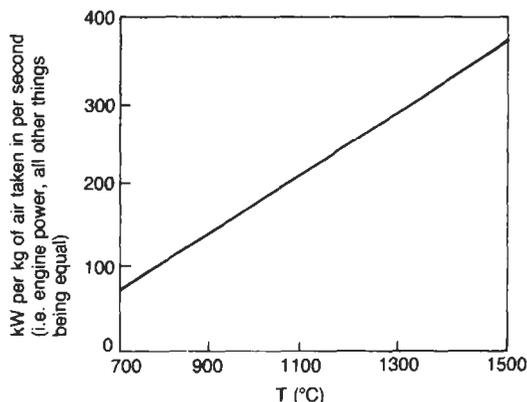


Fig. 20.2. Turbobfan power at different inlet temperatures.

strong, because of the steepness of the fuel-consumption curve at that temperature. By 1975 a typical engine (the RB211, for instance) operated at 1350°C, with a 50% saving in fuel per unit power output over the 1950 engines. But is it worth raising the temperature further? The shallowness of the consumption curve at 1400°C suggests that it might not be profitable; but there is a second factor: power-to-weight ratio. Figure 20.2 shows a typical plot of the power output of a particular engine against turbine inlet temperature. This increases *linearly* with the temperature. If the turbine could both run at a higher temperature and be made of a lighter material there would be a double gain, with important financial benefits of increased payload.

## Properties required of a turbine blade

Let us first examine the development of turbine-blade materials to meet the challenge of increasing engine temperatures. Although so far we have been stressing the need for excellent creep properties, a turbine-blade alloy must satisfy other criteria too. They are listed in Table 20.1.

The first – creep – is our interest here. The second – resistance to oxidation – is the subject of Chapter 21. Toughness and fatigue resistance (Chapters 13 and 15) are obviously important: blades must be tough enough to withstand the impact of birds

Table 20.1 Alloy requirements

- 
- (a) Resistance to creep
  - (b) Resistance to high-temperature oxidation
  - (c) Toughness
  - (d) Thermal fatigue resistance
  - (e) Thermal stability
  - (f) Low density
-

and such like; and changes in the power level of the engine produce mechanical and thermal stresses which – if the blade material is wrongly chosen – will lead to *thermal fatigue*. The alloy composition and structure must remain *stable* at high temperature – precipitate particles can dissolve away if the alloy is overheated and the creep properties will then degenerate significantly. Finally, the *density* must be as low as possible – not so much because of blade weight but because of the need for stronger and hence heavier turbine discs to take the radial load.

These requirements severely limit our choice of creep-resistant materials. For example, ceramics, with their high softening temperatures and low densities, are ruled out for aero-engines because they are far too brittle (they are under evaluation for use in land-based turbines, where the risks and consequences of sudden failure are less severe – see below). Cermets offer no great advantage because their metallic matrices soften at much too low a temperature. The materials which best fill present needs are the *nickel-based super-alloys*.


## Nickel-based super-alloys

The alloy used for turbine blades in the high pressure stage of aircraft turbo fan is a classic example of a material designed to be resistant to dislocation (power-law) creep at high stresses and temperatures. At take-off, the blade is subjected to stresses approaching  $250 \text{ MN m}^{-2}$ , and the design specification requires that this stress shall be supported for 30 hours at  $850^\circ\text{C}$  without more than a 0.1% irreversible creep strain. In order to meet these stringent requirements, an alloy based on nickel has evolved with the rather mind-boggling specification given in Table 20.2.

No one tries to remember exact details of this or similar alloys. But the point of all these complicated additions of foreign atoms to the nickel is straightforward. It is: (a) to have as many atoms in solid solution as possible (the cobalt; the tungsten; and the chromium); (b) to form stable, hard precipitates of compounds like  $\text{Ni}_3\text{Al}$ ,  $\text{Ni}_3\text{Ti}$ ,  $\text{MoC}$ ,

**Table 20.2** Composition of typical creep-resistant blade


	(wt %)		(wt %)
Ni	59	Mo	0.25
Co	10	C	0.15
W	10	Si	0.1
Cr	9	Mn	0.1
Al	5.5	Cu	0.05
Ta	2.5	Zr	0.05
Ti	1.5	B	0.015
Hf	1.5	S	<0.008
Fe	0.25	Pb	<0.0005

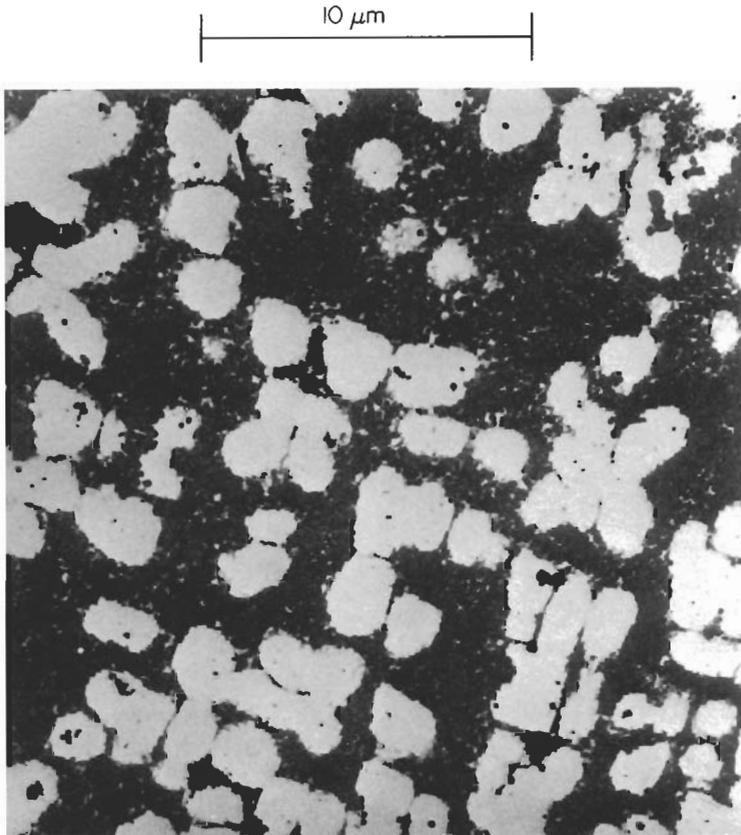

**Fig. 20.3(a)** A piece of a nickel-based super-alloy cut open to show the structure: there are two sizes of precipitates in the alloy – the large white precipitates, and the much smaller black precipitates in between.


TaC to obstruct the dislocations; and (c) to form a protective surface oxide film of  $\text{Cr}_2\text{O}_3$  to protect the blade itself from attack by oxygen (we shall discuss this in Chapter 22). Figure 20.3 (a and b) shows a piece of a nickel-based super-alloy cut open to reveal its complicated structure.

These super-alloys are remarkable materials. They resist creep so well that they can be used at  $850^\circ\text{C}$  – and since they melt at  $1280^\circ\text{C}$ , this is 0.72 of their (absolute) melting point. They are so hard that they cannot be machined easily by normal methods, and must be precision-cast to their final shape. This is done by *investment casting*: a precise wax model of the blade is embedded in an alumina paste which is then fired; the wax burns out leaving an accurate mould from which one blade can be made by pouring liquid super-alloy into it (Fig. 20.4). Because the blades have to be made by this one-off method, they are expensive. One blade costs about UK£250 or US\$375, of which only UK£20 (US\$30) is materials; the total cost of a rotor of 102 blades is UK£25,000 or US\$38,000.

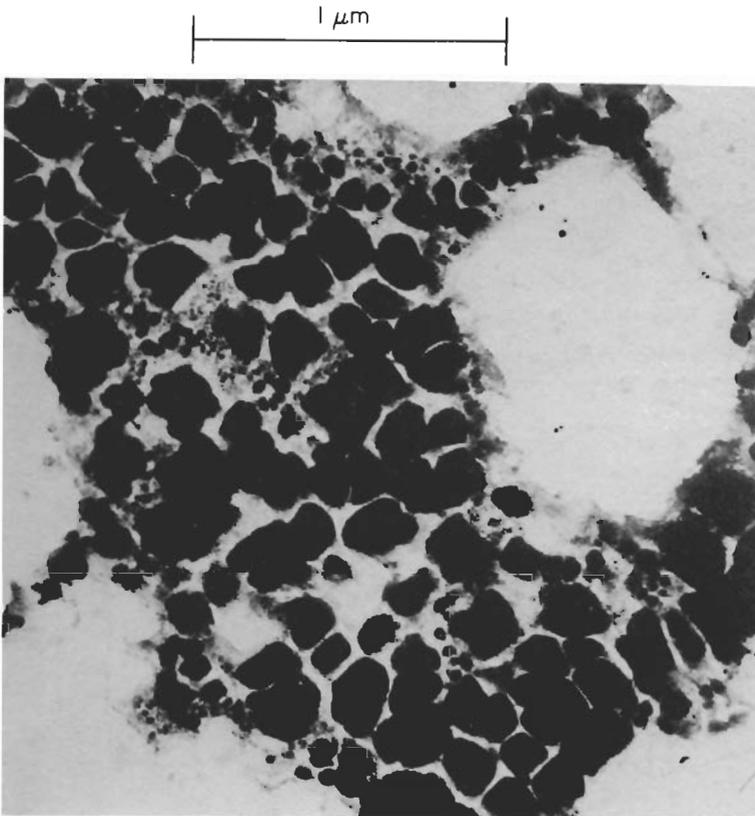


**Fig. 20.3(b)** As Fig. 20.3(a), but showing a much more magnified view of the structure, in which the small precipitates are more clearly identifiable.

Cast in this way, the grain size of such a blade is small (Fig. 20.4). The strengthening caused by alloying successfully suppresses power-law creep, but at  $0.72T_M$ , diffusional flow then becomes a problem (see the deformation-mechanism diagrams of Chapter 19). The way out is to increase the grain size, or even make blades with no grain boundaries at all. In addition, *creep damage* (Chapter 19) accumulates at grain boundaries; we can obviously stave off failure by eliminating grain boundaries, or aligning them parallel to the applied stress (see Fig. 20.4). To do this, we *directionally solidify* the alloys (see Fig. 20.5) to give long grains with grain boundaries parallel to the applied stress. The diffusional distances required for diffusional creep are then very large (greatly cutting down the rate of diffusional creep); in addition, there is no driving force for grain boundary sliding or for cavitation at grain boundaries. Directionally solidified (DS) alloys are standard in high-performance engines and are now in use in civil aircraft also. The improved creep properties of the DS alloy will allow the engine to run at a flame temperature

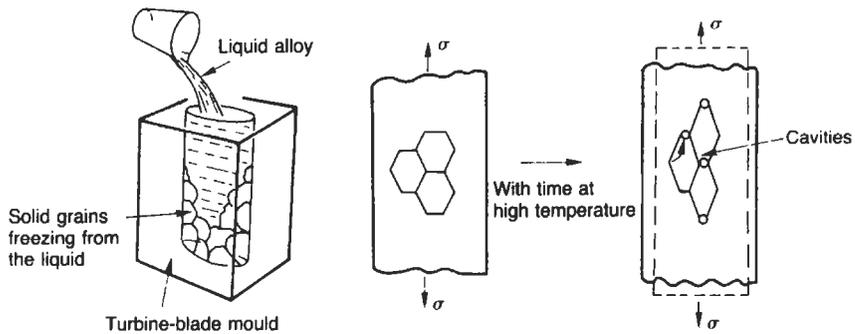

**Fig. 20.4.** Investment casting of turbine blades. This produces a fine-grained material which may undergo a fair amount of diffusion creep, and which may fail rather soon by cavity formation.

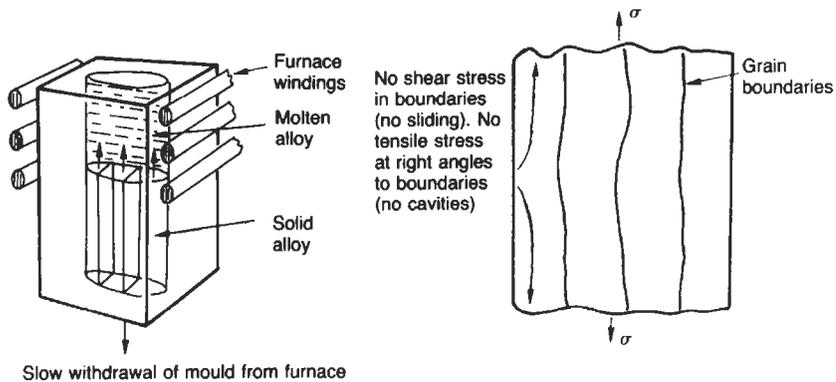

**Fig. 20.5.** Directional Solidification (DS) of turbine blades.

approximately 50°C higher than before, for an additional production cost of about UK£150 or US\$240 per blade.

How was this type of alloy discovered in the first place? Well, the fundamental principles of creep-resistant materials design that we talked about helps us to select the more promising alloy recipes and discard the less promising ones fairly easily. Thereafter, the approach is an empirical one. Large numbers of alloys having different recipes are made up in the laboratory, and tested for creep, oxidation, toughness, thermal fatigue and stability. The choice eventually narrows down to a few alloys and these are subjected to more stringent testing, coupled with judicious tinkering with the alloy recipe. All this is done using a semi-intuitive approach based on previous experience, knowledge of the basic principles of materials design and a certain degree of hunch and luck! Small improvements are continually made in alloy composition and in the manufacture of the finished blades, which evolve by a sort of creepy Darwinism, the fittest (in the sense of Table 20.1) surviving.

Figure 20.6 shows how this evolutionary process has resulted in a continual improvement of creep properties of nickel alloys over the last 30 years, and shows how

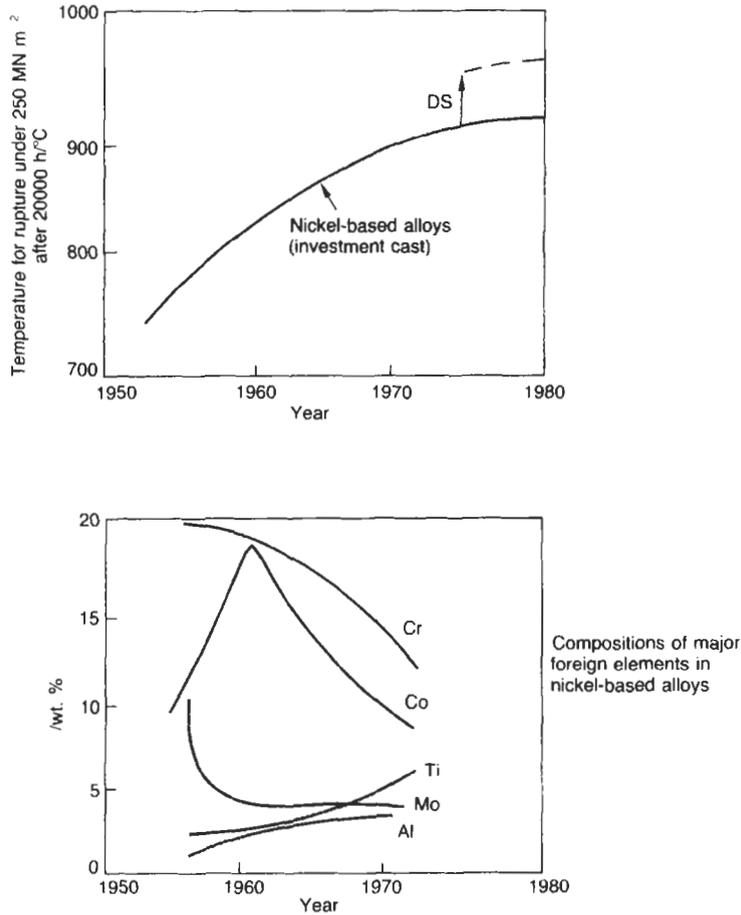


Fig. 20.6. Super-alloy developments.

the amounts of the major foreign elements have been juggled to obtain these improvements – keeping a watchful eye on the remaining necessary properties. The figure also shows how improvements in alloy manufacture – in this case the use of directional solidification – have helped to increase the operating temperature. Nevertheless, it is clear from the graph that improvements in nickel alloys are now nearing the point of diminishing returns.

### Engineering developments – blade cooling

Figure 20.7 shows that up to 1960 turbine inlet temperatures were virtually the same as the metal temperatures. After 1960 there was a sharp divergence, with inlet temperatures substantially above the temperatures of the blade metal itself – indeed, the gas temperature is greater than the *melting point* of the blades. Impossible? Not at

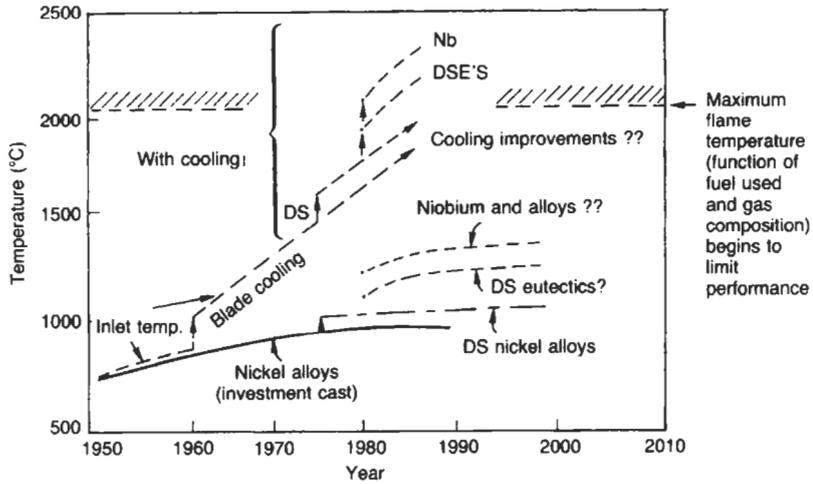


Fig. 20.7. Temperature evolution and future materials trends in turbine blades.

all. It is done by air-cooling the blades, and in a cunning way. In the earliest form of cooled blade, cooling air from the compressor stage of the engine was fed through ports passing along the full length of the blade, and was ejected into the gas stream at the blade end (see Fig. 20.8). This *internal cooling* of the blade enabled the inlet temperature to be increased immediately by 100°C with no change in alloy composition. A later improvement was *film cooling*, in which the air was ejected over the surface of the blade, through little holes connected to the central channel, giving a cool boundary layer between the blade and the hot gases. A programme of continuous improvement in the efficiency of heat transfer by refinements of this type has made it possible for modern turbofans to operate at temperatures that are no longer dominated by the properties of the material.


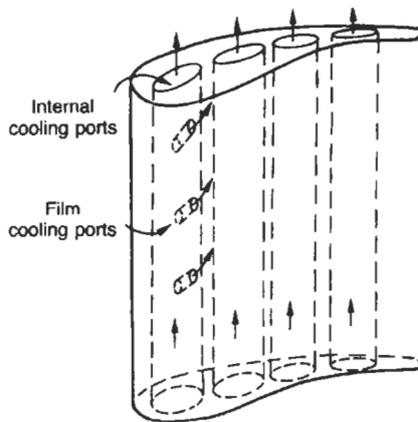


Fig. 20.8. Air-cooled blades.

But blade cooling has reached a limit: ducting still more cold air through the blades will begin to *reduce* the thermal efficiency by taking too much heat away from the combustion chamber. What do we do now?

### Future developments: metals and metal-matrix composites

Driven by these impending limits to blade cooling emphasis has switched back to materials development. Because of the saturation in the development of nickel alloys, more revolutionary approaches are being explored.

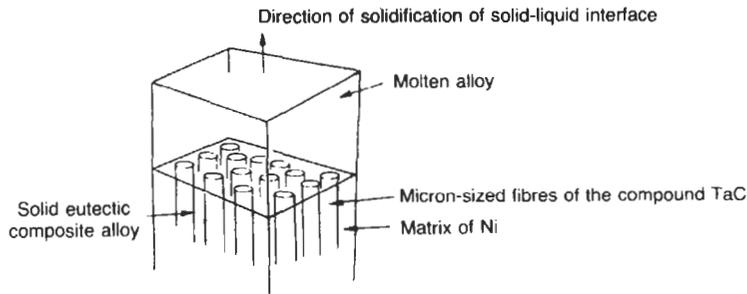

**Fig. 20.9.** Directionally solidified eutectics for turbine blades.

One of these is to exploit a unique characteristic of some alloys – belonging to a class called *eutectics* – to form spontaneously an aligned reinforced structure when directionally solidified. Figure 20.9 shows how they are made. Table 20.3 lists some typical high-temperature composites under study for turbine-blade applications. The reinforcing phase is usually a compound with a high melting temperature; this compound would be far too brittle on its own, but the surrounding metal matrix gives the composite the required toughness. The important feature of these alloys is that the high-melting-point fibres greatly improve the creep properties of the composite alloy, as one might anticipate. The bonding between fibres and matrix is atomic and therefore strong. The structure is very fine (the fibres are only microns in diameter) and the

**Table 20.3** High-temperature composites

<i>Matrix</i>	<i>Reinforcing phase</i>	<i>Reinforcing phase geometry</i>
Ni	TaC	fibres
Co	TaC	fibres
Ni <sub>3</sub> Al	Ni <sub>3</sub> Nb	plates
Co	Cr <sub>7</sub> C <sub>3</sub>	fibres
Nb	Nb <sub>2</sub> C	fibres

**Table 20.4** Ceramics for high-temperature structures

Material	Density ( $\text{Mg m}^{-3}$ )	Melting or decomposition (D) temperature (K)	Modulus ( $\text{GN m}^{-2}$ )	Expansion coefficient $\times 10^{-6} (\text{K}^{-1})$	Thermal conductivity at 1000 K ( $\text{W m}^{-1} \text{K}^{-1}$ )	Fracture toughness $K_{\text{Ic}}$ ( $\text{MN m}^{-3/2}$ )
Alumina, $\text{Al}_2\text{O}_3$	4.0	2320	360	6.9	7	$\approx 5$
Glass-ceramics (pyrocerams)	2.7	>1700	$\approx 120$	$\approx 3$	$\approx 3$	$\approx 3$
Hot-pressed silicon nitride, $\text{Si}_3\text{N}_4$	3.1	2173 (D)	310	3.1	16	$\approx 5$
Hot-pressed silicon carbide, $\text{SiC}$	3.2	3000 (D)	$\approx 420$	4.3	60	$\approx 3.5$
Nickel alloys (Nimonic)	8.0	1600	200	12.5	12	$\approx 100$

accidental breaking of a few of the brittle fibres in service would have little effect on the composite as a whole.

As Fig. 20.7 shows, if DS eutectics ('DSEs') prove successful, they will allow the metal temperature to be increased by  $\approx 100^\circ\text{C}$  above conventional DS nickel alloys, and the inlet temperature by  $\approx 200^\circ\text{C}$  (because of a temperature scaling effect caused by the blade cooling). Further improvements in alloy design are under way in which existing nickel alloys and DS eutectics are being blended to give a fibre-reinforced structure with precipitates in the matrix.

### Future developments: high-temperature ceramics

The ceramics best suited for structural use at high temperatures ( $\approx 1000^\circ\text{C}$ ) are listed in Table 20.4 and compared with nickel-based super-alloys. The comparison shows that all the ceramics have attractively low densities, high moduli and high melting points (and thus excellent creep strength at  $1000^\circ\text{C}$ ); and many are completely resistant to oxidation – they are oxides already. But several have poor thermal conductivity (leading to high thermal stresses) and all have very low toughness.

Alumina ( $\text{Al}_2\text{O}_3$ ) was one of the first pure oxides to be produced in complex shapes, but its combination of high expansion coefficient, poor conductivity and low toughness gives it bad thermal-shock resistance.

Glass-ceramics are made by forming a complex silicate glass and then causing it to partly crystallise. They are widely used for ovenware and for heat exchangers for small engines. Their low thermal expansion gives them much better thermal shock resistance than most other ceramics, but the upper working temperature of  $900^\circ\text{C}$  (when the glass phase softens) limits their use.

The covalently-bonded silicon carbide, silicon nitride, and sialons (alloys of  $\text{Si}_3\text{N}_4$  and  $\text{Al}_2\text{O}_3$ ) seem to be the best bet for high-temperature structural use. Their creep resistance

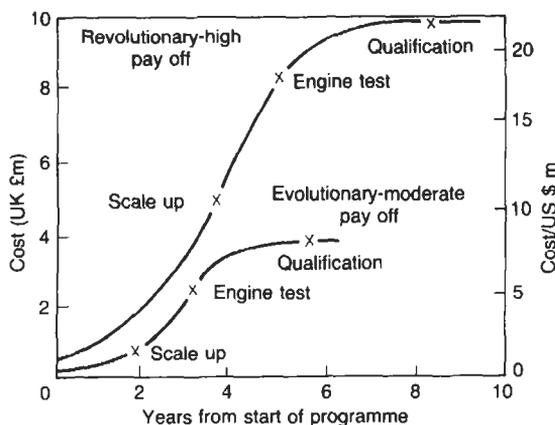


Fig. 20.10. Development costs of new turbine-blade materials.

is outstanding up to 1300°C, and their low expansion and high conductivity (better than nickel alloys!) makes them resist thermal shock well in spite of their typically low toughness. They can be formed by hot-pressing fine powders, by vapour deposition, or by nitriding silicon which is already pressed to shape: in this way, precise shapes (like turbine blades) can be formed without the need for machining (they are much too hard to machine). Their brittleness, however, creates major design problems. It might be overcome by creating ceramics with a fibrous structure, a bit like wood. In an effort to do this, ceramic-matrix components are under development: they combine strong, exceptionally perfect, fibres (such as silicon carbide or alumina, grown by special techniques) in a matrix of ceramic (silicon carbide or alumina again), made by conventional means to give a material that you might think of as 'high temperature wood'.

These materials are now under intensive study for turbine use.

## Cost effectiveness

Any major materials development programme, such as that on the eutectic super-alloys, can only be undertaken if a successful outcome would be cost effective. As Fig. 20.10 shows, the costs of development can be colossal. Even before a new material is out of the laboratory, 5 to 10 million pounds (8 to 15 million dollars) can have been spent, and failure in an engine test can be expensive. Because the performance of a new alloy cannot finally be verified until it has been extensively flight-tested, at each stage of development risk decisions have to be taken whether to press ahead, or cut losses and abandon the programme.

One must consider, too, the cost of the materials themselves. Some of the metals used in conventional nickel alloys – such as hafnium – are hideously expensive (at UK£100,000 tonne<sup>-1</sup> or US\$150,000 tonne<sup>-1</sup>) and extremely scarce; and the use of greater and greater quantities of exotic materials in an attempt to improve the creep properties will drive the cost of blades up. But expensive though it is, the cost of the

turbine blades is still only a small fraction of the cost of an engine, or of the fuel it will consume in its lifetime. Blade costs *are* important, but if new alloys offer improved life or inlet temperature, there is a strong incentive to pursue them.

## **F. Oxidation and corrosion**

---



# Chapter 21

## Oxidation of materials

---

### Introduction

In the last chapter we said that one of the requirements of a high-temperature material – in a turbine blade, or a super-heater tube, for example – was that it should resist attack by gases at high temperatures and, in particular, that it should resist oxidation. Turbine blades *do* oxidise in service, and react with H<sub>2</sub>S, SO<sub>2</sub> and other combustion products. Excessive attack of this sort is obviously undesirable in such a highly stressed component. Which materials best resist oxidation, and how can the resistance to gas attack be improved?

Well, the earth's atmosphere is oxidising. We can get some idea of oxidation-resistance by using the earth as a laboratory, and looking for materials which survive well in its atmosphere. All around us we see ceramics: the earth's crust (Chapter 2) is almost entirely made of oxides, silicates, aluminates and other compounds of oxygen; and being oxides already, they are completely stable. Alkali halides, too, are stable: NaCl, KCl, NaBr – all are widely found in nature. By contrast, metals are not stable: only gold is found in 'native' form under normal circumstances (it is completely resistant to oxidation at all temperatures); all the others in our data sheets will oxidise in contact with air. Polymers are not stable either: most will burn if ignited, meaning that they oxidise readily. Coal and oil (the raw materials for polymers), it is true, are found in nature, but that is only because geological accidents have sealed them off from all contact with air. A few polymers, among them PTFE (a polymer based on —CF<sub>2</sub>—), are so stable that they survive long periods at high temperatures, but they are the exceptions. And polymer-based composites, of course, are just the same: wood is not noted for its high-temperature oxidation resistance.

How can we categorise in a more precise way the oxidation-resistance of materials? If we can do so for oxidation, we can obviously follow a similar method for sulphidation or nitrogenation.

### The energy of oxidation

This tendency of many materials to react with oxygen can be quantified by laboratory tests which measure the energy needed for the reaction



If this energy is *positive*, the material is stable; if *negative*, it will oxidise. The bar-chart of Fig. 21.1 shows the energies of oxide formation for our four categories of materials; numerical values are given in Table 21.1.

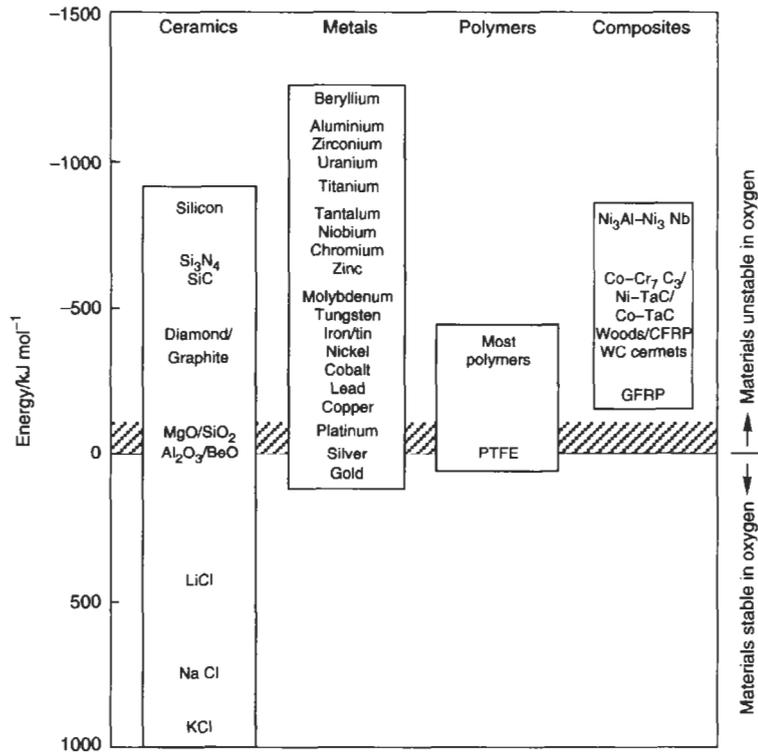


Fig 21.1. Energies of formation of oxides at 273 K/kJ mol<sup>-1</sup> of oxygen O<sub>2</sub>.

## Rates of oxidation

When designing with oxidation-prone materials, it is obviously vital to know how *fast* the oxidation process is going to be. Intuitively one might expect that, the larger the energy released in the oxidation process, the faster the *rate* of oxidation. For example, one might expect aluminium to oxidise 2.5 times faster than iron from the energy data in Fig. 21.1. In fact, aluminium oxidises much more slowly than iron. Why should this happen?

If you heat a piece of bright iron in a gas flame, the oxygen in the air reacts with the iron at the surface of the metal where the oxygen and iron atoms can contact, creating a thin layer of iron oxide on the surface, and making the iron turn black. The layer grows in thickness, quickly at first, and then more slowly because iron atoms now have to diffuse through the film before they make contact and react with oxygen. If you plunge the piece of hot iron into a dish of water the shock of the quenching breaks off the iron oxide layer, and you can see the pieces of layer in the dish. The iron surface now appears bright again, showing that the shock of the quenching has completely stripped the metal of the oxide layer which formed during the heating; if it were reheated, it would oxidise at the old rate.

**Table 21.1** Energies of formation of oxides at 273 K

Material (oxide)	Energy (kJ mol <sup>-1</sup> of oxygen, O <sub>2</sub> )	Material (oxide)	Energy (kJ mol <sup>-1</sup> of oxygen, O <sub>2</sub> )
Beryllium (BeO)	-1182	Woods, most polymers, CFRP	≈ -400
Magnesium (MgO)	-1162	Diamond, graphite (CO <sub>2</sub> )	-389
Aluminium (Al <sub>2</sub> O <sub>3</sub> )	-1045	Tungsten carbide cermet (WO <sub>3</sub> + CO <sub>2</sub> )	-349
Zirconium (ZrO <sub>2</sub> )	-1028	(mainly WC)	
Uranium (U <sub>3</sub> O <sub>8</sub> )	≈ -1000	Lead (Pb <sub>3</sub> O <sub>4</sub> )	-309
Titanium (TiO)	-848	Copper (CuO)	-254
Silicon (SiO <sub>2</sub> )	-836	GFRP	≈ -200
Tantalum (Ta <sub>2</sub> O <sub>5</sub> )	-764	Platinum (PtO <sub>2</sub> )	≈ -160
Niobium (Nb <sub>2</sub> O <sub>5</sub> )	-757	Silver (Ag <sub>2</sub> O)	-5
Chromium (Cr <sub>2</sub> O <sub>3</sub> )	-701	PTFE	≈ zero
Zinc (ZnO)	-636	Gold (Au <sub>2</sub> O <sub>3</sub> )	+80
Silicon nitride Si <sub>3</sub> N <sub>4</sub> (3SiO <sub>2</sub> + 2N <sub>2</sub> )	≈ -629	Alkali halides	≈ +400 to ≈ +1400
Silicon carbide SiC (SiO <sub>2</sub> + CO <sub>2</sub> )	≈ -580	Magnesia, MgO	} Large and positive
Molybdenum (MoO <sub>2</sub> )	-534	Silica, SiO <sub>2</sub>	
Tungsten (WO <sub>3</sub> )	-510	Alumina, Al <sub>2</sub> O <sub>3</sub>	
Iron (Fe <sub>3</sub> O <sub>4</sub> )	-508	Beryllia, BeO	
Tin (SnO)	-500		
Nickel (NiO)	-439		
Cobalt (CoO)	-422		

The important thing about the oxide film is that it acts as a *barrier* which keeps the oxygen and iron atoms apart and cuts down the rate at which these atoms react to form more iron oxide. Aluminium, and most other materials, form oxide barrier layers in just the same sort of way – but the oxide layer on aluminium is a *much* more effective barrier than the oxide film on iron is.

How do we measure rates of oxidation in practice? Well, because oxidation proceeds by the addition of oxygen atoms to the surface of the material, the *weight* of the material usually goes up in proportion to the amount of material that has become oxidised. This weight increase,  $\Delta m$ , can be monitored continuously with time  $t$  in the way illustrated in Fig. 21.2. Two types of behaviour are usually observed at high temperature. The first is *linear oxidation*, with

$$\Delta m = k_L t \quad (21.1)$$

where  $k_L$  is a *kinetic constant*. Naturally,  $k_L$  is usually positive. (In a few materials, however, the oxide evaporates away as soon as it has formed; the material then *loses* weight and  $k_L$  is then negative.)

The second type of oxidation behaviour is *parabolic oxidation*, with

$$(\Delta m)^2 = k_P t \quad (21.2)$$

where  $k_P$  is another kinetic constant, this time always positive.

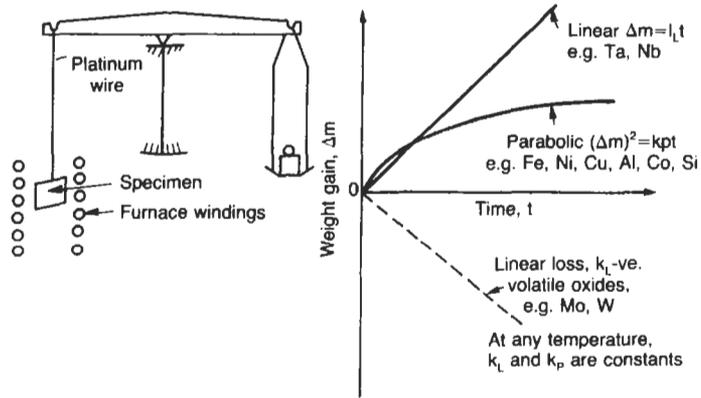


Fig 21.2. Measurement of oxidation rates.

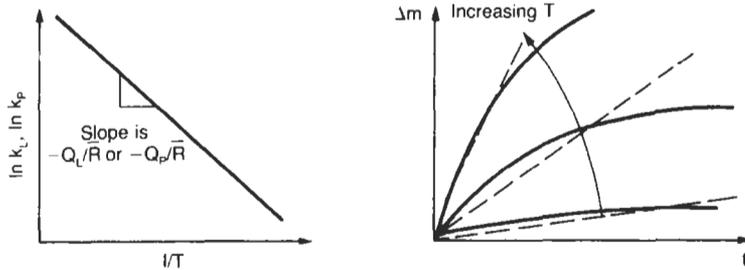


Fig 21.3. Oxidation rates increase with temperature according to Arrhenius's Law.

Oxidation rates follow Arrhenius's Law (Chapter 18), that is, the kinetic constants  $k_L$  and  $k_P$  increase exponentially with temperature:

$$k_L = A_L e^{-Q_L/\bar{R}T} \quad \text{and} \quad k_P = A_P e^{-Q_P/\bar{R}T} \tag{21.3}$$

where  $A_L$  and  $A_P$ ,  $Q_L$  and  $Q_P$  are constants. Thus, as the temperature is increased, the rate of oxidation increases exponentially (Fig. 21.3).

Finally, oxidation rates obviously increase with increasing partial pressure of oxygen, although rarely in a simple way. The partial pressure of oxygen in a gas turbine atmosphere, for example, may well be very different from that in air, and it is important to conduct oxidation tests on high-temperature components under the right conditions.

### Data

Naturally, it is important from the design standpoint to know how much material is replaced by oxide. The mechanical properties of the oxide are usually grossly inferior to the properties of the material (oxides are comparatively brittle, for example), and

**Table 21.2** Time in hours for material to be oxidised to a depth of 0.1 mm at  $0.7 T_M$  in air (N.B. – data subject to considerable variability due to varying degrees of material purity, prior surface treatment and presence of atmospheric impurities like sulphur)

Material	Time	Melting point (K)	Material	Time	Melting point (K)
Au	infinite?	1336	Ni	600	1726
Ag	very long	1234	Cu	25	1356
Al	very long	933	Fe	24	1809
Si <sub>3</sub> N <sub>4</sub>	very long	2173	Co	7	1765
SiC	very long	3110	Ti	<6	1943
Sn	very long	505	WC cermet	<5	1700
Si	$2 \times 10^6$	1683	Ba	<<0.5	983
Be	$10^6$	1557	Zr	0.2	2125
Pt	$1.8 \times 10^5$	2042	Ta	very short	3250
Mg	$>10^5$	923	Nb	very short	2740
Zn	$>10^4$	692	U	very short	1405
Cr	1600	2148	Mo	very short	2880
Na	>1000	371	W	very short	3680
K	>1000	337			

even if the layer is firmly attached to the material – which is certainly not always the case – the effective section of the component is reduced. The reduction in the section of a component can obviously be calculated from data for  $\Delta m$ .

Table 21.2 gives the times for a range of materials required to oxidise them to a depth of 0.1 mm from the surface when exposed to air at  $0.7T_M$  (a typical figure for the operating temperature of a turbine blade or similar component): these times vary by many orders of magnitude, and clearly show that there is no correlation between oxidation rate and energy needed for the reaction (see Al, W for extremes: Al, *very* slow – energy =  $-1045 \text{ kJ mol}^{-1}$  of O<sub>2</sub>; W, *very* fast – energy =  $-510 \text{ kJ mol}^{-1}$  of O<sub>2</sub>).

## Micromechanisms


Figure 21.4 illustrates the mechanism of parabolic oxidation. The reaction




(where M is the material which is oxidising and O is oxygen) really goes in two steps. First M forms an ion, releasing electrons,  $e$ :




These electrons are then absorbed by oxygen to give an oxygen ion:

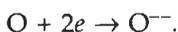


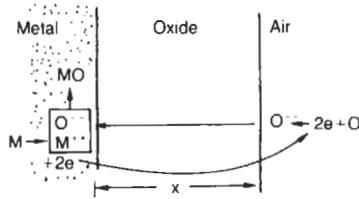

Case 1.  $M^{++}$  diffuses very slowly in oxide. Oxide grows at metal-oxide interface. Examples: Ti, Zr, U.

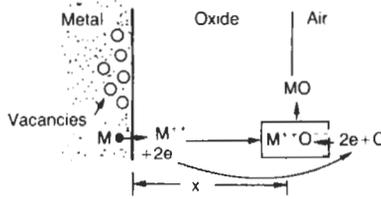

Case 2.  $O^{--}$  diffuses very slowly in oxide. Oxide grows at oxide-air interface. Vacancies form between metal and oxide. Examples: Cu, Fe, Cr, Co.

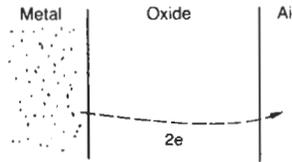

Case 3. Electrons move very slowly. Oxide can grow (slowly) at metal-oxide interface or oxide-air interface depending on whether  $M^{++}$  diffuses faster than  $O^{--}$  or not. Example: Al

**Fig. 21.4.** How oxide layers grow to give parabolic oxidation behaviour.

Either the  $M^{++}$  and the two  $e^-$ s diffuse outward through the film to meet the  $O^{--}$  at the outer surface, or the oxygen diffuses inwards (with two electron holes) to meet the  $M^{++}$  at the inner surface. The concentration gradient of oxygen is simply the concentration in the gas,  $c$ , divided by the film thickness,  $x$ ; and the rate of growth of the film  $dx/dt$  is obviously proportional to the flux of atoms diffusing through the film. So, from Fick's Law (eqn. (18.1)):

$$\frac{dx}{dt} \propto D \frac{c}{x}$$

where  $D$  is the diffusion coefficient. Integrating with respect to time gives

$$x^2 = K_p t \tag{21.4}$$

where

$$K_p \propto c D_0 e^{-Q/\overline{RT}}. \tag{21.5}$$

This growth law has exactly the form of eqn. (21.2) and the kinetic constant is analogous to\* that of eqn. (21.3). This success lets us explain why some films are more protective than others: protective films are those with low diffusion coefficients – and thus high melting points. That is one reason why  $\text{Al}_2\text{O}_3$  protects aluminium,  $\text{Cr}_2\text{O}_3$  protects chromium and  $\text{SiO}_2$  protects silicon so well, whereas  $\text{Cu}_2\text{O}$  and even  $\text{FeO}$  (which have lower melting points) are less protective. But there is an additional reason: electrons must also pass through the film and these films are insulators (the electrical resistivity of  $\text{Al}_2\text{O}_3$  is  $10^9$  times greater than that of  $\text{FeO}$ ).

Although our simple oxide film model explains most of the experimental observations we have mentioned, it does not explain the linear laws. How, for example, can a material *lose* weight linearly when it oxidises as is sometimes observed (see Fig. 21.2)? Well, some oxides (e.g.  $\text{MoO}_3$ ,  $\text{WO}_3$ ) are very volatile. During oxidation of Mo and W at high temperature, the oxides evaporate as soon as they are formed, and offer no barrier at all to oxidation. Oxidation, therefore, proceeds at a rate that is independent of time, and the material loses weight because the oxide is *lost*. This behaviour explains the catastrophically rapid section loss of Mo and W shown in Table 21.2.

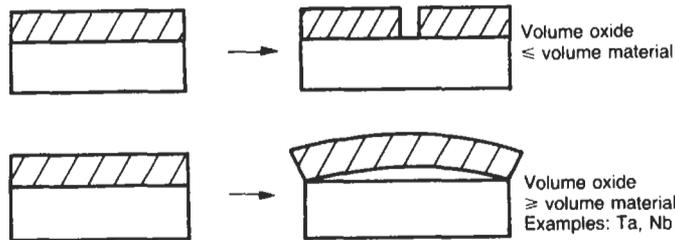


Fig. 21.5 Breakdown of oxide films, leading to linear oxidation behaviour.

The explanation of a linear weight *gain* is more complex. Basically, as the oxide film thickens, it develops cracks, or partly lifts away from the material, so that the barrier between material and oxide does not become any more effective as oxidation proceeds. Figure 21.5 shows how this can happen. If the volume of the oxide is much less than that of the material from which it is formed, it will crack to relieve the strain (oxide films are usually brittle). If the volume of the oxide is much greater, on the other hand, the oxide will tend to release the strain energy by breaking the adhesion between material and oxide, and springing away. For protection, then, we need an oxide skin which is neither too small and splits open (like the bark on a fir tree) nor one which is too big and wrinkles up (like the skin of a rhinoceros), but one which is just right. Then, and only then, do we get protective parabolic growth.

In the next chapter we use this understanding to analyse the design of oxidation-resistant materials.

---

\*It does not have the same value, however, because eqn. (21.5) refers to thickness gain and not *mass* gain: the two can be easily related if quantities like the density of the oxide are known.

## Further reading

- J. P. Chilton, *Principles of Metallic Corrosion*, 2nd edition. The Chemical Society, 1973, Chap. 2.  
M. G. Fontana and N. D. Greene, *Corrosion Engineering*, McGraw Hill, 1967, Chap. 11.  
J. C. Scully, *The Fundamentals of Corrosion*, 2nd edition, Pergamon Press, 1975, Chap. 1.  
O. Kubaschewski and B. E. Hopkins, *Oxidation of Metals and Alloys*, 2nd edition, Butterworths, 1962.  
Smithells' *Metals Reference Book*, 7th edition, Butterworth-Heinemann, 1992 (for data).

# Chapter 22

## Case studies in dry oxidation

---

### Introduction

In this chapter we look first at an important class of alloys designed to resist corrosion: the stainless steels. We then examine a more complicated problem: that of protecting the most advanced gas turbine blades from gas attack. The basic principle applicable to both cases is to coat the steel or the blade with a stable ceramic: usually  $\text{Cr}_2\text{O}_3$  or  $\text{Al}_2\text{O}_3$ . But the ways this is done differ widely. The most successful are those which produce a ceramic film which heals itself if damaged – as we shall now describe.

### CASE STUDY 1: MAKING STAINLESS ALLOYS

Mild steel is an excellent structural material – cheap, easily formed and strong mechanically. But at low temperatures it rusts, and at high, it oxidises rapidly. There is a demand, for applications ranging from kitchen sinks via chemical reactors to superheater tubes, for a corrosion-resistant steel. In response to this demand, a range of stainless irons and steels has been developed. When mild steel is exposed to hot air, it oxidises quickly to form FeO (or higher oxides). But if one of the elements near the top of Table 21.1 with a large energy of oxidation is dissolved in the steel, then this element oxidises preferentially (because it is much more stable than FeO), forming a layer of its oxide on the surface. And if this oxide is a protective one, like  $\text{Cr}_2\text{O}_3$ ,  $\text{Al}_2\text{O}_3$ ,  $\text{SiO}_2$  or  $\text{BeO}$ , it stifles further growth, and protects the steel.

A considerable quantity of this foreign element is needed to give adequate protection. The best is chromium, 18% of which gives a very protective oxide film: it cuts down the rate of attack at  $900^\circ\text{C}$ , for instance, by more than 100 times.

Other elements, when dissolved in steel, cut down the rate of oxidation, too.  $\text{Al}_2\text{O}_3$  and  $\text{SiO}_2$  both form in preference to FeO (Table 21.1) and form protective films (see Table 21.2). Thus 5% Al dissolved in steel decreases the oxidation rate by 30 times, and 5% Si by 20 times. The same principle can be used to impart corrosion resistance to other metals. We shall discuss nickel and cobalt in the next case study – they can be alloyed in this way. So, too, can copper; although it will not dissolve enough chromium to give a good  $\text{Cr}_2\text{O}_3$  film, it *will* dissolve enough aluminium, giving a range of stainless alloys called ‘aluminium bronzes’. Even silver can be prevented from tarnishing (reaction with sulphur) by alloying it with aluminium or silicon, giving protective  $\text{Al}_2\text{O}_3$  or  $\text{SiO}_2$  surface films. And archaeologists believe that the Delhi Pillar – an ornamental pillar of cast iron which has stood, uncorroded, for some hundreds of years in a *particularly* humid spot – survives because the iron has some 6% silicon in it.

Ceramics themselves are sometimes protected in this way. Silicon carbide, SiC, and silicon nitride, Si<sub>3</sub>N<sub>4</sub> both have large negative energies of oxidation (meaning that they oxidise easily). But when they do, the silicon in them turns to SiO<sub>2</sub> which quickly forms a protective skin and prevents further attack.

This protection-by-alloying has one great advantage over protection by a surface coating (like chromium plating or gold plating): it repairs itself when damaged. If the protective film is scored or abraded, fresh metal is exposed, and the chromium (or aluminium or silicon) it contains immediately oxidises, healing the break in the film.

## CASE STUDY 2: PROTECTING TURBINE BLADES

As we saw in Chapter 20, the materials at present used for turbine blades consist chiefly of nickel, with various foreign elements added to get the creep properties right. With the advent of DS blades, such alloys will normally operate around 950°C, which is close to  $0.7T_M$  for Ni (1208 K, 935°C). If we look at Table 21.2 we can see that at this temperature, nickel loses 0.1 mm of metal from its surface by oxidation in 600 hours. Now, the thickness of the metal between the outside of the blade and the integral cooling ports is about 1 mm, so that in 600 hours a blade would lose about 10% of its cross-section in service. This represents a serious loss in mechanical integrity and, moreover, makes no allowance for statistical variations in oxidation rate – which can be quite large – or for preferential oxidation (at grain boundaries, for example) leading to pitting. Because of the large cost of replacing a set of blades ( $\approx$ UK£25,000 or US\$38,000 per engine) they are expected to last for more than 5000 hours. Nickel oxidises with parabolic kinetics (eqn. (21.4)) so that, after a time  $t_2$ , the loss in section  $x_2$  is given by substituting our data into:

$$\frac{x_2}{x_1} = \left(\frac{t_2}{t_1}\right)^{\frac{1}{2}}$$

giving

$$x_2 = 0.1 \left(\frac{5000}{600}\right)^{\frac{1}{2}} = 0.29 \text{ mm.}$$

Obviously this sort of loss is not admissible, but how do we stop it?

Well, as we saw in Chapter 20, the alloys used for turbine blades contain large amounts of chromium, dissolved in solid solution in the nickel matrix. Now, if we look at our table of energies (Table 21.1) released when oxides are formed from materials, we see that the formation of Cr<sub>2</sub>O<sub>3</sub> releases much more energy (701 kJ mol<sup>-1</sup> of O<sub>2</sub>) than NiO (439 kJ mol<sup>-1</sup> of O<sub>2</sub>). This means that Cr<sub>2</sub>O<sub>3</sub> will form in *preference* to NiO on the surface of the alloy. Obviously, the more Cr there is in the alloy, the greater is the preference for Cr<sub>2</sub>O<sub>3</sub>. At the 20% level, enough Cr<sub>2</sub>O<sub>3</sub> forms on the surface of the turbine blade to make the material act a bit as though it were chromium.

Suppose for a moment that our material is chromium. Table 21.2 shows that Cr would lose 0.1 mm in 1600 hours at  $0.7T_M$ . Of course, we have forgotten about one

thing.  $0.7T_M$  for Cr is 1504 K (1231°C), whereas, as we have said, for Ni, it is 1208 K (935°C). We should, therefore, consider how  $\text{Cr}_2\text{O}_3$  would act as a barrier to oxidation at 1208 K rather than at 1504 K (Fig. 22.1). The oxidation of chromium follows parabolic kinetics with an activation energy of  $330 \text{ kJ mol}^{-1}$ . Then the ratio of the times required to remove 0.1 mm (from eqn. (21.3)) is

$$\frac{t_2}{t_1} = \frac{\exp - (Q/\overline{RT}_1)}{\exp - (Q/\overline{RT}_2)} = 0.65 \times 10^3.$$

Thus the time at 1208 K is

$$\begin{aligned} t_2 &= 0.65 \times 10^3 \times 1600 \text{ hours} \\ &= 1.04 \times 10^6 \text{ hours.} \end{aligned}$$

Now, as we have said, there is only at most 20% Cr in the alloy, and the alloy behaves only *partly* as if it were protected by  $\text{Cr}_2\text{O}_3$ . In fact, experimentally, we find that 20% Cr increases the time for a given metal loss by only about *ten* times, i.e. the time taken to lose 0.1 mm at blade working temperature becomes  $600 \times 10 \text{ hours} = 6000 \text{ hours}$  rather than  $10^6 \text{ hours}$ .

Why this large difference? Well, whenever you consider an *alloy* rather than a pure material, the oxide layer – whatever its nature ( $\text{NiO}$ ,  $\text{Cr}_2\text{O}_3$ , etc.) – has foreign elements contained in *it*, too. Some of these will greatly increase either the diffusion coefficients in, or electrical conductivity of, the layer, and make the rate of oxidation through the layer much more than it would be in the absence of foreign element contamination.

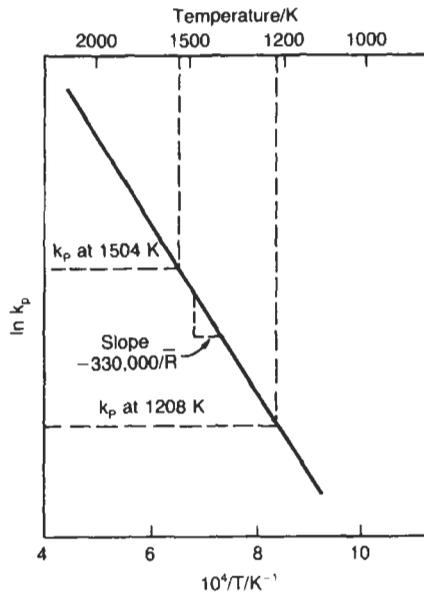


Fig. 22.1. The way in which  $k_p$  varies with temperature.

One therefore has to be very careful in transferring data on film protectiveness from a pure material to an alloyed one, but the approach does, nevertheless, give us an *idea* of what to expect. As in all oxidation work, however, experimental determinations on actual alloys are *essential* for working data.

This 0.1 mm loss in 6000 hours from a 20% Cr alloy at 935°C, though better than pure nickel, is still not good enough. What is worse, we saw in Chapter 20 that, to improve the creep properties, the quantity of Cr has been reduced to 10%, and the resulting oxide film is even less protective. The obvious way out of this problem is to *coat* the blades with a protective layer (Fig. 22.2). This is usually done by spraying molten droplets of aluminium on to the blade surface to form a layer, some microns thick. The blade is then heated in a furnace to allow the Al to diffuse into the surface of the Ni. During this process, some of the Al forms compounds such as AlNi with the nickel – which are themselves good barriers to oxidation of the Ni, whilst the rest of the Al becomes oxidised up to give  $\text{Al}_2\text{O}_3$  – which, as we can see from our oxidation-rate data – should be a very good barrier to oxidation even allowing for the high temperature ( $0.7T_M$  for Al = 653 K, 380°C). An incidental benefit of the relatively thick AlNi layer is its poor thermal conductivity – this helps insulate the metal of the cooled blade from the hot gases, and allows a slight extra increase in blade working temperature.

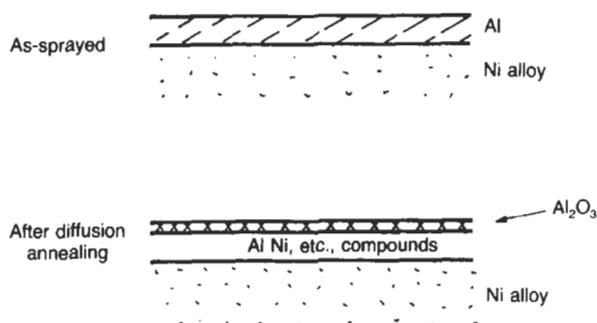


Fig. 22.2. Protection of turbine blades by sprayed-on aluminium.

Other coatings, though more difficult to apply, are even more attractive. AlNi is brittle, so there is a risk that it may chip off the blade surface exposing the unprotected metal. It is possible to diffusion-bond a layer of a Ni–Cr–Al alloy to the blade surface (by spraying on a powder or pressing on a thin sheet and then heating it up) to give a ductile coating which still forms a very protective film of oxide.

### Influence of coatings on mechanical properties

So far, we have been talking in our case study about the *advantage* of an oxide layer in reducing the rate of metal removal by oxidation. Oxide films do, however, have some *disadvantages*.

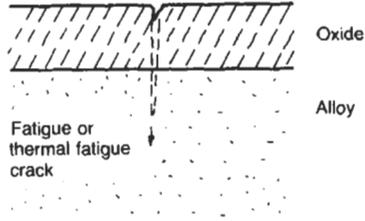


Fig. 22.3. Fatigue cracks can spread from coatings into the material itself.

Because oxides are usually quite brittle at the temperatures encountered on a turbine blade surface, they can crack, especially when the temperature of the blade changes and differential thermal contraction and expansion stresses are set up between alloy and oxide. These can act as ideal nucleation centres for thermal fatigue cracks and, because oxide layers in nickel alloys are stuck well to the underlying alloy (they would be useless if they were not), the crack can spread into the alloy itself (Fig. 22.3). The properties of the oxide film are thus very important in affecting the fatigue properties of the whole component.

#### Protecting future blade materials

What of the corrosion resistance of new turbine-blade alloys like DS eutectics? Well, an alloy like  $\text{Ni}_3\text{Al}-\text{Ni}_3\text{Nb}$  loses 0.05 mm of metal from its surface in 48 hours at the anticipated operating temperature of 1155°C for such alloys. This is obviously not a good performance, and coatings will be required before these materials are suitable for application. At lower oxidation rates, a more insidious effect takes place – preferential attack of one of the phases, with penetration along interphase boundaries. Obviously this type of attack, occurring under a break in the coating, can easily lead to fatigue failure and raises another problem in the use of DS eutectics.

You may be wondering why we did not mention the pure ‘refractory’ metals Nb, Ta, Mo, W in our chapter on turbine-blade materials (although we *did* show one of them on Fig. 20.7). These metals have very high melting temperatures, as shown, and should therefore have very good creep properties.

Nb	2740 K	} $T_M$ .
Ta	3250 K	
Mo	2880 K	
W	3680 K	

But they all oxidise very rapidly indeed (see Table 21.2), and are utterly useless without coatings. The problem with coated refractory metals is, that if a break occurs in the coating (e.g. by thermal fatigue, or erosion by dust particles, etc.), catastrophic oxidation of the underlying metal will take place, leading to rapid failure. The ‘unsafeness’ of this situation is a major problem that has to be solved before we can use these on-other-counts potentially excellent materials.

The ceramics SiC and Si<sub>3</sub>N<sub>4</sub> do not share this problem. They oxidise readily (Table 21.1); but in doing so, a surface film of SiO<sub>2</sub> forms which gives adequate protection up to 1300°C. And because the film forms by oxidation of the material itself, it is self-healing.

### Joining operations: a final note

One might imagine that it is always a good thing to have a protective oxide film on a material. Not always; if you wish to join materials by brazing or soldering, the protective oxide film can be a problem. It is this which makes stainless steel hard to braze and almost impossible to solder; even spot-welding and diffusion bonding become difficult. Protective films create poor electrical contacts; that is why aluminium is not more widely used as a conductor. And production of components by powder methods (which involve the compaction and sintering – really diffusion bonding – of the powdered material to the desired shape) is made difficult by protective surface films.

### Further reading

M. G. Fontana and N. D. Greene, *Corrosion Engineering*, McGraw Hill, 1967, Chap. 11.

D. R. Gabe, *Principles of Metal Surface Treatment and Protection*, 2nd edition, Pergamon Press, 1978.

# Chapter 23

## Wet corrosion of materials

---

### Introduction

In the last two chapters we showed that most materials that are unstable in oxygen tend to oxidise. We were principally concerned with loss of material at high temperatures, in dry environments, and found that, under these conditions, oxidation was usually controlled by the diffusion of ions or the conduction of electrons through oxide films that formed on the material surface (Fig. 23.1). Because of the thermally activated nature of the diffusion and reaction processes we saw that the rate of oxidation was much greater at high temperature than at low, although even at room temperature, very thin films of oxide *do* form on all unstable metals. This minute amount of oxidation is important: it protects, preventing further attack; it causes tarnishing; it makes joining difficult; and (as we shall see in Chapters 25 and 26) it helps keep sliding surfaces apart, and so influences the coefficient of friction. But the *loss* of material by oxidation at room temperature under these *dry* conditions is very slight.

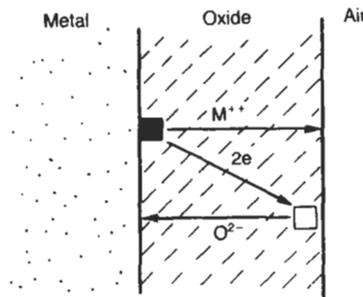


Fig. 23.1. Dry oxidation.

Under *wet* conditions, the picture is dramatically changed. When mild steel is exposed to oxygen and water at room temperature, it rusts rapidly and the loss of metal quickly becomes appreciable. Unless special precautions are taken, the life of most structures, from bicycles to bridges, from buckets to battleships, is limited by wet corrosion. The annual bill in the UK either replacing corroded components, or preventing corrosion (e.g. by painting the Forth Bridge), is around UK£4000 m or US\$6000 m a year.

## Wet corrosion

Why the dramatic effect of water on the rate of loss of material? As an example we shall look at *iron*, immersed in *aerated water* (Fig. 23.2).

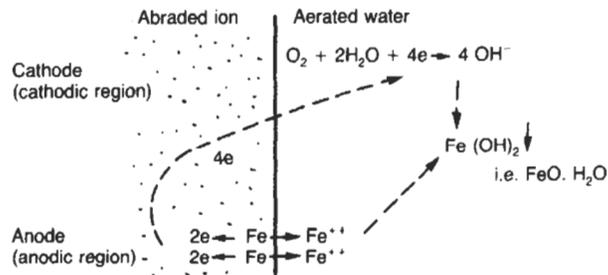


Fig. 23.2. Wet corrosion.

Iron atoms pass into solution in the water as  $\text{Fe}^{++}$ , leaving behind two electrons each (the *anodic* reaction). These are conducted through the metal to a place where the 'oxygen reduction' reaction can take place to consume the electrons (the *cathodic* reaction). This reaction generates  $\text{OH}^-$  ions which then combine with the  $\text{Fe}^{++}$  ions to form a *hydrated iron oxide*  $\text{Fe}(\text{OH})_2$  (really  $\text{FeO} \cdot \text{H}_2\text{O}$ ); but instead of forming on the surface where it might give some protection, it often forms as a precipitate in the water itself. The reaction can be summarised by



just as in the case of dry oxidation.

Now the formation and solution of  $\text{Fe}^{++}$  is analogous to the formation and diffusion of  $\text{M}^{++}$  in an oxide film under dry oxidation; and the formation of  $\text{OH}^-$  is closely similar to the reduction of oxygen on the surface of an oxide film. However, the much faster attack found in wet corrosion is due to the following:

- The  $\text{Fe}(\text{OH})_2$  either deposits *away* from the corroding material; or, if it deposits on the surface, it does so as a loose deposit, giving little or no protection.
- Consequently  $\text{M}^{++}$  and  $\text{OH}^-$  usually diffuse in the *liquid* state, and therefore do so very rapidly.
- In *conducting* materials, the electrons can move very easily as well.

The result is that the oxidation of iron in aerated water (rusting) goes on at a rate which is millions of times faster than that in dry air. Because of the importance of (c), wet oxidation is a particular problem with metals.

## Voltage differences as a driving force for wet oxidation

In dry oxidation we quantified the tendency for a material to oxidise in terms of the energy needed, in  $\text{kJ mol}^{-1}$  of  $\text{O}_2$ , to manufacture the oxide from the material and oxygen. Because wet oxidation involves electron flow in conductors, which is easier to measure, the tendency of a metal to oxidise in solution is described by using a *voltage* scale rather than an *energy* one.

Figure 23.3 shows the voltage differences that would just stop various metals oxidising in aerated water. As we should expect, the information in the figure is similar to that in our previous bar-chart (see Chapter 21) for the *energies* of oxidation. There are some differences in ranking, however, due to the differences between the detailed reactions that go on in dry and wet oxidation.

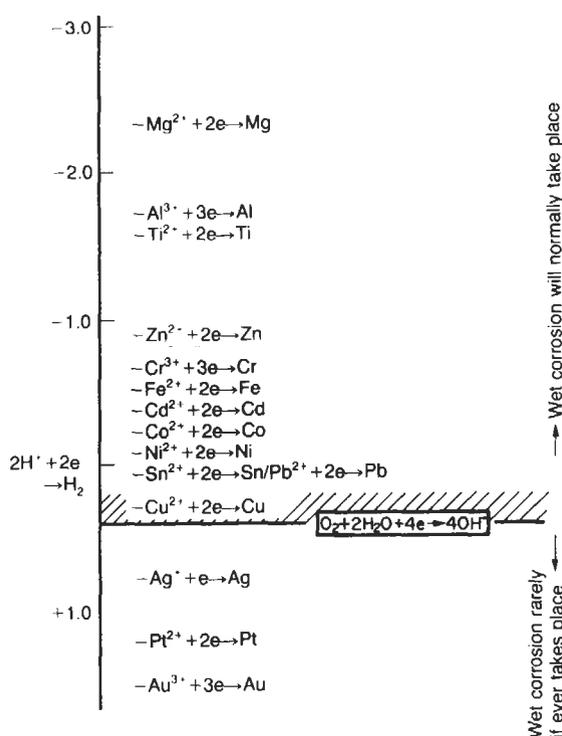


Fig. 23.3. Wet corrosion voltages (at 300 K).

What do these voltages mean? Suppose we could separate the cathodic and the anodic regions of a piece of iron, as shown in Fig. 23.4. Then at the cathode, oxygen is reduced to  $\text{OH}^-$ , absorbing electrons, and the metal therefore becomes positively charged. The reaction continues until the potential rises to +0.401 V. Then the coulombic attraction between the +ve charged metal and the -ve charged  $\text{OH}^-$  ion becomes so large that the  $\text{OH}^-$  is pulled back to the surface, and reconverted to  $\text{H}_2\text{O}$  and  $\text{O}_2$ ; in

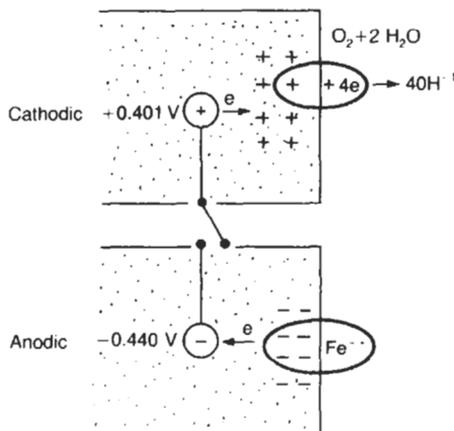


Fig. 23.4. The voltages that drive wet corrosion.

other words, the reaction stops. At the anode,  $\text{Fe}^{2+}$  forms, leaving electrons behind in the metal which acquires a negative charge. When its potential falls to  $-0.440\text{ V}$ , that reaction, too, stops (for the same reason as before). If the anode and cathode are now *connected*, electrons flow from the one to the other, the potentials fall, and both reactions start up again. The difference in voltage of  $0.841\text{ V}$  is the driving potential for the oxidation reaction. The bigger it is, the bigger the tendency to oxidise.

Now a note of caution about how to interpret the voltages. For convenience, the voltages given in reference books always relate to ions having certain specific concentrations (called 'unit activity' concentrations). These concentrations are high – and make it rather hard for the metals to dissolve (Fig. 23.5). In dilute solutions, metals can corrode more easily, and this sort of effect tends to move the voltage values around by up to  $0.1\text{ V}$  or more for some metals. The important thing about the voltage figures given therefore is that they are only a *guide* to the driving forces for wet oxidation.

Obviously, it is not very easy to measure voltage variations *inside* a piece of iron, but we can artificially transport the 'oxygen-reduction reaction' away from the metal by using a piece of metal that does not normally undergo wet oxidation (e.g. platinum) and which serves merely as a *cathode* for the oxygen-reduction reaction.

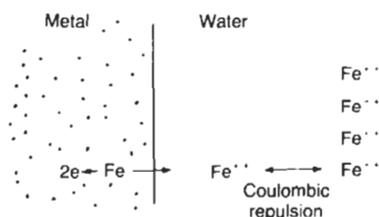


Fig. 23.5. Corrosion takes place less easily in concentrated solution.

The corrosion voltages of Fig. 23.3 also tell you what will happen when two *dissimilar* metals are joined together and immersed in water. If copper is joined to zinc, for instance, the zinc has a larger corrosion voltage than the copper. The zinc therefore becomes the anode, and is attacked; the copper becomes the cathode, where the oxygen reaction takes place, and it is unattacked. Such *couples* of dissimilar metals can be dangerous: the attack at the anode is sometimes very rapid, as we shall see in the next chapter.

## Rates of wet oxidation

As one might expect on the basis of what we said in the chapters on dry oxidation, the rates of wet oxidation found in practice bear little relationship to the voltage driving forces for wet oxidation, provided these are such that the metal is prone to corrosion in the first place. To take some examples, the approximate surface losses of some metals in mm per year in clean water are shown on Fig. 23.6. They are almost the reverse of the order expected in terms of the voltage driving forces for wet oxidation. The slow rate of wet oxidation for Al, for example, arises because it is very difficult to prevent a thin, dry oxidation film of  $\text{Al}_2\text{O}_3$  forming on the metal surface. In *sea* water, on the other hand, Al corrodes very rapidly because the chloride ions tend to break down the protective  $\text{Al}_2\text{O}_3$  film. Because of the effect of 'foreign' ions like this in most practical environments, corrosion rates vary very widely indeed for most materials. Materials Handbooks often list rough figures of the wet oxidation resistance of metals and alloys in various environments (ranging from beer to sewage!).

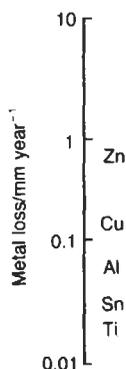


Fig. 23.6. Corrosion rates of some metals in clean water.

## Localised attack: corrosion cracking

It is often found that wet corrosion attacks metals *selectively* as well as, or instead of, uniformly, and this can lead to component failure *much* more rapidly and insidiously than one might infer from average corrosion rates (Fig. 23.7). Stress and corrosion

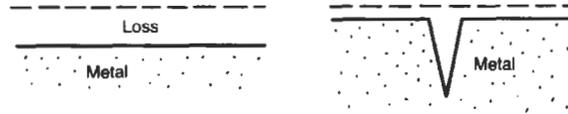


Fig. 23.7. Localised attack.

acting together can be particularly bad, giving cracks which propagate rapidly and unexpectedly. Four types of corrosion cracking commonly lead to unplanned failures. These are:

#### (a) Stress corrosion cracking

In some materials and environments, cracks grow steadily under a constant stress intensity  $K$  which is much less than  $K_c$  (Fig. 23.8). This is obviously dangerous: a structure which is safe when built can become unsafe with time. Examples are brass in ammonia, mild steel in caustic soda, and some Al and Ti alloys in salt water.

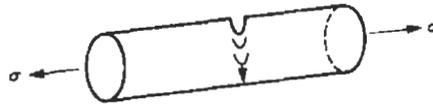


Fig. 23.8. Stress corrosion cracking.

#### (b) Corrosion fatigue

Corrosion increases the rate of growth of fatigue cracks in most metals and alloys, e.g. the stress to give  $N_f = 5 \times 10^7$  cycles decreases by 4 times in salt water for many steels (Fig. 23.9). The crack growth rate is larger – often much larger – than the sum of the rates of corrosion and fatigue, each acting alone.

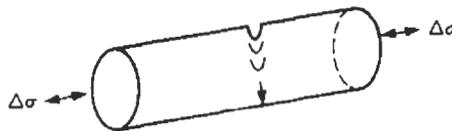


Fig. 23.9. Corrosion fatigue.

#### (c) Intergranular attack

Grain boundaries have different corrosion properties from the grain and may corrode preferentially, giving cracks that then propagate by stress corrosion or corrosion fatigue (Fig. 23.10).

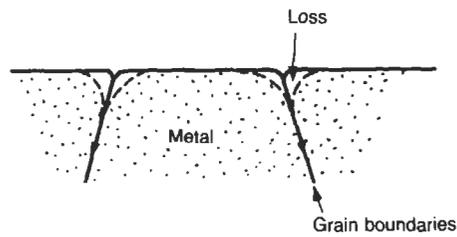


Fig. 23.10. Intergranular attack.

#### (d) Pitting

Preferential attack can also occur at breaks in the oxide film (caused by abrasion), or at precipitated compounds in certain alloys (Fig. 23.11).

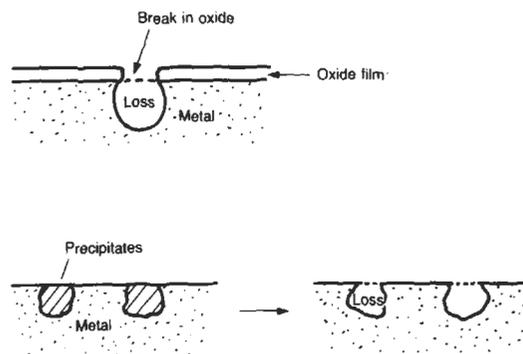


Fig. 23.11. Pitting corrosion.

To summarise, unexpected corrosion failures are much more likely to occur by localised attack than by uniform attack (which can easily be detected); and although corrosion handbooks are useful for making initial choices of materials for applications where corrosion is important, critical components must be checked for life-to-fracture in closely controlled experiments resembling the actual environment as nearly as possible.

In the next chapter we shall look at some case studies in corrosion-resistant designs which are based on the ideas we have just discussed.

#### Further reading

- J. P. Chilton, *Principles of Metallic Corrosion*, 2nd edition, The Chemical Society, 1973, Chap. 3.
- M. G. Fontana and N. D. Greene, *Corrosion Engineering*, McGraw Hill, 1967, Chaps. 2 and 3.
- J. C. Scully, *The Fundamentals of Corrosion*, 2nd edition, Pergamon Press, 1975, Chap. 2.
- Smithells' *Metals Reference Book*, 7th edition, Butterworth-Heinemann, 1992 (for data).
- ASM *Metals Handbook*, 10th edition, ASM International, 1990 (for data).

# Chapter 24

## Case studies in wet corrosion


---

### Introduction

We now examine three real corrosion problems: the protection of pipelines, the selection of a material for a factory roof, and materials for car exhaust systems. The rusting of iron appears in all three case studies, but the best way of overcoming it differs in each. Sometimes the best thing is to change to a new material which does not rust; but often economics prevent this, and ways must be found to slow down or stop the rusting reaction.

### CASE STUDY 1: THE PROTECTION OF UNDERGROUND PIPES

Many thousands of miles of steel pipeline have been laid under, or in contact with, the ground for the long-distance transport of oil, natural gas, etc. Obviously corrosion is a problem if the ground is at all damp, as it usually will be, and if the depth of soil is not so great that oxygen is effectively excluded. Then the oxygen reduction reaction

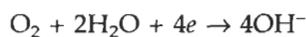

and the metal-corroding reaction




can take place, causing the pipe to corrode. Because of the capital cost of pipelines, their inaccessibility if buried, the disruption to supplies caused by renewal, and the potentially catastrophic consequences of undetected corrosion failure, it is obviously very important to make sure that pipelines do not corrode. How is this done?

One obvious way of protecting the pipe is by covering it with some inert material to keep water and oxygen out: thick polyethylene sheet stuck in position with a butyl glue, for example. The end sections of the pipes are left uncovered ready for welding – and the welds are subsequently covered on site. However, such coverings rarely provide complete protection – rough handling on site frequently leads to breakages of the film, and careless wrapping of welds leaves metal exposed. What can we do to prevent localised attack at such points?


### Sacrificial protection

If the pipe is connected to a slab of material which has a more negative corrosion voltage (Fig. 24.1), then the couple forms an electrolytic cell. As explained in Chapter 23, the more electronegative material becomes the anode (and dissolves), and the pipe becomes the cathode (and is protected).

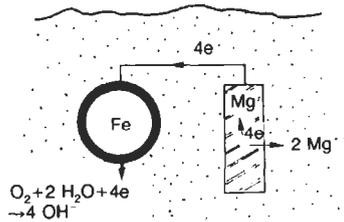

**Fig. 24.1.** Sacrificial protection of pipelines. Typical materials used are Mg (with 6% Al, 3% Zn, 0.2% Mn), Al (with 5% Zn) and Zn.

As Fig. 24.1 shows, pipelines are protected from corrosion by being wired to anodes in just this way. Magnesium alloy is often used because its corrosion voltage is very low (much lower than that of zinc) and this attracts  $Fe^{++}$  to the steel very strongly; but aluminium alloys and zinc are used widely too. The alloying additions help prevent the formation of a protective oxide on the anode – which might make it become cathodic. With some metals in particular environments (e.g. titanium in sea water) the nature of the oxide film is such that it effectively prevents metal passing through the film into solution. Then, although titanium is very negative with respect to iron (see Fig. 23.3), it fails to protect the pipeline (Fig. 24.2). Complications like this can also affect other metals (e.g. Al, Cd, Zn) although generally to a much smaller extent. *This sort of behaviour is another reason for our earlier warning that corrosion voltage are only general guides to corrosion behaviour* – again, experimental work is usually a necessary prelude to design against corrosion.

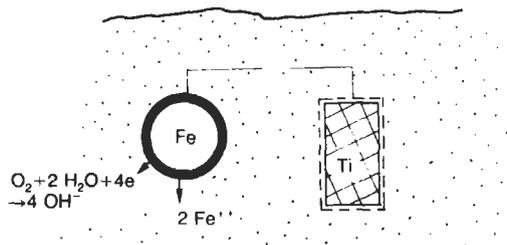

**Fig. 24.2.** Some sacrificial materials do not work because they carry a 'passivating' oxide layer.

Naturally, because the protection depends on the dissolution of the anodes, these require replacement from time to time (hence the term 'sacrificial' anodes). In order to minimise the loss of anode metal, it is important to have as good a barrier layer around the pipe as possible, even though the pipe would still be protected with no barrier layer at all.

#### Protection by imposing a potential

An alternative way of protecting the pipe is shown on Fig. 24.3. Scrap steel is buried near the pipe and connected to it through a battery or d.c. power supply, which

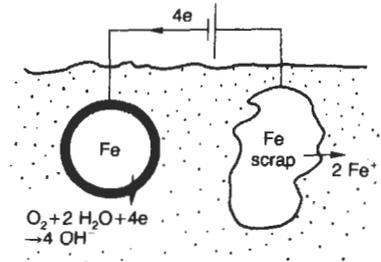


Fig. 24.3. Protection of pipelines by imposed potential.

maintains a sufficient potential difference between them to make sure that the scrap is always the anode and the pipe the cathode (it takes roughly the corrosion potential of iron – a little under 1 volt). This alone will protect the pipe, but unless the pipe is coated, a large current will be needed to maintain this potential difference.

### Alternative materials

Cost rules out almost all alternative materials for long-distance pipe lines: it is much cheaper to build and protect a mild steel pipe than to use stainless steel instead – even though no protection is then needed. The only competing material is a polymer, which is completely immune to wet corrosion of this kind. City gas mains are now being replaced by polymeric ones; but for large diameter transmission lines, the mechanical strength of steel makes it the preferred choice.

## CASE STUDY 2: MATERIALS FOR A LIGHTWEIGHT FACTORY ROOF

Let us now look at the corrosion problems that are involved in selecting a material for the lightweight roof of a small factory. Nine out of ten people asked to make a selection would think first of corrugated, *galvanised steel*. This is strong, light, cheap and easy to install. Where's the catch? Well, fairly new galvanised steel is rust-free, but after 20 to 30 years, rusting sets in and the roof eventually fails.

How does galvanising work? As Fig. 24.4 shows, the galvanising process leaves a thin layer of zinc on the surface of the steel. This acts as a barrier between the steel and the atmosphere; and although the driving voltage for the corrosion of zinc is greater than that for steel (see Fig. 23.3) in fact zinc corrodes quite slowly in a normal urban atmosphere because of the barrier effect of its oxide film. The loss in thickness is typically 0.1 mm in 20 years.

If scratches and breaks occur in the zinc layers by accidental damage – which is certain to occur when the sheets are erected – then the zinc will cathodically protect the iron (see Fig. 24.4) in exactly the way that pipelines are protected using zinc anodes. This explains the long postponement of rusting. But the coating is only about 0.15 mm thick, so after about 30 years most of the zinc has gone, rusting suddenly becomes chronic, and the roof fails.

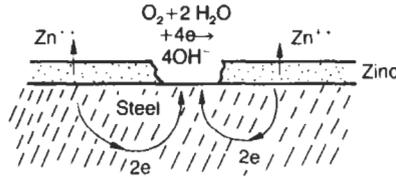


Fig. 24.4. Galvanised steel is protected by a sacrificial layer of zinc.

At first sight, the answer would seem to be to increase the thickness of the zinc layer. This is not easily done, however, because the hot dipping process used for galvanising is not sufficiently adjustable; and electroplating the zinc onto the steel sheet increases the production cost considerably. Painting the sheet (for example, with a bituminous paint) helps to reduce the loss of zinc considerably, but at the same time should vastly decrease the area available for the cathodic protection of the steel; and if a scratch penetrates both the paint and the zinc, the exposed steel may corrode through much more quickly than before.

#### Alternative materials

A relatively recent innovation has been the architectural use of *anodised aluminium*. Although the driving force for the wet oxidation of aluminium is very large, aluminium corrodes very slowly in fresh-water environments because it carries a very adherent film of the poorly conducting  $\text{Al}_2\text{O}_3$ . In anodised aluminium, the  $\text{Al}_2\text{O}_3$  film is artificially thickened in order to make this barrier to corrosion extremely effective. In the anodising process, the aluminium part is put into water containing various additives to promote compact film growth (e.g. boric acid). It is then made positive electrically which attracts the oxygen atoms in the polar water molecules (see Chapter 4). The attached oxygen atoms react continuously with the metal to give a thickened oxide film as shown on Fig. 24.5. The film can be coloured for aesthetic purposes by adding colouring agents towards the end of the process and changing the composition of the bath to allow the colouring agents to be incorporated.

Finally, what of polymeric materials? Corrugated plastic sheet is commonly used for roofing small sheds, car ports and similar buildings; but although polymers do not

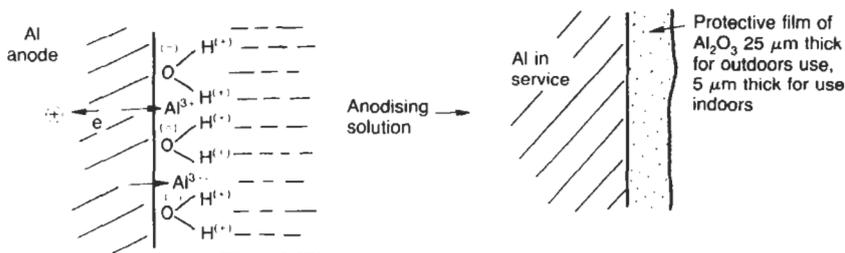


Fig. 24.5. Protecting aluminium by anodising it.

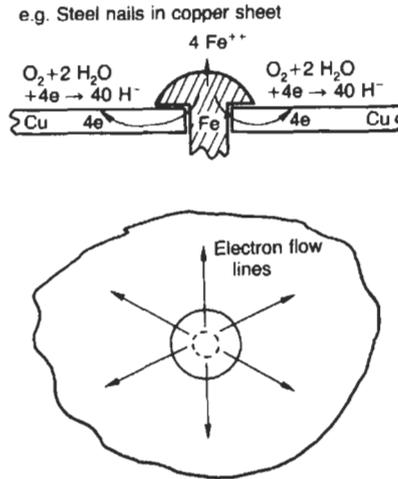


Fig. 24.6. Large cathodes can lead to very rapid corrosion.

generally corrode – they are often used in nasty environments like chemical plant – they *are* prone to damage by the ultraviolet wavelengths of the sun's radiation. These high-energy photons, acting over a period of time, gradually break up the molecular chains in the polymer and degrade its mechanical properties.

A note of caution about roof fasteners. A common mistake is to fix a galvanised or aluminium roof in place with nails or screws of a *different* metal: copper or brass, for instance. The copper acts as cathode, and the zinc or aluminium corrodes away rapidly near to the fastening. A similar sort of goof has been known to occur when copper roofing sheet has been secured with steel nails. As Fig. 24.6 shows, this sort of situation leads to catastrophically rapid corrosion not only because the iron is anodic, but because it is so easy for the electrons generated by the anodic corrosion to get away to the large copper cathode.

### CASE STUDY 3: AUTOMOBILE EXHAUST SYSTEMS

The lifetime of a conventional exhaust system on an average family car is only 2 years or so. This is hardly surprising – mild steel is the usual material and, as we have shown, it is not noted for its corrosion resistance. The interior of the system is not painted and begins to corrode immediately in the damp exhaust gases from the engine. The single coat of cheap cosmetic paint soon falls off the outside and rusting starts there, too, aided by the chloride ions from road salt, which help break down the iron oxide film.

The lifetime of the exhaust system could be improved by galvanising the steel to begin with. But there are problems in using platings where steel has to be joined by *welding*. Zinc, for example, melts at 420°C and would be burnt off the welds; and breaks would still occur if plating metals of higher melting point (e.g. Ni, 1455°C) were used.

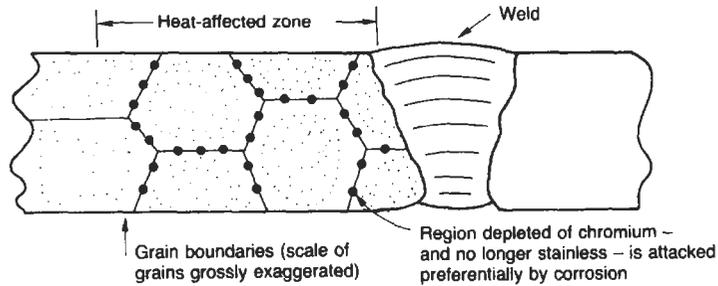


Fig. 24.7. Weld decay in stainless steel.

Occasionally manufacturers fit chromium-plated exhaust systems but this is for appearance only: if the plating is done before welding, the welds are unprotected and will corrode quickly; and if it is done after welding, the interior of the system is unplated and will corrode.

### Alternative materials

The most successful way of combating exhaust-system corrosion is, in fact, stainless steel. This is a good example of how – just as with dry oxidation – the addition of foreign atoms to a metal can produce stable oxide films that act as barriers to corrosion. In the case of stainless steel, Cr is dissolved in the steel in solid solution, and  $\text{Cr}_2\text{O}_3$  forms on the surface of the steel to act as a corrosion barrier.

There is one major pitfall which must be avoided in using stainless-steel components joined by welding: it is known as *weld decay*. It is sometimes found that the *heat-affected zone* – the metal next to the weld which got hot but did not melt – corrodes badly.

Figure 24.7 explains why. All steels contain carbon – for their mechanical properties – and this carbon can ‘soak up’ chromium (at grain boundaries in particular) to form precipitates of the compound *chromium carbide*. Because the regions near the grain boundaries lose most of their chromium in this way, they are no longer protected by  $\text{Cr}_2\text{O}_3$ , and corrode badly. The cure is to *stabilise* the stainless steel by adding Ti or Nb which soaks up the carbon near the grain boundaries.

### Further reading

- M. G. Fontana and N. D. Greene, *Corrosion Engineering*, McGraw Hill, 1967.  
 D. R. Gabe, *Principles of Metal Surface Treatment and Protection*, 2nd edition, Pergamon Press, 1978.  
 R. D. Barer and B. F. Peters, *Why Metals Fail*, Gordon & Breach, 1970.  
*ASM Metals Handbook*, 10th edition, ASM International, 1990.



## **G. Friction, abrasion and wear**

---



# Chapter 25

## Friction and wear

---

### Introduction

We now come to the final properties that we shall be looking at in this book on engineering materials: the frictional properties of materials in contact, and the wear that results when such contacts slide. This is of considerable importance in mechanical design. Frictional forces are undesirable in bearings because of the power they waste; and wear is bad because it leads to poor working tolerances, and, ultimately, to failure. On the other hand, when selecting materials for clutch and brake linings – or even for the soles of shoes – we aim to maximise friction but still to minimise wear, for obvious reasons. But wear is not always bad: in operations such as grinding and polishing, we try to achieve maximum wear with the minimum of energy expended in friction; and without wear you couldn't write with chalk on a blackboard, or with a pencil on paper. In this chapter and the next we shall examine the origins of friction and wear and then explore case studies which illustrate the influence of friction and wear on component design.

### Friction between materials

As you know, when two materials are placed in contact, any attempt to cause one of the materials to slide over the other is resisted by a *friction force* (Fig. 25.1). The force that will just cause sliding to start,  $F_s$ , is related to the force  $P$  acting normal to the contact surface by

$$F_s = \mu_s P \quad (25.1)$$

where  $\mu_s$  is the *coefficient of static friction*. Once sliding starts, the limiting frictional force decreases slightly and we can write

$$F_k = \mu_k P \quad (25.2)$$

where  $\mu_k (< \mu_s)$  is the *coefficient of kinetic friction* (Fig. 25.1). The work done in sliding against kinetic friction appears as *heat*.

These results at first sight run counter to our intuition – how is it that the friction between two surfaces can depend only on the *force*  $P$  pressing them together and not on their area? In order to understand this behaviour, we must first look at the geometry of a typical surface.

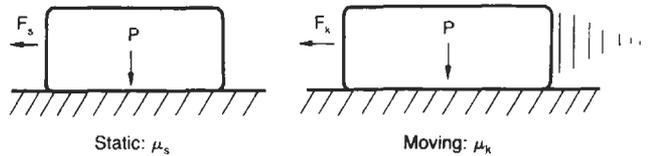


Fig. 25.1. Static and kinetic coefficients of friction.

If the surface of a fine-turned bar of copper is examined by making an oblique slice through it (a 'taper section' which magnifies the height of any asperities), or if its profile is measured with a 'Talysurf' (a device like a gramophone pick-up which, when run across a surface, plots out the hills and valleys), it is found that the surface looks like Fig. 25.2. The figure shows a large number of projections or *asperities* – it looks rather like a cross-section through Switzerland. If the metal is abraded with the finest abrasive paper, the scale of the asperities decreases but they are still there – just smaller. Even if the surface is polished for a long time using the finest type of metal polish, micro-asperities still survive.

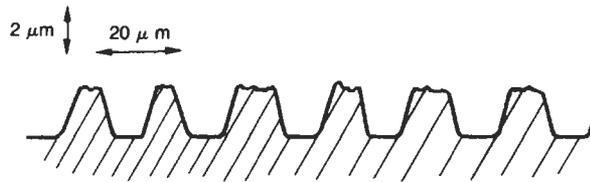


Fig. 25.2. What a finely machined metal surface looks like at high magnification (the heights of the asperities are plotted on a much more exaggerated scale than the lateral distances between asperities).

So it follows that, if two surfaces are placed in contact, no matter how carefully they have been machined and polished, they will contact only at the occasional points where one set of asperities meets the other. It is rather like turning Austria upside down and putting it on top of Switzerland. The load pressing the surfaces together is supported solely by the contacting asperities. The *real* area of contact,  $a$ , is very small and because of this the stress  $P/a$  (load/area) on each asperity is very large.


Initially, at very low loads, the asperities deform elastically where they touch. However, for realistic loads, the high stress causes extensive *plastic* deformation at the tips of asperities. If each asperity yields, forming a junction with its partner, the total load transmitted across the surface (Fig. 25.3) is

$$P \approx a\sigma_y \quad (25.3)$$

where  $\sigma_y$  is the compressive yield stress. In other words, the real area of contact is given by

$$a \approx \frac{P}{\sigma_y} \quad (25.4)$$

Obviously, if we double  $P$  we double the real area of contact,  $a$ .

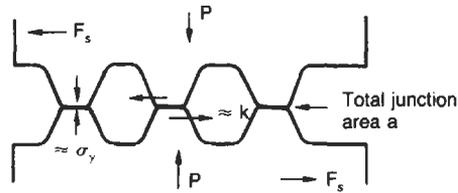

**Fig. 25.3.** The real contact area between surfaces is less than it appears to be, because the surfaces touch only where asperities meet.

Let us now look at how this contact geometry influences friction. If you attempt to slide one of the surfaces over the other, a shear stress  $F_s/a$  appears at the asperities. The shear stress is greatest where the cross-sectional area of asperities is least, that is, at or very near the contact plane. Now, the intense plastic deformation in the regions of contact presses the asperity tips together so well that there is atom-to-atom contact across the junction. The junction, therefore, can withstand a shear stress as large as  $k$  approximately, where  $k$  is the shear-yield strength of the material (Chapter 11).

The asperities will give way, allowing sliding, when

$$\frac{F_s}{a} \geq k$$

or, since  $k \approx \sigma_y/2$ , when

$$F_s \approx ak \approx a\sigma_y/2 \quad (25.5)$$

Combining this with eqn. (25.3), we have

$$F_s \approx \frac{P}{2}. \quad (25.6)$$

This is just the empirical eqn. (25.1) we started with, with  $\mu_s \approx 1/2$ , but this time it is not empirical – we derived it from a model of the sliding process. The value  $\mu_s \approx 1/2$  is close to the value of coefficients of static friction between unlubricated metal, ceramic and glass surfaces – a considerable success.

How do we explain the lower value of  $\mu_k$ ? Well, once the surfaces are sliding, there is less *time* available for atom-to-atom bonding at the asperity junctions than when the surfaces are in static contact, and the contact area over which shearing needs to take place is correspondingly reduced. As soon as sliding stops, creep allows the contacts to grow a little, and diffusion allows the bond there to become stronger, and  $\mu$  rises again to  $\mu_s$ .

## Data for coefficients of friction

If *metal* surfaces are thoroughly cleaned in vacuum it is almost impossible to slide them over each other. Any shearing force causes further plasticity at the junctions, which quickly grow, leading to complete seizure ( $\mu > 5$ ). This is a problem in outer space, and

in atmospheres (e.g.  $H_2$ ) which remove any surface films from the metal. A little oxygen or  $H_2O$  greatly reduces  $\mu$  by creating an oxide film which prevents these large metallic junctions forming.

We said in Chapter 21 that all metals except gold have a layer, no matter how thin, of metal oxide on their surfaces. Experimentally, it is found that for some metals the junction between the oxide films formed at asperity tips is weaker in shear than the metal on which it grew (Fig. 25.4). In this case, sliding of the surfaces will take place in the thin oxide layer, at a stress less than in the metal itself, and lead to a corresponding reduction in  $\mu$  to a value between 0.5 and 1.5.

When soft metals slide over each other (e.g. lead on lead, Fig. 25.5) the junctions are weak but their area is large so  $\mu$  is large. When hard metals slide (e.g. steel on steel) the junctions are small, but they are strong, and again friction is large (Fig. 25.5). Many bearings are made of a thin film of a soft metal between two hard ones, giving weak junctions of small area. *White metal* bearings, for example, consist of soft alloys of lead or tin supported in a matrix of stronger phases; *bearing bronzes* consist of soft lead particles (which smear out to form the lubricating film) supported by a bronze matrix; and polymer-impregnated *porous bearings* are made by partly sintering copper with a polymer (usually PTFE) forced into its pores. Bearings like these are not designed to run dry – but if lubrication does break down, the soft component gives a coefficient of friction of 0.1 to 0.2 which may be low enough to prevent catastrophic overheating and seizure.

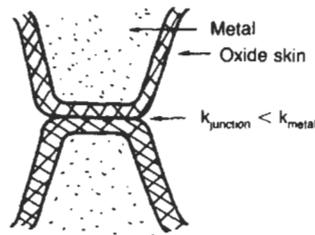


Fig. 25.4. Oxide-coated junctions can often slide more easily than ones which are clean.

When ceramics slide on ceramics (Fig. 25.5), friction is lower. Most ceramics are very hard – good for resisting wear – and, because they are stable in air and water (metals, except gold, are not genuinely stable, even if they appear so) – they have less tendency to bond, and shear more easily.

When metals slide on bulk polymers, friction is still caused by adhesive junctions, transferring a film of polymer to the metal. And any plastic flow tends to orient the polymer chains parallel to the sliding surface, and in this orientation they shear easily, so  $\mu$  is low – 0.05 to 0.5 (Fig. 25.5). Polymers make attractive low-friction bearings, although they have some: polymer molecules peel easily off the sliding surface, so wear is heavy; and because creep allows junction growth when the slider is stationary, the coefficient of static friction,  $\mu_s$ , is sometimes much larger than that for sliding friction,  $\mu_k$ .

Composites can be designed to have high friction (brake linings) or low friction (PTFE/bronze/lead bearings), as shown in Fig. 25.5. More of this presently.

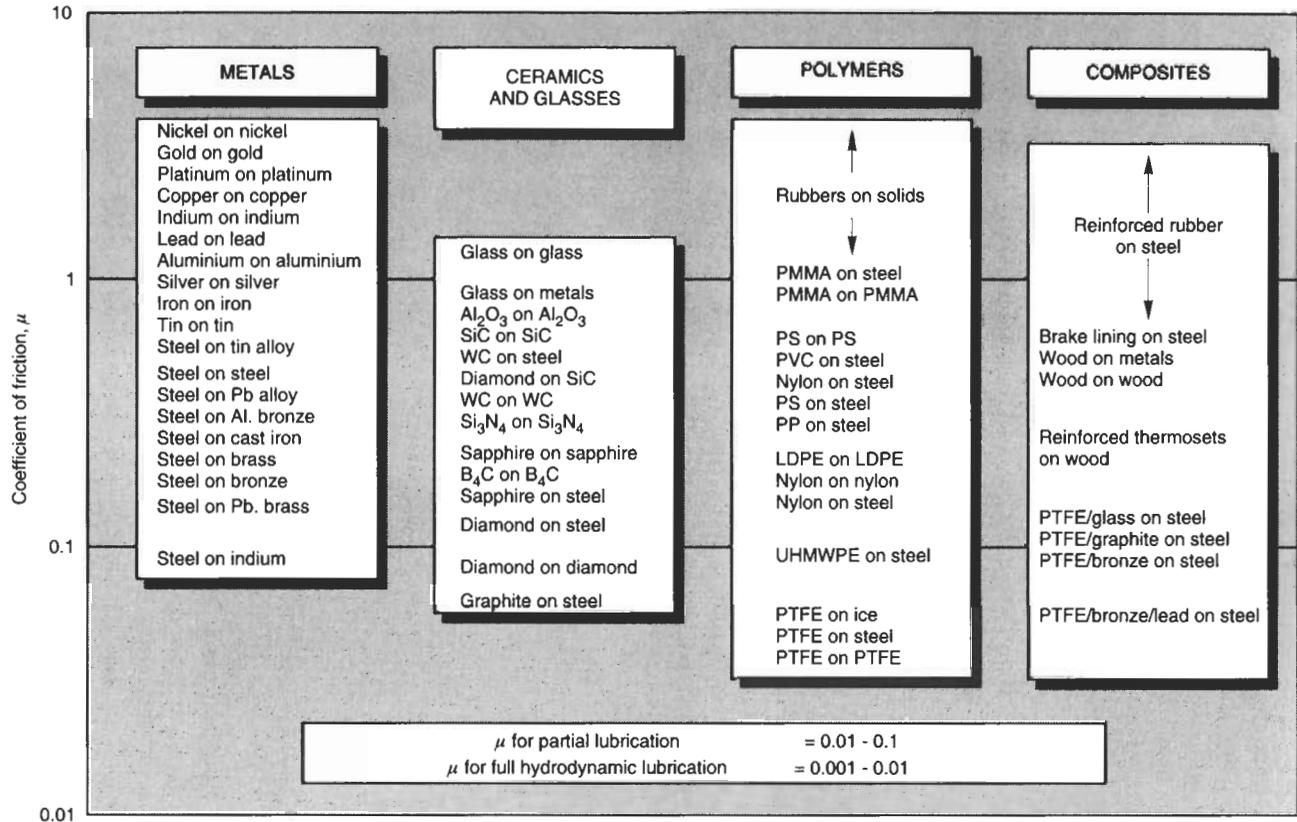


Fig. 25.5. Bar chart showing the coefficient of static friction for various material considerations.

## Lubrication

As we said in the introduction, friction absorbs a lot of work in machinery and as well as wasting power, this work is mainly converted to heat at the sliding surfaces, which can damage and even melt the bearing. In order to minimise frictional forces we need to make it as easy as possible for surfaces to slide over one another. The obvious way to try to do this is to contaminate the asperity tips with something that: (a) can stand the pressure at the bearing surface and so prevent atom-to-atom contact between asperities; (b) can itself shear easily.

Polymers and soft metal, as we have said, can do this; but we would like a much larger reduction in  $\mu$  than these can give, and then we must use *lubricants*. The standard lubricants are oils, greases and fatty materials such as soap and animal fats. These 'contaminate' the surfaces, preventing adhesion, and the thin layer of oil or grease shears easily, obviously lowering the coefficient of friction. What is *not* so obvious is why the very fluid oil is not squeezed out from between the asperities by the enormous pressures generated there. One reason is that oils nowadays have added to them small amounts ( $\approx 1\%$ ) of active organic molecules. One end of each molecule reacts with the metal oxide surface and sticks to it, while the other attracts one another to form an oriented 'forest' of molecules (Fig. 25.6), rather like mould on cheese. These forests can resist very large forces normal to the surface (and hence separate the asperity tips very effectively) while the two layers of molecules can shear over each other quite easily. This type of lubrication is termed *partial or boundary lubrication*, and is capable of reducing  $\mu$  by a factor of 10 (Fig. 25.5). *Hydrodynamic lubrication* is even more effective: we shall discuss it in the next chapter.

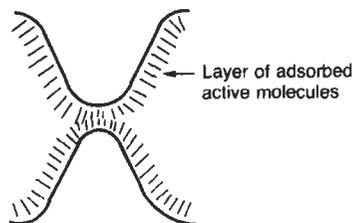


Fig. 25.6. Boundary lubrication.

Even the best boundary lubricants cease to work above about  $200^{\circ}\text{C}$ . Soft metal bearings like those described above can cope with *local* hot spots: the soft metal melts and provides a local lubricating film. But when the entire bearing is designed to run hot, special lubricants are needed. The best are a suspension of PTFE in special oils (good to  $320^{\circ}\text{C}$ ); graphite (good to  $600^{\circ}\text{C}$ ); and molybdenum disulphide (good to  $800^{\circ}\text{C}$ ).

## Wear of materials

Even when solid surfaces are protected by oxide films and boundary lubricants, some solid-to-solid contact occurs at regions where the oxide film breaks down under

mechanical loading, and adsorption of active boundary lubricants is poor. This intimate contact will generally lead to *wear*. Wear is normally divided into two main types: *adhesive wear* and *abrasive wear*.

### Adhesive wear

Figure 25.7 shows that, if the adhesion between A atoms and B atoms is good enough, wear fragments will be removed from the softer material A. If materials A and B are the same, wear takes place from *both* surfaces – the wear bits fall off and are lost or get trapped between the surfaces and cause further trouble (see below). The size of the bits depends on how far away from the junction the shearing takes place: if work-hardening extends well into the asperity, the tendency will be to produce large pieces. In order to minimise the *rate of wear* we obviously need to minimise the size of each piece removed. The obvious way to do this is to minimise the area of contact  $a$ . Since  $a \approx P/\sigma_y$ , reducing the loading on the surfaces will reduce the wear, as would seem intuitively obvious. Try it with chalk on a blackboard: the higher the pressure, the stronger the line (a wear track). The second way to reduce  $a$  is to increase  $\sigma_y$ , i.e. the *hardness*. This is why hard pencils write with a lighter line than soft pencils.

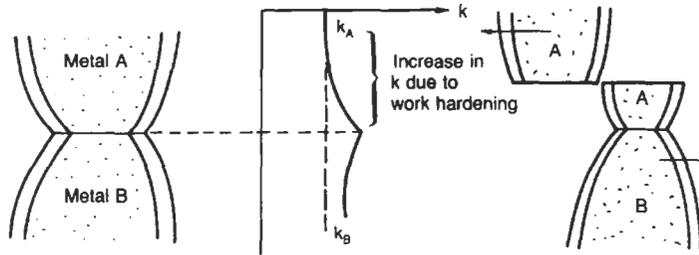


Fig. 25.7. Adhesive wear.

### Abrasive wear

Wear fragments produced by adhesive wear often become detached from their asperities during further sliding of the surfaces. Because oxygen is desirable in lubricants (to help maintain the oxide-film barrier between the sliding metals) these detached wear fragments can become oxidised to give hard oxide particles which *abrade* the surfaces in the way that sandpaper might.

Figure 25.8 shows how a hard material can 'plough' wear fragments from a softer material, producing severe abrasive wear. Abrasive wear is not, of course, confined to indigenous wear fragments, but can be caused by dirt particles (e.g. sand) making their way into the system, or – in an engine – by combustion products: that is why it is important to filter the oil.

Obviously, the rate of abrasive wear can be reduced by reducing the load – just as in a hardness test. The particle will dig less deeply into the metal, and plough a smaller

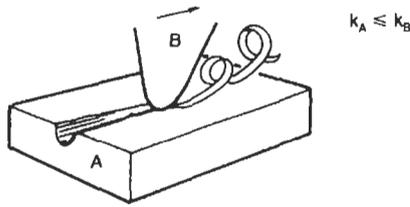


Fig. 25.8. Abrasive wear.

furrow. Increasing the hardness of the metal will have the same effect. Again, although abrasive wear is usually bad – as in machinery – we would find it difficult to sharpen lathe tools, or polish brass ornaments, or drill rock, without it.

### Surface and bulk properties

Many considerations enter the choice of material for a bearing. It must have bulk properties which meet the need to support loads and transmit heat fluxes. It must be processable: that is, capable of being shaped, finished and joined. It must meet certain economic criteria: limits on cost, availability and suchlike. If it can do all these things it must further have – or be given – necessary surface properties to minimise wear, and, when necessary, resist corrosion.

So, bearing materials are not chosen for their wear or friction properties (their ‘tribological’ properties) alone; they have to be considered in the framework of the overall design. One way forward is to choose a material with good bulk properties, and then customise the surface with exotic treatments or coatings. For the most part, it is the properties of the surface which determine tribological response, although the immediate subsurface region is obviously important because it supports the surface itself.

There are two general ways of tailoring surfaces. The aim of both is to increase the surface hardness, or to reduce friction, or all of these. The first is *surface treatment* involving only small changes to the chemistry of the surface. They exploit the increase in the hardness given by embedding foreign atoms in a thin surface layer: in carburising (carbon), nitriding (nitrogen) or boriding (boron) the surface is hardened by diffusing these elements into it from a gas, liquid or solid powder at high temperatures. Steels, which already contain carbon, can be surface-hardened by rapidly heating and then cooling their surfaces with a flame, an electron beam, or a laser. Elaborate though these processes sound, they are standard procedures, widely used, and to very good effect.

The second approach, that of *surface coating*, is more difficult, and that means more expensive. But it is often worth it. Hard, corrosion resistant layers of alloys rich in tungsten, cobalt, chromium or nickel can be sprayed onto surfaces, but a refinishing process is almost always necessary to restore the dimensional tolerances. Hard ceramic coatings such as  $\text{Al}_2\text{O}_3$ ,  $\text{Cr}_2\text{O}_3$ , TiC, or TiN can be deposited by plasma methods and these not only give wear resistance but resistance to oxidation and

other sorts of chemical attack as well. And – most exotic of all – it is now possible to deposit diamond (or something very like it) on to surfaces to protect them from almost anything.

Enough of this here. Surfaces resurface (as you might say) in the next chapter.

## Further reading

F. P. Bowden and D. Tabor, *Friction – An Introduction to Tribology*, Heinemann Science Study Series, No. 41, 1974.

F. P. Bowden and D. Tabor, *The Friction and Lubrication of Solids*, Oxford University Press, Part I, 1950; Part II, 1965.

A. D. Sarkar, *Wear of Metals*, Pergamon Press, 1976.

E. Rabinowicz, *Friction and Wear of Materials*, Wiley, 1965.

*Smithells' Metals Reference Book*, 7th edition, Butterworth-Heinemann, 1992.

I. M. Hutchings, *Tribology: Functions and Wear of Engineering Materials*, Edward Arnold, London 1992.

# Chapter 26

## Case studies in friction and wear

---

### Introduction

In this chapter we examine three quite different problems involving friction and wear. The first involves most of the factors that appeared in Chapter 25: it is that of a round shaft or journal rotating in a cylindrical bearing. This type of *journal bearing* is common in all types of rotating or reciprocating machinery: the crankshaft bearings of an automobile are good examples. The second is quite different: it involves the frictional properties of ice in the design of skis and sledge runners. The third case study introduces us to some of the frictional properties of polymers: the selection of rubbers for anti-skid tyres.

### CASE STUDY 1: THE DESIGN OF JOURNAL BEARINGS

In the proper functioning of a well-lubricated journal bearing, the frictional and wear properties of the materials are, suprisingly, irrelevant. This is because the mating surfaces never touch: they are kept apart by a thin pressurised film of oil formed under conditions of *hydrodynamic lubrication*. Figure 26.1 shows a cross-section of a bearing operating hydrodynamically. The load on the journal pushes the shaft to one side of the bearing, so that the working clearance is almost all concentrated on one side. Because oil is viscous, the revolving shaft drags oil around with it. The convergence of the oil stream towards the region of nearest approach of the mating surfaces causes an increase in the pressure of the oil film, and this pressure lifts the shaft away from the bearing surface. Pressures of 10 to 100 atmospheres are common under such conditions. Provided the oil is sufficiently viscous, the film at its thinnest region is still thick enough to cause complete separation of the mating surfaces. Under *ideal* hydrodynamic

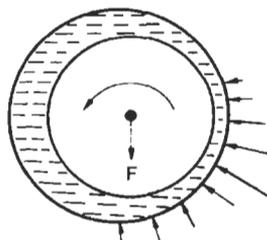


Fig. 26.1. Hydrodynamic lubrication.

conditions there is no asperity contact and no wear. Sliding of the mating surfaces takes place by shear in the liquid oil itself, giving coefficients of friction in the range 0.001 to 0.005.

Hydrodynamic lubrication is all very well when it functions properly. But real bearings contain dirt – hard particles of silica, usually – and new automobile engines are notorious for containing hard cast-iron dust from machining operations on the engine block. Then, if the particles are thicker than the oil film at its thinnest, abrasive wear will take place. There are two ways of solving this problem. One is to make the mating surfaces harder than the dirt particles. Crankshaft journals are ‘case-hardened’ by special chemical and heat treatments (Chapter 25) to increase the surface hardness to the level at which the dirt is abraded by the journal. (It is important not to harden the *whole* shaft because this will make it brittle and it might then break under shock loading.) However, the bearing surfaces are not hardened in this way; there are benefits in keeping them soft. First, if the bearing metal is soft enough, dirt particles will be pushed into the surface of the bearing and will be taken largely out of harm’s way. This property of bearing material is called *embeddability*. And, second, a bearing only operates under conditions of hydrodynamic lubrication when the rotational speed of the journal is high enough. When starting an engine up, or running slowly under high load, hydrodynamic lubrication is not present, and we have to fall back on *boundary lubrication* (see Chapter 25). Under these conditions some contact and wear of the mating surfaces will occur (this is why car engines last less well when used for short runs rather than long ones). Now crankshafts are difficult and expensive to replace when worn, whereas bearings can be designed to be cheap and easy to replace as shown on Fig. 26.2. It is thus good practice to concentrate as much of the wear as possible on the *bearing* – and, as we showed in our section on *adhesive wear* in the previous chapter, this is done by having a soft bearing material: lead, tin, zinc or alloys of these metals.

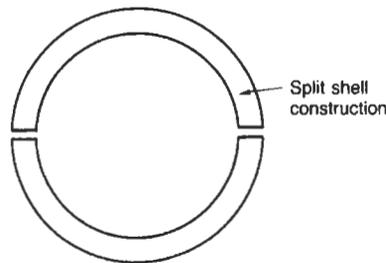


Fig. 26.2. Easily replaceable bearing shells.

Now for the snag of a soft bearing material – will it not fail to support the normal operating forces imposed on it by the crankshaft? All bearing materials have a certain ‘ $p - v$ ’ envelope within which they function safely (Fig. 26.3). The maximum pressure,  $p$ , that the bearing can accept is determined by the hardness of the surface; the maximum velocity,  $v$ , is determined by heating, and thus by the thermal conductivity

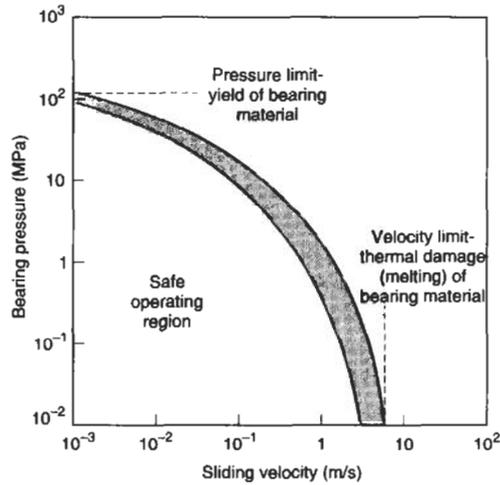


Fig. 26.3. The pressure - velocity envelope for a bearing material.


of the material of which the bearing is made. So, if nothing special were done to prevent it, a soft bearing would deform under the imposed pressure like putty. In practice, by making the layer of soft material *thin* and backing it with something much harder, this difficulty can be avoided.

The way it works is this. If you squeeze a slug of plasticine between two blocks of wood, the slug deforms easily at first, but as the plasticine layer gets thinner and thinner, more and more lateral flow is needed to make it spread, and the pressure required to cause this flow gets bigger and bigger. The plasticine is constrained by the blocks so that it can never be squeezed out altogether – that would take an infinite pressure. This principle of *plastic constraint* is used in bearing design by depositing a very thin layer (about 0.03 mm thick) of soft alloy on to the bearing shell. This is thick enough to embed most dirt particles, but thin enough to support the journal forces.


This soft bearing material also has an important role to play if there is a failure in the oil supply to the bearing. In this case, frictional heating will rapidly increase the bearing temperature, and would normally lead to pronounced metal-to-metal contact, gross atomic bonding between journal and bearing, and seizure. The soft bearing material of low melting point will be able to shear in response to the applied forces, and may also melt locally. This helps protect the journal from more severe surface damage, and also helps to avoid component breakages that might result from sudden locking of mating surfaces.

The third advantage of a soft bearing material is *conformability*. Slight misalignments of bearings can be self-correcting if plastic flow occurs easily in the bearing metal (Fig. 26.4). Clearly there is a compromise between load-bearing ability and conformability.

Because our thin overlay of lead-tin can get worn away under severe operating conditions before the end of the normal life of the bearing, it is customary to put a second thicker, and therefore harder, layer between the overlay and the steel backing

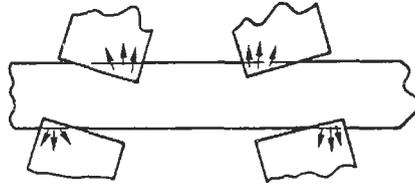

**Fig. 26.4.** Conformability of bearings; a conformable bearing material will flow to adjust to minor misalignments.

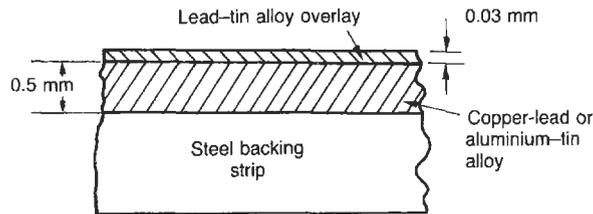

**Fig. 26.5.** A schematic cross-section through a typical layered bearing shell.

strip (Fig. 26.5). The alloys normally used are copper–lead, or aluminium–tin. In the event of the wearing through of the overlay they are still soft enough to act as bearing materials without immediate damage to the journal.


In the end it is through experience as much as by science that bearing materials have evolved. Table 26.1 lists some of these.

**Table 26.1** Materials for oil lubricated bearings

<i>Material</i>	<i>Application</i>
Tin-based white metal 88% Sn – 8% Sb – 4% Cu	Camshaft, cross-head bearings of i.c. engines
Lead-based white metal 75% Pb – 12% Sn – 13% Sb – 1% Cu	General machinery operating at low bearing pressures
Copper–lead 70% Cu – 30% Pb	Crankshaft and camshaft bearings of i.c. engines; turbocharger bearings
Lead–bronze 75% Cu – 20% Pb – 5% Sn	High performance i.c. engines, camshafts, gearboxes
Phosphor–bronze 88% Cu – 11% Sn – 1% P	High-load bearings for gearboxes, rolling mills, gudgeon pin bushes, etc., often used with overlay of softer material
Aluminium–tin 60% Al – 40% Sn	Heavily loaded crankshaft bearings for diesel engines. Can be used with overlay of softer material
Acetal–steel	General machinery where low start-up friction is required

**CASE STUDY 2: MATERIALS FOR SKIS AND SLEDGE RUNNERS**

Skis, both for people and for aircraft, used to be made of waxed wood. Down to about  $-10^{\circ}\text{C}$ , the friction of waxed wood on snow is very low –  $\mu$  is about 0.02 – and if this were not so, planes equipped with skis could not take off from packed-snow runways, and the winter tourist traffic to Switzerland would drop sharply. Below  $-10^{\circ}\text{C}$ , bad things start to happen (Fig. 26.6):  $\mu$  rises sharply to about 0.4. Polar explorers have observed this repeatedly. Wright, a member of the 1911–13 Scott expedition, writes: ‘Below  $0^{\circ}\text{F}$  ( $-18^{\circ}\text{C}$ ) the friction (on the sledge runners) seemed to increase progressively as the temperature fell’; it caused the expedition considerable hardship. What determines the friction of skis on snow?

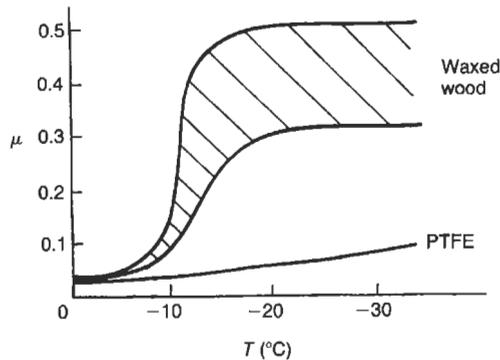

**Fig. 26.6.** Friction of materials on ice at various temperatures.

Ice differs from most materials in that its melting point *drops* if you compress it. It is widely held that pressure from the skis causes the snow beneath to melt, but this is nonsense: the pressure of a large person distributed over a ski lowers the melting point of ice by about  $0.0001^{\circ}\text{C}$  and, even if the weight is carried by asperities which touch the ski over only  $10^{-3}$  of its nominal area, the depression of the melting point is still only  $0.1^{\circ}\text{C}$ . Pressure melting, then, cannot account for the low friction shown in Fig. 26.6. But as the large person starts to descend the ski slope, work is done against the frictional forces, heat is generated at the sliding surface, and the ‘velocity limit’ of Fig. 26.3 is exceeded. The heat melts a layer of ice, producing a thin film of water, at points where asperities touch the ski: the person hydroplanes along on a layer of water generated by friction. The principle is exactly like that of the lead–bronze bearing, in which local hot spots melt the lead, producing a lubricating film of liquid which lowers  $\mu$  and saves the bearing.

Below  $-10^{\circ}\text{C}$ , heat is conducted away too quickly to allow this melting – and because their thermal conductivity is high, skis with exposed metal (aluminium or steel edges) are slower at low temperatures than those without. At these low temperatures, the mechanism of friction is the same as that of metals: ice asperities adhere to the ski and must be sheared when it slides. The value of  $\mu$  (0.4) is close to that calculated from the shearing model in Chapter 25. This is a large value of the coefficient of friction – enough

to make it very difficult for a plane to take off, and increasing by a factor of more than 10 the work required to pull a loaded sledge. What can be done to reduce it?

This is a standard friction problem. A glance at Fig. 25.5 shows that, when polymers slide on metals and ceramics,  $\mu$  can be as low as 0.04. Among the polymers with the lowest coefficients are PTFE ('Teflon') and polyethylene. By coating the ski or sledge runners with these materials, the coefficient of friction stays low, *even* when the temperature is so low that frictional heating is unable to produce a boundary layer of water. Aircraft and sports skis now have polyethylene or Teflon undersurfaces; the Olympic Committee has banned their use on bob-sleds, which already, some think, go fast enough.

### CASE STUDY 3: HIGH-FRICTION RUBBER

So far we have talked of ways of reducing friction. But for many applications – brake pads, clutch linings, climbing boots, and above all, car tyres – we want as much friction as we can get.

The frictional behaviour of rubber is quite different from that of metals. In Chapter 25 we showed that when metallic surfaces were pressed together, the bulk of the deformation at the points of contact was plastic; and that the friction between the surfaces arose from the forces needed to shear the junctions at the areas of contact.

But rubber deforms *elastically* up to very large strains. When we bring rubber into contact with a surface, therefore, the deformation at the contact points is *elastic*. These elastic forces still squeeze the atoms together at the areas of contact, of course; adhesion will still take place there, and shearing will still be necessary if the surfaces are to slide. This is why car tyres grip well in dry conditions. In *wet* conditions, the situation is different; a thin lubricating film of water and mud forms between rubber and road, and this will shear at a stress a good deal lower than previously, with dangerous consequences. Under these circumstances, another mechanism of friction operates to help prevent a skid.

It is illustrated in Figure 26.7. All roads have a fairly rough surface. The high spots push into the tyre, causing a considerable local elastic deformation. As the tyre skids, it slips forward over the rough spots. The region of rubber that was elastically deformed by the rough spot now relaxes, while the rubber just behind this region becomes compressed as it reaches the rough spot. Now, all rubbers exhibit some *anelasticity* (Chapter 8); the stress – strain curve looks like Fig. 26.8. As the rubber is compressed, work is done on it equal to the area under the upper curve; but if the stress



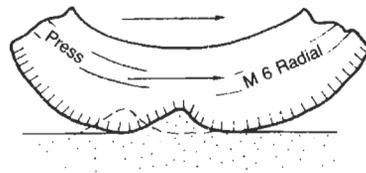


Fig. 26.7. Skidding on a rough road surface deforms the tyre material elastically.

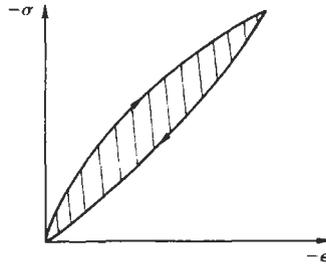

**Fig. 26.8.** Work is needed to cycle rubber elastically.

is removed we do not get all this work back. Part of it is dissipated as heat – the part shown as the shaded area between the loading and the unloading curve. So to make the tyre slide on a rough road we have to do work, even when the tyre is well lubricated, and if we have to do work, there is friction. Special rubbers have been developed for high-loss characteristics (called ‘high-loss’ or ‘high-hysteresis’ rubbers) and these have excellent skid resistance even in wet conditions.

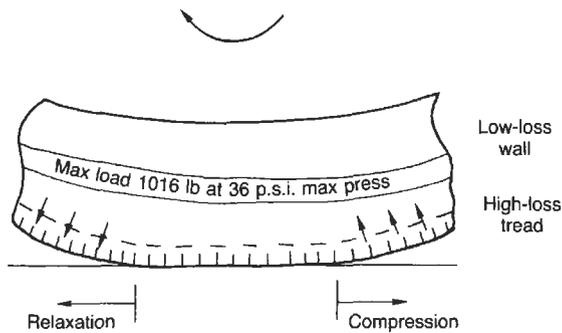

**Fig. 26.9.** Anti-skid tyres, with a high-loss tread (for maximum grip) and a low-loss wall (for minimum heating up).

There is one obvious drawback of high-hysteresis rubber. In normal rolling operation, considerable elastic deformations still take place in the tyre wall, and high-loss tyres will consume fuel and generate considerable heat. The way out is to use a low-loss tyre covered with a high-loss tread – another example of design using composite materials (Fig. 26.9).

## Further reading

- F. P. Bowden and D. Tabor, *Friction – An Introduction to Tribology*, Heinemann Science Study Series, No. 41, 1974.
- F. P. Bowden and D. Tabor, *The Friction and Lubrication of Solids*, Oxford University Press, Part I, 1950; Part II, 1965.

- A. D. Sarkar, *Wear of Metals*, Pergamon Press, 1976.
- P. G. Forrester, Bearing materials, *Metallurgical Reviews*, 5 (1960) 507.
- E. R. Braithwaite (ed.), *Lubrication and Lubricants*, Elsevier, 1967.
- N. A. Waterman and M. F. Ashby (eds), *Elsevier Materials Selector*, Elsevier, Amsterdam (1991) Section 1-5.



# Final Case Study

---



# Chapter 27

## Materials and energy in car design

---

### Introduction

The status of steel as the raw material of choice for the manufacture of car bodies rests principally on its *price*. It has always been the cheapest material which meets the necessary strength, stiffness, formability and weldability requirements of large-scale car body production. Until recently, the fact that steel has a density two-thirds that of lead was accorded little significance. But increasing environmental awareness and tightening legislative requirements concerning damaging emissions and fuel efficiency are now changing that view. Car makers are looking hard at alternatives to steel.

### Energy and cars

Energy is used to build a car, and energy is used to run it. Rising oil prices mean that, since about 1980, the cost of the petrol consumed during the average life of a car is comparable with the cost of the car itself. Consumers, therefore, now want more fuel-efficient cars, and more fuel-efficient cars pollute less.

A different perspective on the problem is shown in Table 27.1: 15% of all the energy used in a developed country is consumed by private cars. The dependence of most developed countries on imported oil is such a liability that they are seeking ways of reducing it. Private transport is an attractive target because to trim its energy consumption does not necessarily depress the economy. In the US, for example, legislation is in place requiring that the *average* fleet-mileage of a manufacturer increase from 22.5 to 34.5 miles per gallon; and in certain cities (Los Angeles, for example) a target of *zero* emission has been set. How can this be achieved?

**Table 27.1** Energy in manufacture and use of cars

---

Energy to produce cars, per year	=	0.8% to 1.5% of total energy consumed by nation
Energy to move cars, per year	=	15% of total energy consumed by nation
(Transportation of people and goods, total)	=	24% of total energy consumed by nation

---

## Ways of achieving energy economy

It is clear from Table 27.1 that the energy content of the car itself – that is of the steel, rubber, glass and of the manufacturing process itself – is small: less than one-tenth of that required to move the car. This means that there is little point in trying to save energy here; indeed (as we shall see) it may pay to use more energy to make the car (using, for instance, aluminium instead of steel) if this reduces the fuel consumption.

We must focus, then, on reducing the energy used to move the car. There are two routes.

- Improve engine efficiency.* Engines are already remarkably efficient; there is a limit to the economy that can be achieved here, though it can help.
- Reduce the weight of the car.* Figure 27.1 shows how the fuel consumption (g.p.m.) and the mileage (m.p.g.) vary with car weight. There is a linear correlation: halving the weight halves the g.p.m. This is why small cars are more economical than big ones: engine size and performance have some influence, but it is mainly the weight that determines the fuel consumption.

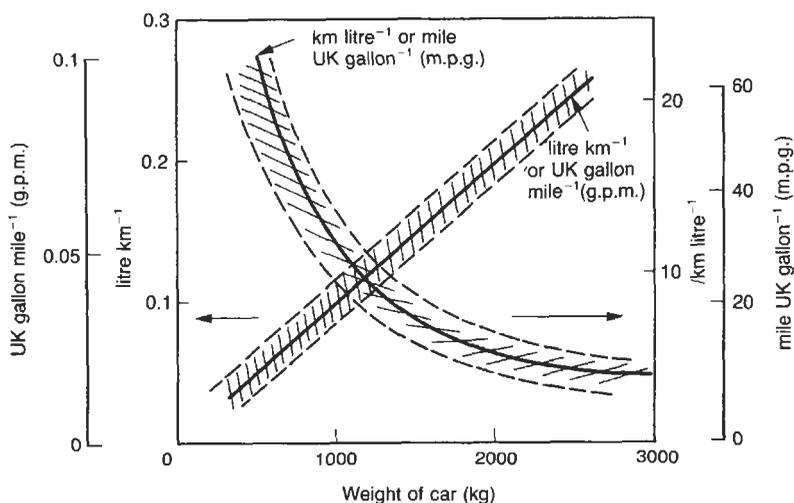


Fig. 27.1. Fuel consumption of production cars.

We can, then reduce the size of cars, but the consumer does not like that. Or we can reduce the *weight* of the car by substituting lighter materials for those used now. Lighter cars not only use less fuel, they also emit less gaseous pollution – hence the interest in producing lighter vehicles, reversing what historically has been a consistent trend in the opposite direction.

## Material content of a car

As Fig. 27.1 suggests, most cars weigh between 400 kg and 2500 kg. In a typical modern production car (Fig. 27.2) this is made up as shown in Table 27.2.



**Fig. 27.2.** The Volkswagen Passat – a typical 1970s pressed-steel body with no separate chassis. For a given material this ‘monocoque’ construction gives a minimum weight-to-strength ratio.

**Table 27.2** Contributors to the weight of car

71% Steel:	body shell, panels
15% Cast iron:	engine block; gear box; rear axle
4% Rubber:	tyres; hoses
Balance glass, zinc, copper, aluminium, polymers	

## Alternative materials

### Primary mechanical properties

Candidate materials for substitutes must be lighter than steel, but structurally equivalent. For the engine block, the choice is an obvious one: aluminium (density  $2.7 \text{ Mg m}^{-3}$ ) or possibly magnesium (density  $1.8 \text{ Mg m}^{-3}$ ) replace an *equal volume* of cast iron (density  $7.7 \text{ Mg m}^{-3}$ ) with an immediate weight reduction on this component of 2.8 to 4.3 times. The production methods remain almost unchanged. Many manufacturers have made this change already.

**Table 27.3** Properties of candidate materials for car bodies

Material	Density $\rho$ ( $\text{Mg m}^{-3}$ )	Young's modulus, $E$ ( $\text{GN m}^{-2}$ )	Yield strength, $\sigma_y$ ( $\text{MN m}^{-2}$ )	$(\rho/E^{1/2})$	$(\rho/\sigma_y^{1/2})$
Mild steel	7.8	207	220	1.32	0.53
High-strength steel			up to 500		0.35
Aluminium alloy	2.7	69	193	0.66	0.19
GFRP (chopped fibre, moulding grade)	1.8	15	75	0.73	0.21

The biggest potential weight saving, however, is in the body panels, which make up 60% of the weight of the vehicle. Here the choice is more difficult. Candidate materials are given in Table 27.3.

How do we assess the possible weight saving? Just replacing a steel panel with an aluminium-alloy or fibreglass one of equal thickness (giving a weight saving which scales as the density) is unrealistic: both the possible substitutes have much lower moduli, and thus will deflect (under given loads) far more; and one of them has a much



**Fig. 27.3.** The Morris Traveller – a classic of the 1950s with wooden members used as an integral part of the monocoque body shell.

lower yield strength, and might undergo plastic flow. We need an analysis like that of Chapters 7 and 12.

If (as with body panels) *elastic* deflection is what counts, the logical comparison is for a panel of equal *stiffness*. And if, instead, it is resistance to *plastic* flow which counts (as with bumpers) then the proper thing to do is to compare sections with equal resistance to plastic flow.

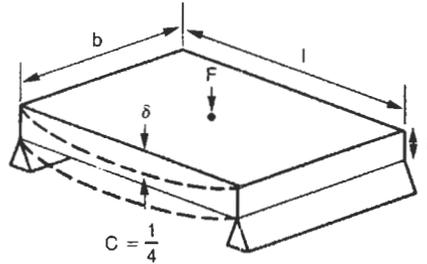


Fig. 27.4. Elastic deflection of a car-body panel.

The *elastic* deflection  $\delta$  of a panel under a force  $F$  (Fig. 27.4) is given by

$$\delta = \frac{CF^3}{Ebt^3} \quad (27.1)$$

where  $t$  is the sheet thickness,  $l$  the length and  $b$  the width of the panel. The constant  $C$  depends on how the panel is held: at two edges, at four edges, and so on – it does not affect our choice. The mass of the panel is

$$M = \rho btl. \quad (27.2)$$

The quantities  $b$  and  $l$  are determined by the design (they are the dimensions of the door, trunk lid, etc.). The only variable in controlling the stiffness is  $t$ . Now from eqn. (27.1)

$$t = \left( \frac{C l^3 F}{\delta E b} \right)^{\frac{1}{3}}. \quad (27.3)$$

Substituting this expression for  $t$  in eqn. (27.2) gives, for the mass of the panel,

$$M = \left\{ C \left( \frac{F}{\delta} \right) l^3 b^2 \right\}^{\frac{1}{3}} \left( \frac{\rho}{E^{\frac{1}{3}}} \right). \quad (27.4)$$

Thus, for a given *stiffness* ( $F/\delta$ ), *panel dimensions* ( $l, b$ ) and *edge-constraints* ( $C$ ) the lightest panel is the one with the smallest value of  $\rho/E^{\frac{1}{3}}$ .

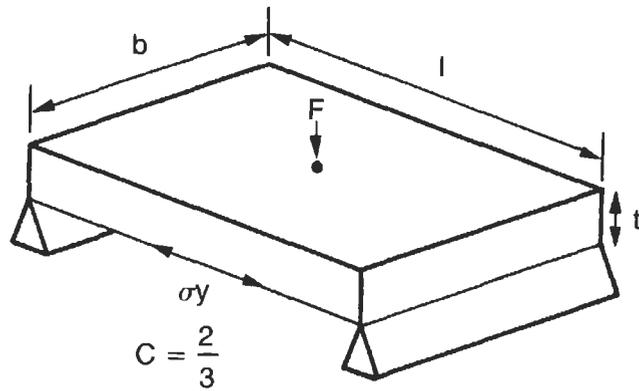


Fig. 27.5. Yielding of a car-body panel.

We can perform a similar analysis for *plastic* yielding. A panel with the section shown in Fig. 27.5 yields at a load

$$F = \left( \frac{Cbt^2}{l} \right) \sigma_y \quad (27.5)$$

The panel mass is given, as before, by equation (27.2). The only variable is  $t$  given by

$$t = \left( \frac{Fl}{Cb\sigma_y} \right)^{\frac{1}{2}} \quad (27.6)$$

from eqn. (27.5). Substituting for  $t$  in eqn. (27.2) gives

$$M = \left( \frac{Fbl^3}{C} \right)^{\frac{1}{2}} \left( \frac{\rho}{\sigma_y^{\frac{1}{2}}} \right). \quad (27.7)$$

The panel with the smallest value of  $\rho/\sigma_y^{\frac{1}{2}}$  is the one we want.

We can now assess candidate materials more sensibly on the basis of the data given in Table 27.3. The values of the two important property groups are shown in the last two columns. For the majority of body panels (for which *elastic* deflection determines design) high-strength steel offers no advantage over mild steel: it has the same value of  $\rho/E^{\frac{1}{2}}$ . GFRP is better (a lower  $\rho/E^{\frac{1}{2}}$  and thus weight), and aluminium alloy is better still – that is one of the reasons aircraft are made of aluminium. But notice that the weight saving in going from a steel to an aluminium panel is not a factor of 3 (the ratio of the

densities) but only 2 (the ratio of their  $\rho/E^{1/2}$ s) because the aluminium panel has to be thicker to compensate for its lower  $E$ .

High strength steel *does* offer a weight saving for strength-limited components: bumpers, front and rear header panels, engine mounts, bulkheads, and so forth; the weight saving ( $\rho/\sigma_y^{1/2}$ ) is a factor of 1.5. Both aluminium alloy and fibreglass offer potential weight savings of up to 3 times ( $\rho/\sigma_y^{1/2}$ ) on these components. This makes possible a saving of at least 30% on the weight of the vehicle; if, in addition, an aluminium engine block is used, the overall weight saving is larger still. These are very substantial savings – sufficient to achieve the increase in mileage per gallon from 22.5 to 34.5 without any decrease in the size of the car, or increase in engine efficiency. So they are obviously worth examining more closely. What, then, of the *other* properties required of the substitute materials?

### Secondary properties

Although resistance to deflection and plastic yielding are obviously of first importance in choosing alternative materials, other properties enter into the selection. Let us look at these briefly. Table 27.4 lists the conditions imposed by the service environment.

**Table 27.4** The service environment of the average car

<i>Loading</i>	Static	→ Elastic or plastic deflection	
	Impact	→ Elastic or plastic deflection	
	Impact	→ Fracture	
	Fatigue	→ Fatigue fracture	
	Long-term static	→ Creep	
<i>Physical environment</i>	–40°C < $T$ < 120°C		
	55% < relative humidity < 100%		
<i>Chemical environment</i>	Water		Petrol
	Oil		Antifreeze
	Brake fluid		Salt
	Transmission fluid		

Consider these in turn. *Elastic* and *plastic* deflection we have dealt with already. The toughness of steel is so high that *fracture* of a steel panel is seldom a problem. But what about the other materials? The data for toughness are given in Table 27.5.

But what is the proper way to use toughness values? The most sensible thing to do is ask: suppose the panel is loaded up to its yield load (above this load we *know* it will begin to fail – by plastic flow – so it does not matter whether other failure mechanisms also appear); what is the maximum crack size that is still stable? If this is large enough

**Table 27.5** Properties of body-panel materials: toughness, fatigue and creep

Material	Toughness $G_c$ ( $\text{kJm}^{-2}$ )	Tolerable crack length (mm)	Fatigue	Creep
Mild steel	$\approx 100$	$\approx 140$	} OK	OK
High-strength steel	$\approx 100$	$\approx 26$		
Aluminium alloy	$\approx 20$	$\approx 12$	OK	OK
GFRP (chopped fibre, moulding grade)	$\approx 37$	$\approx 30$	OK	Creep above $60^\circ\text{C}$

that it should not appear in service, we are satisfied; if not, we must increase the section. This crack size is given (Chapter 13) by

$$\sigma_y \sqrt{\pi a} = K_c = \sqrt{EG_c}$$

from which

$$a_{\max} = \frac{EG_c}{\pi \sigma_y^2}$$

The resulting crack lengths are given in Table 27.5. A panel with a crack longer than this will fail by 'tearing'; one with a short crack will simply fail by general yield, i.e. it will bend permanently. Although the tolerable crack lengths are shorter in replacement materials than in steel, they are still large enough to permit the replacement materials to be used.

*Fatigue* (Chapter 15) is always a potential problem with any structure subject to varying loads: anything from the loading due to closing the door to that caused by engine vibration can, potentially, lead to failure. The fatigue strength of all these materials is adequate.

*Creep* (Chapter 17) is not normally a problem a designer considers when designing a car body with metals: the maximum service temperature reached is  $120^\circ\text{C}$  (panels near the engine, under extreme conditions), and neither steel nor aluminium alloys creep significantly at these temperatures. But GFRP does. Above  $60^\circ\text{C}$  creep-rates are significant. GFRP shows a classic three-stage creep curve, ending in failure; so that extra reinforcement or heavier sections will be necessary where temperatures exceed this value.

More important than either creep or fatigue in current car design is the *effect of environment* (Chapter 23). An appreciable part of the cost of a new car is contributed by the manufacturing processes designed to prevent rusting; and these processes only partly work – it is body-rust that ultimately kills a car, since the mechanical parts (engine, etc.) can be replaced quite easily, as often as you like.

Steel is particularly bad in this regard. In ordinary circumstances, aluminium is much better as we showed in the chapters on corrosion. Although the effect of salt on aluminium is bad, heavy anodising will slow down even that form of attack to tolerable


levels (the masts of modern yachts are made of anodised aluminium alloy, for example).

So aluminium alloy is good: it resists all the fluids likely to come in contact with it. What about GFRP? The strength of GFRP is reduced by up to 20% by continuous immersion in most of the fluids – even salt water – with which it is likely to come into contact; but (as we know from fibreglass boats) this drop in strength is not critical, and it occurs without visible corrosion, or loss of section. In fact, GFRP is much more corrosion-resistant, in the normal sense of ‘loss-of-section’, than steel.


## Production methods

The biggest penalty one has to pay in switching materials is likely to be the higher material and production costs. *High-strength steel*, of course, presents almost no problem. The yield strength is higher, but the section is thinner, so that only slight changes in punches, dies and presses are necessary, and once these are paid for, the extra cost is merely that of the material.

At first sight, the same is true of *aluminium alloys*. But because they are heavily alloyed (to give a high yield strength) their *ductility* is low. If expense is unimportant, this does not matter, some early Rolls-Royce cars (Fig. 27.6) had aluminium bodies which were formed into intricate shapes by laborious hand-beating methods, with frequent annealing of the aluminium to restore its ductility. But in mass production we should like to deep draw body panels in one operation – and then low ductility is much

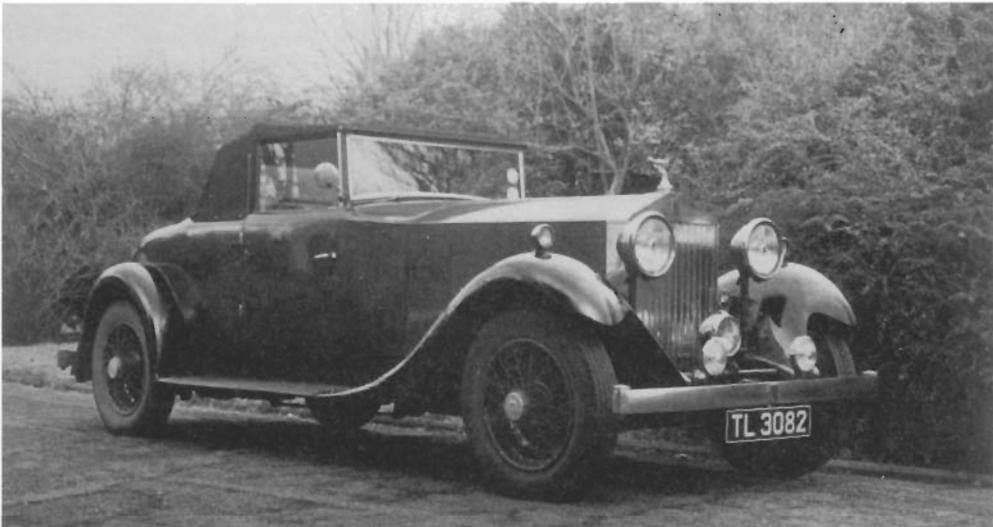


**Fig. 27.6.** A 1932 Rolls-Royce. Mounted on a separate steel chassis is an all-aluminium hand-beaten body by the famous coach building firm of James Mulliner. Any weight advantage due to the use of aluminium is totally outweighed by the poor weight-to-strength ratio of separate-chassis construction; but the bodywork remains immaculate after 48 years of continuous use!

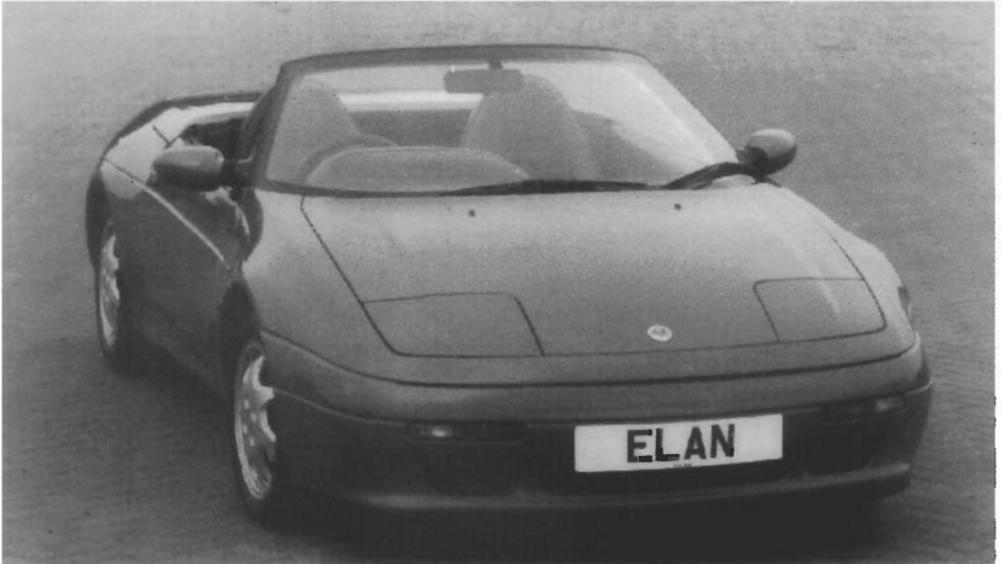

**Fig. 27.7.** A 1994 Lotus Elan, with a GFRP body (but still mounted on a steel chassis – which does not give anything like the weight saving expected with an all-GFRP monocoque structure). (Reproduced with the kind permission of Group Lotus Ltd.)

more serious. The result is a loss of design flexibility: there are more constraints on the use of aluminium alloys than on steel; and it is this, rather than the cost, which is the greatest obstacle to the wholesale use of aluminium in cars.

GFRP looks as if it would present production problems: you may be familiar with the tedious hand lay-up process required to make a fibreglass boat or canoe. But mass-production methods have now been developed to handle GFRP. Most modern cars have GFRP components (bumpers, fascia panels, internal panels) and a few have GFRP bodies (Fig. 27.7), usually mounted on a steel chassis; the full weight savings will only be realised if the *whole* load-bearing structure is made from GFRP. In producing GFRP car panels, a slug of polyester resin, with *chopped* glass fibres mixed in with it, is dropped into a heated split mould (Fig. 27.8). As the polyester used is a *thermoset* it will

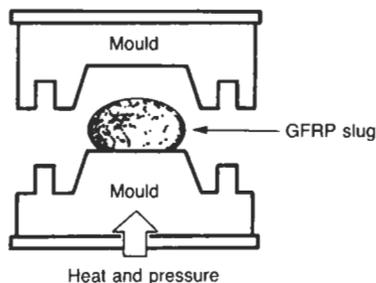

**Fig. 27.8.** Compression moulding of car-body components.

'go off' in the hot mould, after which the solid moulding can be ejected. Modern methods allow a press like this to produce one moulding per minute – still slower than steel pressing, but practical. Moulding (as this is called) brings certain advantages. It offers great design flexibility – particularly in change of section, and sharp detail – which cannot be achieved with steel. And GFRP mouldings often result in consolidation of components, reducing assembly costs.

## Conclusions

The conclusions are set out in the table below.

### A. High-strength steel

<i>For</i>	<i>Against</i>
Retains all existing technology	Weight saving only appreciable in designing against <i>plastic flow</i>
Use in selected applications, e.g. bumpers.	

### B. Aluminium alloy

<i>For</i>	<i>Against</i>
Large weight saving in both body shell and engine block Retains much existing technology Corrosion resistance excellent	Unit cost higher Deep drawing properties poor – loss in design flexibility
Aluminium alloy offers saving of up to 40% in total car weight. The increased unit cost is offset by the lower running cost of the lighter vehicle, and the greater recycling potential of the aluminium.	

### C. GFRP

<i>For</i>	<i>Against</i>
Large weight saving in body shell Corrosion resistance excellent Great gain in design flexibility and some parts consolidation	Unit cost higher Massive changes in manufacturing technology Designer must cope with some creep
GFRP offers savings of up to 30% in total car weight, at some increase in unit cost and considerable capital investment in new equipment. Recycling problems still have to be overcome.	



# Appendix 1

## Examples

---

1. (a) Commodity A is currently consumed at the rate  $C_A$  tonnes per year, and commodity B at the rate  $C_B$  tonnes per year ( $C_A > C_B$ ). If the two consumption rates are increasing exponentially to give growths in consumption after each year of  $r_A\%$  and  $r_B\%$ , respectively ( $r_A < r_B$ ), derive an equation for the time, measured from the present day, before the annual consumption of B exceeds that of A.
- (b) The table shows 1994 figures for consumptions and growth rates of steel, aluminium and plastics. What are the doubling times (in years) for consumption of these commodities?
- (c) Calculate the number of years, measured from 1994, before the consumption of (a) aluminium and (b) polymers would exceed that of steel, *if exponential growth continued*. Is this continued growth probable?

Material	Current (1994) world consumption (tonnes year <sup>-1</sup> )	Projected growth rate in consumption (% year <sup>-1</sup> , (1994))
Iron and steel	$3 \times 10^8$	2
Aluminium	$4 \times 10^7$	3
Polymers	$1 \times 10^8$	4

Answers:

- (a) 
$$t = \frac{100}{r_B - r_A} \ln \left( \frac{C_A}{C_B} \right).$$
  - (b) Doubling times: steel, 35 years; aluminium, 23 years; plastics, 18 years.
  - (c) If exponential growth continued, aluminium would overtake steel in 201 years (A.D. 2195); polymers would overtake steel in 55 years (A.D. 2049).
2. (a) Discuss ways of conserving engineering materials, and the technical and social problems involved in implementing them.
  - (b) 12% of the world production of lead is used dissipatively as an antiknock compound in petrol. If laws were passed to prevent this use, how many years would it require before the consumption of lead returned to the level obtaining *just* before the new laws took effect? Assume that the other uses of lead continue to grow at an average rate of 2% per year.

Answer: (b) 6.4 years.

3. (a) Explain what is meant by *exponential growth* in the consumption of a material.
- (b) A material is consumed at  $C_0$  tonne year<sup>-1</sup> in 1994. Consumption in 1980 is increasing at  $r\%$  year<sup>-1</sup>. If the resource base of the material is  $Q$  tonnes, and consumption *continues* to increase at  $r\%$  year<sup>-1</sup>, show that the resource will be half exhausted after a time,  $t_{1/2}$ , given by

$$t_{1/2} = \frac{100}{r} \ln \left\{ \frac{rQ}{200C_0} + 1 \right\}.$$

- (c) Discuss, giving specific examples, the factors that might cause a decrease in the rate of consumption of a potentially scarce material.
4. Use the information given in Table 2.1 (Prices of Materials) and in Table 2.4 (Energy Content of Materials) to calculate the approximate cost of (a) aluminium, (b) low-density polyethylene, (c) mild steel and (d) cement in 2004, assuming that oil increases in price by a factor of 1.6 and that labour and other manufacturing costs increase by a factor of 1.3 between 1994 and 2004.

Comment on the implications of your results (e.g. Which commodities have increased by the largest factor? How have the relative costs of materials changed? What are the implications for the use of polymers?).

*Answers:* (a) aluminium, UK£1448 (US\$2172) tonne<sup>-1</sup>; (b) polyethylene, UK£932 (US\$1398) tonne<sup>-1</sup>; (c) mild steel, UK£440 (US\$660) tonne<sup>-1</sup>; (d) cement, UK£78 (US\$117) tonne<sup>-1</sup>.

5. (a) Define *Poisson's ratio*,  $\nu$ , and the *dilatation*,  $\Delta$ , in the straining of an elastic solid.
- (b) Calculate the dilatation  $\Delta$  in the uniaxial elastic extension of a bar of material, assuming strains are small, in terms of  $\nu$  and the tensile strain,  $\epsilon$ . Hence find the value of  $\nu$  for which the volume change during elastic deformation is zero.
- (c) Poisson's ratio for most metals is about 0.3. For cork it is close to zero; for rubber it is close to 0.5. What are the approximate volume changes in each of these materials during an elastic tensile strain of  $\epsilon$ ?

*Answers:* (b) 0.5, (c) 'most metals':  $0.4\epsilon$ ; cork:  $\epsilon$ ; rubber: 0.

6. The potential energy  $U$  of two atoms, a distance  $r$  apart, is

$$U = -\frac{A}{r^m} + \frac{B}{r^n}, \quad m = 2, \quad n = 10.$$

Given that the atoms form a stable molecule at a separation of 0.3 nm with an energy of  $-4$  eV, calculate  $A$  and  $B$ . Also find the force required to break the molecule, and the critical separation at which the molecule breaks. You should sketch an energy/distance curve for the atom, and sketch beneath this curve the appropriate *force/distance* curve.

*Answers:*  $A: 7.2 \times 10^{-20} \text{ J nm}^2$ ;  $B: 9.4 \times 10^{-25} \text{ J nm}^{10}$ ; Force:  $2.39 \times 10^{-9} \text{ N}$  at 0.352 nm.

7. The potential energy  $U$  of a pair of atoms in a solid can be written as

$$U = \frac{-A}{r^m} + \frac{B}{r^n}$$

where  $r$  is the separation of the atoms, and  $A$ ,  $B$ ,  $m$  and  $n$  are positive constants. Indicate the physical significance of the two terms in this equation.

A material has a cubic unit cell with atoms placed at the corners of the cubes. Show that, when the material is stretched in a direction parallel to one of the cube edges, Young's modulus  $E$  is given by

$$E = \frac{mnkT_M}{\Omega}$$

where  $\Omega$  is the mean atomic volume,  $k$  is Boltzmann's constant and  $T_M$  is the absolute melting temperature of the solid. You may assume that  $U(r_0) = -kT_M$ , where  $r_0$  is the equilibrium separation of a pair of atoms.

8. The table below gives the Young's modulus,  $E$ , the atomic volume,  $\Omega$ , and the melting temperature,  $T_M$ , for a number of metals. If

$$E \approx \frac{\bar{A}kT_M}{\Omega}$$

(where  $k$  is Boltzmann's constant and  $\bar{A}$  is a constant), calculate and tabulate the value of the constant  $\bar{A}$  for each metal. Hence find an arithmetic mean of  $\bar{A}$  for these metals.

Use the equation, with the average  $\bar{A}$ , to calculate the approximate Young's modulus of (a) diamond and (b) ice. Compare these with the experimental values of  $1.0 \times 10^{12} \text{ N m}^{-2}$  and  $7.7 \times 10^9 \text{ N m}^{-2}$ , respectively. Watch the units!

Material	$\Omega \times 10^{29}$ ( $\text{m}^3$ )	$T_m$ (K)	$E$ ( $\text{GN m}^{-2}$ )
Nickel	1.09	1726	214
Copper	1.18	1356	124
Silver	1.71	1234	76
Aluminium	1.66	933	69
Lead	3.03	600	14
Iron	1.18	1753	196
Vanadium	1.40	2173	130
Chromium	1.20	2163	289
Niobium	1.80	2741	100
Molybdenum	1.53	2883	360
Tantalum	1.80	3271	180
Tungsten	1.59	3683	406

Data for ice and for diamond.

Ice	Diamond
$\Omega = 3.27 \times 10^{-29} \text{ m}^3$	$\Omega = 5.68 \times 10^{-30} \text{ m}^3$
$T_M = 273 \text{ K}$	$T_M = 4200 \text{ K}$
$E = 7.7 \times 10^9 \text{ N m}^{-2}$	$E = 1.0 \times 10^{12} \text{ N m}^{-2}$

*Answers:* Mean  $\bar{A} = 88$ . Calculated moduli: diamond,  $9.0 \times 10^{11} \text{ N m}^{-2}$ ; ice,  $1.0 \times 10^{10} \text{ N m}^{-2}$ .

9. (a) Calculate the density of an f.c.c. packing of spheres of unit density.  
 (b) If these same spheres are packed to form a *glassy* structure, the arrangement is called 'dense random packing' and has a density of 0.636. If crystalline f.c.c. nickel has a density of  $8.90 \text{ Mg m}^{-3}$ , calculate the density of glassy nickel.

*Answers:* (a) 0.740, (b)  $7.65 \text{ Mg m}^{-3}$ .

10. (a) Sketch three-dimensional views of the unit cell of a b.c.c. crystal, showing a (100) plane, a (110) plane, a (111) plane and a (210) plane.  
 (b) The slip planes of b.c.c. iron are the {110} planes: sketch the atom arrangement in these planes, and mark the  $\langle 111 \rangle$  slip directions.  
 (c) Sketch three-dimensional views of the unit cell of an f.c.c. crystal, showing a [100], a [110], a [111] and a [211] direction.  
 (d) The slip planes of f.c.c. copper are the {111} planes: sketch the atom arrangement in these planes and mark the  $\langle 110 \rangle$  slip directions.
11. (a) The atomic diameter of an atom of nickel is 0.2492 nm. Calculate the lattice constant  $a$  of f.c.c. nickel.  
 (b) The atomic weight of nickel is  $58.71 \text{ kg kmol}^{-1}$ . Calculate the density of nickel. (Calculate first the mass per atom, and the number of atoms in a unit cell.)  
 (c) The atomic diameter of an atom of iron is 0.2482 nm. Calculate the lattice constant  $a$  of b.c.c. iron.  
 (d) The atomic weight of iron is  $55.85 \text{ kg kmol}^{-1}$ . Calculate the density of iron.

*Answers:* (a) 0.352 nm, (b)  $8.91 \text{ Mg m}^{-3}$ , (c) 0.287 nm, (d)  $7.88 \text{ Mg m}^{-3}$ .

12. Crystalline copper and magnesium have face-centred-cubic and close-packed-hexagonal structures respectively.
- (a) Assuming that the atoms can be represented as hard spheres, calculate the percentage of the volume occupied by atoms in each material.  
 (b) Calculate, from first principles, the dimensions of the unit cell in copper and in magnesium.

(The densities of copper and magnesium are  $8.96 \text{ Mg m}^{-3}$  and  $1.74 \text{ Mg m}^{-3}$ , respectively.)

*Answers:* (a) 74% for both; (b) copper:  $a = 0.361 \text{ nm}$ ; magnesium:  $a = 0.320 \text{ nm}$ ;  $c = 0.523 \text{ nm}$ .

13. The table lists Young's modulus,  $E_{\text{composite}}$ , for a glass-filled epoxy composite. The material consists of a volume fraction  $V_f$  of glass particles (Young's modulus,  $E_f$ ,  $80 \text{ GN m}^{-2}$ ) dispersed in a matrix of epoxy (Young's modulus,  $E_m$ ,  $5 \text{ GN m}^{-2}$ ).

Volume fraction of glass, $V_f$	$E_{\text{composite}}$ ( $\text{GN m}^{-2}$ )
0	5.0
0.05	5.5
0.10	6.4
0.15	7.8
0.20	9.5
0.25	11.5
0.30	14.0

Calculate the upper and lower values for the modulus of the composite material, and plot them, together with the data, as a function of  $V_f$ . Which set of values most nearly describes the results? Why? How does the modulus of a random chopped-fibre composite differ from those of an aligned continuous-fibre composite?

14. A composite material consists of parallel fibres of Young's modulus  $E_F$  in a matrix of Young's modulus  $E_M$ . The volume fraction of fibres is  $V_F$ . Derive an expression for  $E_C$ , Young's modulus of the composite along the direction of the fibres, in terms of  $E_F$ ,  $E_M$  and  $V_F$ . Obtain an analogous expression for the density of the composite,  $\rho_C$ . Using material parameters given below, find  $\rho_C$  and  $E_C$  for the following composites: (a) carbon fibre-epoxy resin ( $V_F = 0.5$ ), (b) glass fibre-polyester resin ( $V_F = 0.5$ ), (c) steel-concrete ( $V_F = 0.02$ ).

A uniform, rectangular-section beam of fixed width  $w$ , unspecified depth  $d$ , and fixed length  $L$  rests horizontally on two simple supports at either end of the beam. A concentrated force  $F$  acts vertically downwards through the centre of the beam. The deflection,  $\delta$ , of the loaded point is

$$\delta = \frac{FL^3}{4E_C w d^3}$$

ignoring the deflection due to self weight. Which of the three composites will give the lightest beam for a given force and deflection?

Material	Density ( $\text{Mg m}^{-3}$ )	Young's modulus ( $\text{GN m}^{-2}$ )
Carbon fibre	1.90	390
Glass fibre	2.55	72
Epoxy resin	1.15	3
Polyester resin		
Steel	7.90	200
Concrete	2.40	45

Answers:  $E_C = E_F V_F + (1 - V_F) E_M$ ;  $\rho_C = \rho_F V_F + (1 - V_F) \rho_M$ .

(a)  $\rho_C = 1.53 \text{ Mg m}^{-3}$ ,  $E_C = 197 \text{ GN m}^{-2}$ ; (b)  $\rho_C = 1.85 \text{ Mg m}^{-3}$ ,  $E_C = 37.5 \text{ GN m}^{-2}$ ;

(c)  $\rho_C = 2.51 \text{ Mg m}^{-3}$ ,  $E_C = 48.1 \text{ GN m}^{-2}$ .

Carbon fibre/Epoxy resin.

15. Indicate, giving specific examples, why some composite materials are particularly attractive in materials applications.

A composite material consists of flat, thin metal plates of uniform thickness glued one to another with a thin, epoxy-resin layer (also of uniform thickness) to form a 'multi-decker-sandwich' structure. Young's modulus of the metal is  $E_1$ , that of the epoxy resin is  $E_2$  (where  $E_2 < E_1$ ) and the volume fraction of metal is  $V_1$ . Find the ratio of the maximum composite modulus to the minimum composite modulus in terms of  $E_1$ ,  $E_2$  and  $V_1$ . Which value of  $V_1$  gives the largest ratio?

Answer: Largest ratio when  $V_1 = 0.5$ .

16. (a) Define a high polymer; list three engineering polymers.  
 (b) Define a thermoplastic and a thermoset.  
 (c) Distinguish between a glassy polymer, a crystalline polymer and a rubber.  
 (d) Distinguish between a cross-linked and a non-cross-linked polymer.  
 (e) What is a co-polymer?  
 (f) List the monomers of polyethylene (PE), polyvinyl chloride (PVC), and polystyrene (PS).  
 (g) What is the glass transition temperature,  $T_G$ ?  
 (h) Explain the change of moduli of polymers at the glass transition temperature.  
 (i) What is the order of magnitude of the number of carbon atoms in a single molecule of a high polymer?  
 (j) What is the range of temperature in which  $T_G$  lies for most engineering polymers?  
 (k) How would you increase the modulus of a polymer?
17. (a) Select the material for the frame of the ultimate bicycle – meaning the lightest possible for a given stiffness. You may assume that the tubes of which the frame is made are cantilever beams (of length  $l$ ) and that the elastic bending displacement  $\delta$  of one end of a tubular beam under a force  $F$  (the other end being rigidly clamped) is

$$\delta = \frac{Fl^3}{3E\pi r^3 t}.$$

$2r$  is the diameter of the tube (fixed by the designer) and  $t$  is the wall thickness of the tube, which you may vary.  $t$  is much less than  $r$ . Find the combination of material properties which determine the mass of the tube for a given stiffness, and hence make your material selection using data given in Chapters 3 and 5. Try steel, aluminium alloy, wood, GFRP and CFRP.

- (b) Which of the following materials leads to the cheapest bicycle frame, for a given stiffness: mild steel, aluminium alloy, titanium alloy, GFRP, CFRP or hard wood?

Answers: (a) CFRP, (b) steel.

18. Explain what is meant by the *ideal strength* of a material. Show how dislocations can allow metals and alloys to deform plastically at stresses that are much less than the ideal strength. Indicate, giving specific examples, the ways in which metals and alloys may be made harder.
19. The energy per unit length of a dislocation is  $\frac{1}{2}Gb^2$ . Dislocations dilate a close-packed crystal structure very slightly, because at their cores, the atoms are not close-packed: the dilatation is  $\frac{1}{4}b^2$  per unit length of dislocation. It is found that the density of a bar of copper changes from  $8.9323 \text{ Mg m}^{-3}$  to  $8.9321 \text{ Mg m}^{-3}$  when it is very heavily deformed. Calculate (a) the dislocation density introduced into the copper by the deformation and (b) the energy associated with that density. Compare this result with the latent heat of melting of copper ( $1833 \text{ MJ m}^{-3}$ ) ( $b$  for copper is  $0.256 \text{ nm}$ ;  $G$  is  $\frac{3}{8}E$ ).

Answers: (a)  $1.4 \times 10^{15} \text{ m}^{-2}$ , (b)  $2.1 \text{ MJ m}^{-3}$ .

20. Explain briefly what is meant by a *dislocation*. Show with diagrams how the motion of (a) an edge dislocation and (b) a screw dislocation can lead to the plastic deformation of a crystal under an applied shear stress. Show how dislocations can account for the following observations:

- (a) cold working makes aluminium harder;
- (b) an alloy of 20% Zn, 80% Cu is harder than pure copper;
- (c) the hardness of nickel is increased by adding particles of thorium oxide.

21. (a) Derive an expression for the shear stress  $\tau$  needed to bow a dislocation line into a semicircle between small hard particles a distance  $L$  apart.
- (b) A polycrystalline aluminium alloy contains a dispersion of hard particles of diameter  $10^{-8} \text{ m}$  and average centre-to-centre spacing of  $6 \times 10^{-8} \text{ m}$  measured in the slip planes. Estimate their contribution to the tensile yield strength,  $\sigma_y$ , of the alloy.
- (c) The alloy is used for the compressor blades of a small turbine. Adiabatic heating raises the blade temperature to  $150^\circ\text{C}$ , and causes the particles to coarsen slowly. After 1000 hours they have grown to a diameter of  $3 \times 10^{-8} \text{ m}$  and are spaced  $18 \times 10^{-8} \text{ m}$  apart. Estimate the drop in yield strength. (The shear modulus of aluminium is  $26 \text{ GN m}^{-2}$ , and  $b = 0.286 \text{ nm}$ .)

Answers: (b)  $450 \text{ MN m}^{-2}$ , (c)  $300 \text{ MN m}^{-2}$ .

22. Nine strips of pure, fully annealed copper were deformed plastically by being passed between a pair of rotating rollers so that the strips were made thinner and longer. The increases in length produced were 1, 10, 20, 30, 40, 50, 60, 70 and 100% respectively. The diamond-pyramid hardness of each piece was measured after rolling. The results were

Nominal strain	0.01	0.1	0.2	0.3	0.4	0.5	0.6	0.7	1.0
Hardness/ $\text{MN m}^{-2}$	423	606	756	870	957	1029	1080	1116	1170

Assuming that a diamond-pyramid hardness test creates a further nominal strain, on average, of 0.08, and that the hardness value is 3.0 times the true stress with this extra strain, construct the curve of *nominal* stress against nominal strain, and find:

- the tensile strength of copper;
- the strain at which tensile failure commences;
- the percentage reduction in cross-sectional area at this strain;
- the work required to initiate tensile failure in a cubic metre of annealed copper.

Why can copper survive a much higher extension during rolling than during a tensile test?

*Answers:* (a)  $217 \text{ MN m}^{-2}$ , (b) 0.6 approximately, (c) 38%, (d) 109 MJ.

23. (a) If the *true stress–true strain* curve for a material is defined by

$$\sigma = A\epsilon^n, \text{ where } A \text{ and } n \text{ are constants,}$$

find the tensile strength  $\sigma_{\text{TS}}$ . (Method: first find the equation of the *nominal stress–nominal strain* curve, assuming flow does not localise. Differentiate to find the maximum of this curve. Hence find the strain corresponding to the tensile strength. Use this to find the tensile strength itself.)

- (b) For a nickel alloy,  $n = 0.2$ , and  $A = 800 \text{ MN m}^{-2}$ . Evaluate the tensile strength of the alloy. Evaluate the true stress in an alloy specimen loaded to  $\sigma_{\text{TS}}$ .

*Answers:* (a)  $\sigma_{\text{TS}} = \frac{An^n}{e^n}$ , (b)  $\sigma_{\text{TS}} = 475 \text{ MN m}^{-2}$ ,  $\sigma = 580 \text{ MN m}^{-2}$ .

24. (a) Discuss the assumption that, when a piece of metal is deformed at constant temperature, its volume is unchanged.
- (b) A ductile metal wire of uniform cross-section is loaded in tension until it just begins to neck. Assuming that volume is conserved, derive a differential expression relating the *true stress* to the *true strain* at the onset of necking.
- (c) The curve of true stress against true strain for the metal wire approximates to

$$\sigma = 350\epsilon^{0.4} \text{ MN m}^{-2}.$$

Estimate the tensile strength of the wire and the work required to take  $1 \text{ m}^3$  of the wire to the point of necking.

Answers: (c)  $163 \text{ MN m}^{-2}$ ,  $69.3 \text{ MJ}$ .

25. (a) One type of hardness test involves pressing a hard sphere (radius  $r$ ) into the test material under a fixed load  $F$ , and measuring the depth,  $h$ , to which the sphere sinks into the material, plastically deforming it. Derive an expression for the indentation hardness,  $H$ , of the material in terms of  $h$ ,  $F$  and  $r$ . Assume  $h \ll r$ .
- (b) The indentation hardness,  $H$ , is found to be given by  $H \approx 3\sigma_y$  where  $\sigma_y$  is the true yield stress at a nominal plastic strain of 8%. If (as in question 23) the true stress-strain curve of a material is given by

$$\sigma = A\epsilon^n$$

and  $n = 0.2$ , calculate the tensile strength of a material for which the indentation hardness is  $600 \text{ MN m}^{-2}$ . You may assume that  $\sigma_{\text{TS}} = An^n/e^n$  (see question 23).

Answers: (a)  $H = \frac{F}{2\pi rh}$ , (b)  $\sigma_{\text{TS}} = 198 \text{ MN m}^{-2}$ .

26. A metal bar of width  $w$  is compressed between two hard anvils as shown in Fig. A1.1. The third dimension of the bar,  $L$ , is much greater than  $w$ . Plastic deformation takes place as a result of shearing along planes, defined by the dashed lines in the figure, at a shear stress  $k$ . Find an upper bound for the load  $F$  when (a) there is no friction between anvils and bar, and (b) there is sufficient friction to effectively weld the anvils to the bar. Show that the solution to case (b) satisfies the general formula

$$F \leq 2wLk \left( 1 + \frac{w}{4d} \right)$$

which defines upper bounds for all integral values of  $w/2d$ .

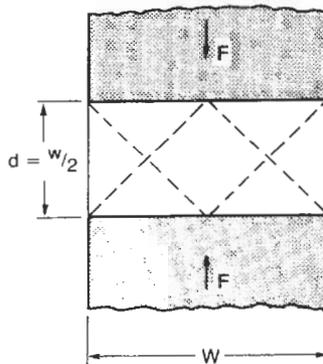


Fig. A1.1.

A composite material used for rock-drilling bits consists of an assemblage of tungsten carbide cubes (each  $2\ \mu\text{m}$  in size) stuck together with a thin layer of cobalt. The material is required to withstand compressive stresses of  $4000\ \text{MN m}^{-2}$  in service. Use the above equation to estimate an upper limit for the thickness of the cobalt layer. You may assume that the compressive yield stress of tungsten carbide is well above  $4000\ \text{MN m}^{-2}$ , and that the cobalt yields in shear at  $k = 175\ \text{MN m}^{-2}$ . What assumptions made in the analysis are likely to make your estimate inaccurate?

Answers: (a)  $2wLk$ , (b)  $3wLk$ ;  $0.048\ \mu\text{m}$ .

27. By calculating the plastic work done in each process, determine whether the bolt passing through the plate in Fig. A1.2 will fail, when loaded in tension, by yielding of the shaft or shearing-off of the head. (Assume no work-hardening.)

Answer: The bolt will fail by shearing-off of the head.

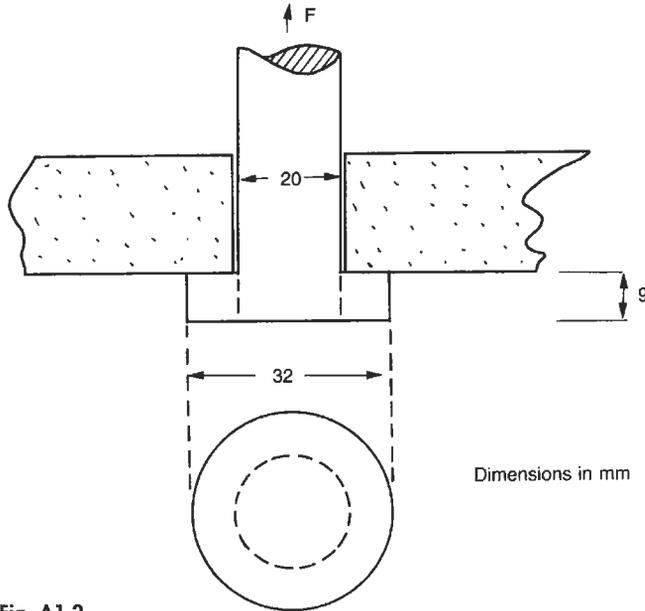


Fig. A1.2.

28. Sketch curves of the nominal stress against nominal strain obtained from tensile tests on (a) a typical ductile material, (b) a typical non-ductile material. The following data were obtained in a tensile test on a specimen with 50 mm gauge length and a cross-sectional area of  $160\ \text{mm}^2$ .

Extension/mm	0.050	0.100	0.150	0.200	0.250	0.300	1.25	2.50	3.75	5.00	6.25	7.50
Load/kN	12	25	32	36	40	42	63	80	93	100	101	90

The total elongation of the specimen just before final fracture was 16%, and the reduction in area at the fracture was 64%.

Find the maximum allowable working stress if this is to equal

- $0.25 \times$  Tensile strength,
- $0.6 \times$  0.1% proof stress.
- What would have been the elongation and maximum reduction in area if a 150 mm gauge length had been used?

*Answers:* (a)  $160 \text{ MN m}^{-2}$ ; (b)  $131 \text{ MN m}^{-2}$ ; (c) 12.85%, 64%.

29. A large thick plate of steel is examined by X-ray methods, and found to contain no detectable cracks. The equipment can detect a single edge-crack of depth  $a = 1 \text{ mm}$  or greater. The steel has a fracture toughness  $K_C$  of  $53 \text{ MN m}^{-3/2}$  and a yield strength of  $950 \text{ MN m}^{-2}$ . Assuming that the plate contains cracks on the limit of detection, determine whether the plate will undergo general yield or will fail by fast fracture before general yielding occurs. What is the stress at which fast fracture would occur?

*Answer:* Failure by fast fracture at  $946 \text{ MN m}^{-2}$ .

30. Two wooden beams are butt-jointed using an epoxy adhesive (Fig. A1.3). The adhesive was stirred before application, entraining air bubbles which, under pressure in forming the joint, deform to flat, penny-shaped discs of diameter  $2a = 2 \text{ mm}$ . If the beam has the dimensions shown, and epoxy has a fracture toughness of  $0.5 \text{ MN m}^{-3/2}$ , calculate the maximum load  $F$  that the beam can support. Assume  $K = \sigma\sqrt{\pi a}$  for the disc-shaped bubbles.

*Answer:* 2.97 kN.

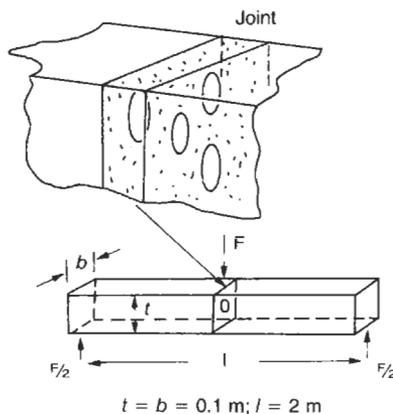


Fig. A1.3.

31. A component is made of a steel for which  $K_c = 54 \text{ MN m}^{-3/2}$ . Non-destructive testing by ultrasonic methods shows that the component contains cracks of up to  $2a = 0.2 \text{ mm}$  in length. Laboratory tests show that the crack-growth rate under cyclic loading is given by

$$\frac{da}{dN} = A(\Delta K)^4,$$

where  $A = 4 \times 10^{-13} (\text{MN m}^{-2})^{-4} \text{ m}^{-1}$ . The component is subjected to an alternating stress of range

$$\Delta\sigma = 180 \text{ MN m}^{-2}$$

about a mean tensile stress of  $\Delta\sigma/2$ . Given that  $\Delta K = \Delta\sigma\sqrt{\pi a}$ , calculate the number of cycles to failure.

*Answer:*  $2.4 \times 10^6$  cycles.

32. When a fast-breeder reactor is shut down quickly, the temperature of the surface of a number of components drops from  $600^\circ\text{C}$  to  $400^\circ\text{C}$  in less than a second. These components are made of a stainless steel, and have a thick section, the bulk of which remains at the higher temperature for several seconds. The low-cycle fatigue life of the steel is described by

$$N_f^{1/2} \Delta\epsilon^{\text{pl}} = 0.2$$

where  $N_f$  is the number of cycles to failure and  $\Delta\epsilon^{\text{pl}}$  is the plastic strain range. Estimate the number of fast shut-downs the reactor can sustain before serious cracking or failure will occur. (The thermal expansion coefficient of stainless steel is  $1.2 \times 10^{-5} \text{ K}^{-1}$ ; the appropriate yield strain at  $400^\circ\text{C}$  is  $0.4 \times 10^{-3}$ .)

*Answer:*  $10^4$  shut-downs.

33. (a) An aluminium alloy for an airframe component was tested in the laboratory under an applied stress which varied sinusoidally with time about a mean stress of zero. The alloy failed under a stress range,  $\Delta\sigma$ , of  $280 \text{ MN m}^{-2}$  after  $10^5$  cycles; under a range of  $200 \text{ MN m}^{-2}$ , the alloy failed after  $10^7$  cycles. Assuming that the fatigue behaviour of the alloy can be represented by

$$\Delta\sigma(N_f)^a = C$$

where  $a$  and  $C$  are material constants, find the number of cycles to failure,  $N_f$ , for a component subjected to a stress range of  $150 \text{ MN m}^{-2}$ .

- (b) An aircraft using the airframe components has encountered an estimated  $4 \times 10^8$  cycles at a stress range of  $150 \text{ MN m}^{-2}$ . It is desired to extend the airframe life by another  $4 \times 10^8$  cycles by reducing the performance of the aircraft. Find the

decrease in stress range necessary to achieve this additional life. You may assume a simple cumulative-damage law of the form

$$\sum_i \frac{N_i}{N_{fi}} = 1$$

for this calculation.

Indicate briefly how the following would affect the fatigue life of the components:

- (a) a good surface finish;
- (b) the presence of a rivet hole;
- (c) a significant mean tensile stress;
- (d) a corrosive atmosphere.

*Answers:* (a)  $5.2 \times 10^8$  cycles, (b)  $13 \text{ MN m}^{-2}$ .

34. A cylindrical steel pressure vessel of 7.5 m diameter and 40 mm wall thickness is to operate at a working pressure of  $5.1 \text{ MN m}^{-2}$ . The design assumes that failure will take place by fast fracture from a crack which has extended gradually along the length of the vessel by fatigue. To prevent fast fracture, the total number of loading cycles from zero to full load and back to zero again must not exceed 3000.

The fracture toughness for the steel is  $200 \text{ MN m}^{-3/2}$ . The growth of the crack by fatigue may be represented approximately by the equation

$$\frac{da}{dN} = A(\Delta K)^4,$$

where  $A = 2.44 \times 10^{-14} (\text{MN m}^{-2})^{-4} \text{ m}^{-1}$ ,  $da/dN$  is the extent of crack growth per load cycle and  $K$  is the stress intensity factor for the crack.

Find the minimum pressure to which the vessel must be tested before use to guarantee against failure in under the 3000 load cycles.

*Answer:*  $8.97 \text{ MN m}^{-2}$ .

35. Use your knowledge of diffusion to account for the following observations:

- (a) Carbon diffuses fairly rapidly through iron at  $100^\circ\text{C}$ , whereas chromium does not.
- (b) Diffusion is more rapid in polycrystalline silver with a small grain size than in coarse-grained silver.

Give an approximate expression for the time  $t$  required for significant diffusion to take place over a distance  $x$  in terms of  $x$ , and the diffusion coefficient,  $D$ . A component is made from an alloy of copper with 18% by weight of zinc. The

concentration of zinc is found to vary significantly over distances of 10  $\mu\text{m}$ . Estimate the time required for a substantial levelling out of the zinc concentration at 750°C. The diffusion coefficient for zinc in the alloy is given by

$$D = D_0 e^{-Q/\bar{R}T}$$

where  $\bar{R}$  is the universal gas constant and  $T$  is the absolute temperature. The constants  $D_0$  and  $Q$  have the values  $9.5 \text{ mm}^2 \text{ s}^{-1}$  and  $159 \text{ kJ mol}^{-1}$ , respectively.

Answers:  $t = x^2/D$ ; 23 min.

36. It is found that a force  $F$  will inject a given weight of a thermosetting polymer into an intricate mould in 30 s at 177°C and in 81.5 s at 157°C. If the viscosity of the polymer follows an *Arrhenius Law*, with a rate of process proportional to  $e^{-Q/\bar{R}T}$ , calculate how long the process will take at 227°C.

Answer: 3.5 s.

37. Explain what is meant by *creep* in materials. What are the characteristics of a creep-resistant material?

A cylindrical tube in a chemical plant is subjected to an excess internal pressure of  $6 \text{ MN m}^{-2}$ , which leads to a circumferential stress in the tube wall. The tube wall is required to withstand this stress at a temperature of 510°C for 9 years. A designer has specified tubes of 40 mm bore and 2 mm wall thickness made from a stainless alloy of iron with 15% by weight of chromium. The manufacturer's specification for this alloy gives the following information:

Temperature (°C)	618	640	660	683	707
Steady-state creep rate $\dot{\epsilon}$ ( $\text{s}^{-1}$ ), for an applied tensile stress $\sigma$ of $200 \text{ MN m}^{-2}$	$1.0 \times 10^{-7}$	$1.7 \times 10^{-7}$	$4.3 \times 10^{-7}$	$7.7 \times 10^{-7}$	$2.0 \times 10^{-6}$

Over the present ranges of stress and temperature the alloy can be considered to creep according to the equation

$$\dot{\epsilon} = A\sigma^5 e^{-Q/\bar{R}T}$$

where  $A$  and  $Q$  are constants,  $\bar{R}$  is the universal gas constant, and  $T$  is the absolute temperature. Given that failure is imminent at a creep strain of 0.01 for the present alloy, comment on the safety of the design.

Answer: Strain over 9 years = 0.00057; design safe.

38. Explain what is meant by *diffusion* in materials. Account for the variation of diffusion rates with (a) temperature, (b) concentration gradient and (c) grain size.

An alloy tie bar in a chemical plant has been designed to withstand a stress,  $\sigma$ , of  $25 \text{ MN m}^{-2}$  at 620°C. Creep tests carried out on specimens of the alloy under

these conditions indicated a steady-state creep-rate,  $\dot{\epsilon}$ , of  $3.1 \times 10^{-12} \text{ s}^{-1}$ . In service it was found that, for 30% of the running time, the stress and temperature increased to  $30 \text{ MN m}^{-2}$  and  $650^\circ\text{C}$ . Calculate the average creep-rate under service conditions. It may be assumed that the alloy creeps according to the equation

$$\dot{\epsilon} = A\sigma^5 e^{-Q/\bar{R}T}$$

where  $A$  and  $Q$  are constants,  $\bar{R}$  is the universal gas constant and  $T$  is the absolute temperature.  $Q$  has a value of  $160 \text{ kJ mol}^{-1}$ .

*Answer:*  $6.82 \times 10^{-12} \text{ s}^{-1}$ .

39. The oxidation of a particular metal in air is limited by the outward diffusion of metallic ions through an unbroken surface film of one species of oxide. Assume that the concentration of metallic ions in the film immediately next to the metal is  $c_1$ , and that the concentration of ions in the film immediately next to the air is  $c_2$ , where  $c_1$  and  $c_2$  are constants. Use Fick's First Law to show that the oxidation of the metal should satisfy parabolic kinetics, with weight gain  $\Delta m$  given by

$$(\Delta m)^2 = k_p t.$$

The oxidation of another metal is limited by the outward flow of electrons through a uniform, unbroken oxide film. Assume that the electrical potential in the film immediately next to the metal is  $V_1$ , and the potential immediately next to the free surface is  $V_2$ , where  $V_1$  and  $V_2$  are constants. Use Ohm's Law to show that parabolic kinetics should apply in this case also.

40. The kinetics of oxidation of mild steel at high temperature are parabolic, with

$$k_p \text{ (kg}^2 \text{ m}^{-4} \text{ s}^{-1}\text{)} = 37 \exp \left\{ - \frac{138 \text{ kJ mol}^{-1}}{\bar{R}T} \right\}.$$

Find the depth of metal lost from the surface of a mild steel tie bar in a furnace at  $500^\circ\text{C}$  after 1 year. You may assume that the oxide scale is predominantly FeO. The atomic weight and density of iron are  $55.9 \text{ kg kmol}^{-1}$  and  $7.87 \text{ Mg m}^{-3}$ ; the atomic weight of oxygen is  $16 \text{ kg kmol}^{-1}$ . What would be the loss at  $600^\circ\text{C}$ ?

*Answers:* 0.33 mm at  $500^\circ\text{C}$ ; 1.13 mm at  $600^\circ\text{C}$ .

41. Explain the following observations, using diagrams to illustrate your answer wherever you can.
- (a) A reaction vessel for a chemical plant was fabricated by welding together stainless-steel plates (containing 18% chromium, 8% nickel and 0.1% carbon by weight). During service the vessel corroded badly at the grain boundaries near the welds.

- (b) Mild-steel radiators in a central-heating system were found to have undergone little corrosion after several years' service.
- (c) In order to prevent the corrosion of a mild-steel structure immersed in sea water, a newly qualified engineer suggested the attachment of titanium plates in the expectation of powerful cathodic action. He later found to his chagrin that the structure had corroded badly.
42. Explain the following observations, using diagrams to illustrate your answer wherever possible:
- (a) Diffusion of aluminium into the surface of a nickel super-alloy turbine blade reduced the rate of high-temperature oxidation.
- (b) Steel nails used to hold copper roofing sheet in position failed rapidly by wet corrosion.
- (c) The corrosion of an underground steel pipeline was greatly reduced when the pipeline was connected to a buried bar of magnesium alloy.
43. (a) Measurements of the rate of crack growth in brass exposed to ammonium sulphate solution and subjected to a constant tensile stress gave the following data:

Nominal stress $\sigma$ ( $\text{MN m}^{-2}$ )	Crack depth $a$ (mm)	Crack growth rate $da/dt$ ( $\text{mm year}^{-1}$ )
4	0.25	0.3
4	0.50	0.6
8	0.25	1.2

Show that these data are consistent with a relationship of form

$$\frac{da}{dt} = AK^n$$

where  $K = \sigma\sqrt{\pi a}$  is the stress intensity factor. Find the values of the integer  $n$  and the constant  $A$ .

- (b) The critical strain energy release rate,  $G_c$ , for brass in the present environment is  $55 \text{ kJ m}^{-2}$ , with a Young's modulus of  $110 \text{ GN m}^{-2}$ . It is proposed to use the brass for piping in an ammonium sulphate plant. The pipes must sustain a circumferential tensile stress of  $85 \text{ MN m}^{-2}$ , and experience has shown that longitudinal scratches  $0.02 \text{ mm}$  deep are likely to occur on the inner surfaces of the pipes. Estimate the time that a pipe would last without fracturing once the solution started to flow through it.
- (c) How might you protect the inside of the pipe against chemical attack?

Answers: (a)  $n = 2$ ,  $A = 0.0239 \text{ m}^4 \text{ MN}^{-2} \text{ year}^{-1}$ ; (b) 6.4 days.

44. Under aggressive corrosion conditions it is estimated that the maximum corrosion current density in a galvanised steel sheet will be  $6 \times 10^{-3} \text{ A m}^{-2}$ . Estimate the thickness of the galvanised layer needed to give a rust-free life of at least 5 years. The density of zinc is  $7.13 \text{ Mg m}^{-3}$ , and its atomic weight is 65.4. Assume that the zinc corrodes to give  $\text{Zn}^{2+}$  ions.

*Answer:* 0.045 mm.

45. A sheet of steel of thickness 0.50 mm is tinplated on both sides and subjected to a corrosive environment. During service, the tinplate becomes scratched, so that steel is exposed over 0.5% of the area of the sheet. Under these conditions it is estimated that the current consumed at the tinned surface by the oxygen-reduction reaction is  $2 \times 10^{-3} \text{ A m}^{-2}$ . Will the sheet rust through within 5 years in the scratched condition? The density of steel is  $7.87 \text{ Mg m}^{-3}$ . Assume that the steel corrodes to give  $\text{Fe}^{2+}$  ions. The atomic weight of iron is 55.9.

*Answer:* Yes.

46. (a) Explain the origins of friction between solid surfaces in contact.  
 (b) Soft rubbers do not obey the law of friction  $F_s = \mu_s P$  (where  $F_s$  is the sliding force,  $P$  the normal force acting across the surfaces and  $\mu_s$  the coefficient of static friction). Instead,  $F_s$  increases with the nominal contact area  $A$  (for this reason racing cars have wide tyres). Explain this.  
 (c) How does lubrication reduce friction? How can friction between road and tyre be maintained even under conditions of appreciable lubrication?
47. It is observed that snow lies stably on roofs with a slope of less than  $24^\circ$ , but that it slides off roofs with a greater slope. Skiers, on the other hand, slide on a snow-covered mountain side with a slope of only  $2^\circ$ . Why is this?

A man of weight 100 kg standing on skis 2 m long and 0.10 m wide slides on the  $2^\circ$  mountain slope, at  $0^\circ\text{C}$ . Calculate the work done against friction when the ski slides a distance equal to its own length. Hence calculate the average thickness of the water film beneath each ski. (The latent heat of fusion of ice is  $330 \text{ MJ m}^{-3}$ .)

*Answers:* Work done 69 J; average film thickness =  $0.5 \mu\text{m}$ .

# Appendix 2

## Aids and demonstrations

---

The following is a summary of visual aids (slides, artefacts and demonstrations) that may be found helpful in presenting the material in this book. Material for slides may be found in this book; in the further reading at the ends of the chapters; and in other readily available sources (indicated by references [1] to [5] and listed at the end of Appendix 2). Where material for slides needs to be found from more specialised publications and reports we have given appropriate references. Copyright permission should, of course, be obtained where applicable.

### Chapter 1

*Slides:* S. S. Schenectady after fast fracture in dock [1]; sectioned drawing of turbofan aero-engine [2]; sectioned drawing of spark plug; sailing cruisers (from yachting magazines); bridges.

*Artefacts:* Screwdrivers; dismantled spark plug; PVC yachting anorak, polymer rope, etc.

### Chapter 2

*Slides:* Map of World (to illustrate strategic factors); open-cast copper mine (to emphasise energy needed to extract ores); recycling of scrap metals, glass, building materials, etc.

### Chapter 3

*Slides:* Vaulting pole, springs, girders (for extremes of stiffness).

*Demonstrations:* (a) Foam polyurethane  $\approx 40 \times 5 \times 5$  cm pulled along its length in tension. (b) Foam  $\approx 60 \times 60 \times 10$  cm glued into square wooden frame hinged at all four corners and sheared. (c) Foam  $\approx 20$ -cm cube loaded in compression by 10-kg weight on wooden platten to give  $\approx 4\%$  strain;  $E \approx 10^{-4}$  GN m<sup>-2</sup>. (d) Rods of steel, glass, wood  $\approx 6$  mm diameter  $\times 0.75$  m long suspended by string at each end (Fig. 3.4) with 0.5-kg weight at mid point;  $f$  values  $\approx 10, 6$  and  $2$  s<sup>-1</sup>.

### Chapter 4

*Demonstrations:* (a) Atom spring models (Fig. 4.2) on overhead projector to illustrate effect of structure on modulus. (b) Large models of Na atom and Cl atom. (c) Liquid nitrogen.

## Chapter 5

*Demonstrations:* (a) Give four injection-moulded close-packed planes to each student to allow personal building of f.c.c. and c.p.h. (b) Atomix atomic model on overhead projector to show atom packing (Emotion Productions Inc., 4825 Sainte Catherine O, Montreal 215PQ, Canada); or ball bearings on overhead projector.

## Chapter 6

*Slides:* Microstructures of GFRP, glass-filled polymer, cermet, wood; sectioned piece of cord-reinforced automobile tyre.

*Demonstrations:* (a) Put 15-mm rubber tube into vacuum flask of liquid nitrogen – tube should have steel rod inside to keep it straight. Take tube out after 3 min and remove steel rod (wearing gloves). Support tube horizontally with lagged support at each end. Load centre of span with 0.5-kg weight and lagged hook. Rubber will become floppy after 1–2 min. (b) Glue alternate sheets of foam polyurethane and plywood together to make a sandwich composite – stiff one way, very floppy the other.

## Chapter 7

*Slides:* Of reflecting telescopes, aeroplanes, space capsules, bicycles (to illustrate applications of stiff but light materials).

## Chapter 8

*Slides:* Slab and sheet metal rolling; extrusion, etc., of polymers; tensile-testing machines; hardness-testing machines; hardness indentations.

*Demonstrations:* (a) Pull rubber band on overhead projector to show large elastic strain. (b) Take a piece of plasticine modelling material (Harbutt Ltd., Bathampton, Bath BA2 6TA, England; from most toy shops) and roll into a rod  $\approx 2.5$  cm diameter  $\times$  12 cm long. Form central portion to give slightly reduced gauge section. Pull on overhead projector to show elastic and plastic deformation and necking.

## Chapter 9

*Demonstrations:* (a) Take offcut of carpet  $\approx 0.5 \times 3$  m; put on bench and pass rucks along (Fig. 9.6). (b) Raft of pencils on overhead projector to simulate plank analogy (Fig. 9.10).

## Chapter 10

*Slides:* Microstructures showing precipitates; electron micrographs of dislocation tangles; micrographs of polycrystalline metals.

*Demonstrations:* (a) Atomix (to show grain boundaries). (b) Model of dispersion strengthening. Take piece of PMMA sheet  $\approx 2.5$  mm thick and  $\approx 7$  cm square. Glue four PMMA strips of section  $\approx 7 \times 7$  mm on top of the sheet to form a tray  $\approx 7$  mm deep. Cut six  $\approx 7$ -mm lengths of an  $\approx 6$ -mm-diameter PMMA rod. Glue the ends of these to

the bottom of the tray to form a line of 'stepping stones' spaced equally ( $\approx 3\text{mm}$ ) apart and going straight across the centre of the tray from edge to edge. Cap the top of each stepping stone with a 6-mm self-adhesive disc. Lightly grease the inside of the tray and also the stepping stones. Place tray on overhead projector. Gently pour coloured water into one side of tray until water is near stepping-stone obstacles. Tilt tray up slightly to allow water to run up to obstacles. Show bowing of water meniscus between obstacles, with eventual breakthrough; the surface tension of the water is analogous to the line tension of a dislocation, and regions where the water has broken through are analogous to regions of the crystal that have undergone plastic deformation by amount  $b$ .

### Chapter 11

*Slides:* Necked tensile specimens of metals; deep drawing operations and deep-drawn cans, etc.

*Demonstrations:* (a) Push two very blunt wooden wedges together on overhead projector (Fig. 11.1) to show shearing under compressive loading. (b) Make two-dimensional working model of Fig. 11.4 out of PMMA sheet for use on overhead projector (note – remove offending apexes to allow movement, and put markers on either side of shear planes to show up the shear displacements on the overhead). (c) Necking of plasticine on overhead projector (see demonstration in Chapter 8). (d) Stable necking of polyethylene. Cut a gauge length  $\approx 7 \times 70\text{mm}$  from polyethylene sheet (length of specimen parallel to roll direction of sheet). Pull in tension on overhead, and observe propagation of stable neck.

### Chapter 12

*Slides:* Springs of various types; multi-leaf springs on trucks, automobiles, steam locomotives, etc.; light pressure vessels – e.g. aeroplane fuselages; cheap pressure vessels – e.g. water tanks, nuclear reactor vessels; metal rolling stand.

*Demonstrations:* Take a strip  $\approx 0.25\text{mm} \times 1\text{cm} \times 15\text{cm}$  of cold-rolled (work-hardened) brass and bend it (on edge) on the overhead until permanent deformation takes place. Anneal brass strip at bright red heat for  $\approx 0.5\text{min}$  to soften it.\* After cooling replace on overhead and show that permanent deformation takes place at a much smaller deflection than before. This illustrates the importance of large  $\sigma_y$  in springs.

\* For this and subsequent demonstrations involving a heat source, use a gas torch such as the Sievert self-blowing propane outfit (W. A. Meyer Ltd., 9/11 Gleneldon Road, London SW16 2AU, or from most tool shops): this comprises 3.9-kg propane bottle, 3085 hose-failure valve, fitted pressure hose no. 16310, 3486 torch, 2941 burner.

### Chapter 13

*Slides:* Fast-structure failures in ships [1], pressure vessels, pipelines, flywheels, etc.

*Demonstrations:* (a) Balloons and safety pin (see Chapter 13, p. 121). Afterwards, put fractured edges of balloon rubber on overhead to show that wavy fracture path closely parallels that seen when metals have undergone fast fracture. (b)  $G_c$  for Sellotape (see Chapter 13, p. 122).

## Chapter 14

*Slides:* Plastic cavitation around inclusions in metals (e.g. metallographic section through neck in tensile specimen); SEM pictures of fracture surfaces in ductile metals, glass, alkali halide crystals.

*Artefacts:* Damaged piece of GFRP to show opacity caused by debonding.

*Demonstrations:* (a) Take piece of plasticine  $\approx 1 \times 3 \times 10$  cm. Using knife put notch  $\approx 5$  mm deep into long edge. Pull on overhead and watch notch tip blunting by plastic flow. (b) Pull plasticine to failure to show high toughness and rough fracture surface. (c) Notch  $\approx 5$ -mm-diameter glass rod with sharp triangular file and break on overhead to show low toughness and smooth fracture surface. (d) Put rubber tube in liquid nitrogen for  $\approx 2$  min; remove and smash with hammer *behind safety screens* to show low toughness. (e) Heat an  $\approx 2$ -mm-diameter medium carbon steel rod to bright red and quench into water. Using fingers, snap rod on overhead to show low toughness. Harden a second rod, but reheat it to give a light blue colour. Show that this tempering makes it much harder to snap the rod (use thick gloves and safety glasses in (c), (d) and (e) and put a safety screen between these demonstrations and the audience).

## Chapter 15

*Slides:* Fatigue fracture surfaces; components failed by fatigue, e.g. gear teeth, half-shafts, etc.

*Demonstration:* Make a pendulum comprising some 5-A fuse wire hanging from a horizontal knife-edge and carrying a 0.5-kg weight. Make the length of the fuse wire in pendulum  $\approx 15$  cm. Make the weight oscillate with amplitude  $\approx 7$  cm. Flexing of the wire where it passes over the knife edge will lead to fatigue failure after  $\approx 1$  min.

## Chapter 16

*Slides:* Ultrasonic crack detection; hydraulic testing.

## Chapter 17

*Slides:* Tungsten filaments, turbine blades, lead drain pipes and organ pipes, glaciers; creep-testing rigs; micrographs of creep cavities.

*Demonstrations:* (a) Wind  $\approx 2$ -cm-diameter, 8-cm-long coil of  $\approx 1.5$ -mm-diameter Pb–Sn solder. Suspend coil from one end and observe marked creep extension of coil after  $\approx 15$  min at room temperature. (b) Observe self-weight creep of  $\approx 45$ -cm length of  $\approx 1$ -cm-diameter polyethylene tube held horizontally at one end. (c) Support an  $\approx 2$ -mm-diameter steel wire horizontally at one end. Hang a 20-g weight from the free end. Support a second identical length of wire immediately alongside the first, and hang a 40-g weight from its free end. Heat the pair of wires to red heat at their clamped ends and observe creep; note that the creep rate of the second wire is much more than twice that of the first, illustrating power-law creep.

### Chapter 18

*Demonstrations:* (a) Inject a drop of coloured dye under the surface of a very shallow stagnant pool of water in a Petri dish on the overhead. Observe dye spreading by diffusion with time. (b) Atomix to show vacancies, and surface diffusion.

### Chapter 19

*Demonstration:* Fit up a dashpot and spring model (Fig. 19.8) and hang it from a support. Hang a weight on the lower end of the combination and, using a ruler to measure extension, plot the creep out on the blackboard. Remove weight and plot out the reverse creep.

### Chapter 20

*Slides:* Turbofan aero-engine; super-alloy turbine blades, showing cooling ports [3]; super-alloy microstructures [4]; DS eutectic microstructures [3, 5]; ceramic turbine blades.

### Chapter 21

*Slides:* Pitting corrosion on a marine turbine blade [4]; corroded tie bars, etc., in furnaces, heat exchangers, etc.; oxidised cermets.

*Demonstrations:* (a) Heat one end of a  $\approx 2 \times 5 \times 120$ -mm piece of lightly abraded mild steel in the gas flame. After  $\approx 1$  min at bright red heat, plunge into cold water in a dish on the overhead. Oxide flakes will spall off into the water leaving a bright metal surface. (b) Lightly abrade a  $\approx 0.1$ -mm  $\times 5$ -cm  $\times 5$ -cm piece of copper shim. Play the gas flame on one side of it, using the reducing region of the flame, and keep at medium red heat for  $\approx 1$  min. Then plunge immediately into cold water. Place shim on edge on overhead to show pronounced bending effect. This shows the effect of oxygen partial pressure on oxidation rate. The metal in contact with the reducing flame has a negligibly thin oxide layer; the oxide layer on the other side, where oxygen was available, is quite thick. The differential thermal contraction between this thick layer and the copper has caused a 'bimetallic strip' effect.

### Chapter 22

*Slides:* Microstructures of oxide layers and oxide-resistant coatings on metals and alloys; selective attack of eutectic alloys [5].

*Demonstrations:* Take a piece of  $0.1$ -mm  $\times 5$ -cm  $\times 5$ -cm stainless-steel shim, and a similar piece of mild-steel shim. Degrease, and weigh both. Heat each for  $\approx 1$  min in the gas flame to bright red heat. The mild-steel shim will gain weight by more than  $\approx 0.05$  g. The stainless-steel shim will not gain weight significantly.

### Chapter 23

*Slides:* Corroded automobiles, fences, roofs; stress-corrosion cracks, corrosion-fatigue cracks, pitting corrosion.

*Demonstrations:* Mix up an indicator solution as follows: dissolve 5 g of potassium ferricyanide in 500 cm<sup>3</sup> distilled water. Dissolve 1 g of phenolphthalein in 100 cm<sup>3</sup> ethyl alcohol. Take 500 cm<sup>3</sup> of distilled, aerated water and to it add 5 g sodium chloride. Shake until dissolved. Add 15 cm<sup>3</sup> of the ferricyanide solution and shake. Gradually add 45 cm<sup>3</sup> of phenolphthalein solution, shaking all the time (but stop adding this if the main solution starts to go cloudy). (a) Pour indicator solution into a Petri dish on the overhead. Degrease and lightly abrade a steel nail and put into dish. After  $\approx$  10 min a blue deposit will form by the nail, produced by reaction between Fe<sup>++</sup> and the ferricyanide and showing that the iron is corroding. A pink colour will also appear, produced by reaction between OH<sup>-</sup> and phenolphthalein, and showing that the oxygen-reduction reaction is taking place. (b) Modify a voltmeter so that the needle can be seen when put on the overhead. Wire up to galvanic couples of metals such as Cu, Fe, Zn, and Pt foil in salty water and show the voltage differences.

## Chapter 24

*Slides:* Covering pipelines with polymeric films; cathodic protection of pipelines, ships, etc., with zinc bracelets; use of inert polymers in chemical plant; galvanic corrosion in architecture (e.g. Al window frames held with Cu bolts); weld decay.

*Artefacts:* Galvanised steel sheet, new and old; anodised Al; polymeric roofing material; corroded exhaust system.

*Demonstrations:* (a) Put indicator solution in Petri dish on overhead. Take steel nail and solder a Zn strip to it. Degrease, lightly abrade, and put in solution. No blue will appear, showing that the Fe is cathodically protected by the Zn. Pink will appear due to OH<sup>-</sup> (produced by the oxygen-reduction reaction) because the Zn is corroding. (b) Put two degreased and lightly abraded steel nails in indicator solution on overhead. Wire a 4.5-V battery across them. Observe blue at one nail, pink at the other. This illustrates imposed-potential protection. (c) Solder a piece of Cu to a steel nail. Degrease, lightly abrade, and put in solution on overhead. Observe rapid build-up of blue at nail, pink at Cu, showing fast corrosion produced by mixing materials having different wet corrosion voltages.

## Chapter 25

*Slides:* Bearings; brake linings; grinding and metal-cutting operations; taper sections of metal surfaces.

*Demonstrations:* (a) Block on inclined plane to determine  $\mu$ . (b) Make a pair of rough surfaces from plasticine. Press together on overhead to show junction deformation. Shear on overhead to show origin of frictional force. (c) Gouge fragments out of plasticine on overhead using a serrated piece of wood to simulate abrasive wear. (d) Write on blackboard using chalk. Light 'pressure' leaves little chalk on board – heavy 'pressure' leaves a lot of chalk, showing dependence of adhesive wear rate on contact force.

## Chapter 26

*Slides:* Split-shell bearings; hard particles embedded in soft bearing alloys; micrograph of section through layered bearing shell; skiers; automobile tyres.

*Artefacts:* Skis sectioned to show layered construction.

*Demonstrations:* (a) Put lump of plasticine between plattens of hand-operated hydraulic press. Monitor compressive straining of plasticine with a dial gauge. Plot load against compression on the blackboard. Show how plastic constraint when the plasticine is squashed down to a very thin layer vastly increases the load it can support. (b) Take a piece  $\approx 1.5 \times 5 \times 5$ -cm low-loss rubber. Show that it is low loss by dropping an  $\approx 3$ -cm-diameter steel ball on to it, giving large rebound. Repeat with a piece of high-loss rubber, giving little rebound. Make an inclined plane of frosted glass, and soap it. Place the pads of rubber at the top of the plane, and adjust angle of plane until low-loss pad slides rapidly downhill but high-loss pad slides only slowly if at all. (It is worth spending some extra time in building a pair of toy clockwork-driven tractors, one shod with low-loss tyres, the other with high-loss. Provided the slope of the ramp is suitably adjusted, the low-loss tractor will be unable to climb the soaped slope, but the high-loss one will.)

## Chapter 27

*Slides:* Cars; steel-pressing plant; car assembly line; hand lay-up of GFRP; polymer moulding plant.

1. *Final Report of a Board of Investigation – The Design and Methods of Construction of Welded Steel Merchant Vessels*, Government Printing Office, Washington, DC, USA, 1947.
2. Coloured wall chart obtainable from Rolls-Royce Ltd., P.O. Box 31, Derby DE2 8BJ, England.
3. *Current and Future Materials Usage in Aircraft Gas Turbine Engines*, Metals and Ceramics Information Center, Battelle Laboratories, 505 King Avenue, Columbus, Ohio 43201, USA.
4. *The Nimonic Alloys*, 2nd edition. W. Betteridge and J. Heslop, Arnold, 1974.
5. *Conference on In-Situ Composites II*, edited by M. R. Jackson, J. L. Walter, F. D. Lemkey and R. W. Hertzberg, Xerox Publishing. 191 Spring Street, Lexington, Mass. 02173, USA, 1976.

# Appendix 3

## Symbols and formulae

---

### List of principal symbols

<i>Symbol</i>	<i>Meaning (units)</i>
Note:	Multiples or sub-multiples of basic units indicate the unit suffixes typically used with materials data.
$a$	side of cubic unit cell (nm)
$a$	crack length (mm)
$a$	constant in Basquin's Law (dimensionless)
$A$	constant in fatigue crack-growth law
$A$	constant in creep law $\dot{\epsilon}_{ss} = A\sigma^n e^{-Q/RT}$
$\mathbf{b}$	Burgers vector (nm)
$b$	constant in Coffin–Manson Law (dimensionless)
$c$	concentration ( $\text{m}^{-3}$ )
$C_1$	constant in Basquin's Law ( $\text{MN m}^{-2}$ )
$C_2$	constant in Coffin–Manson Law (dimensionless)
$D$	diffusion coefficient ( $\text{m}^2 \text{s}^{-1}$ )
$D_0$	pre-exponential constant in diffusion coefficient ( $\text{m}^2 \text{s}^{-1}$ )
$E$	Young's modulus of elasticity ( $\text{GN m}^{-2}$ )
$f$	force acting on unit length of dislocation line ( $\text{N m}^{-1}$ )
$F$	force (N)
$g$	acceleration due to gravity on the Earth's surface ( $\text{ms}^{-2}$ )
$G$	shear modulus ( $\text{GN m}^{-2}$ )
$G_c$	toughness (or critical strain energy release rate) ( $\text{kJ m}^{-2}$ )
$H$	hardness ( $\text{kg mm}^{-2}$ )
$J$	diffusion flux ( $\text{m}^{-2} \text{s}^{-1}$ )
$k$	shear yield strength ( $\text{MN m}^{-2}$ )
$k$	Boltzmann's constant $\bar{R}/N_A$ ( $\text{J K}^{-1}$ )
$K$	bulk modulus ( $\text{GN m}^{-2}$ )
$K$	stress intensity factor ( $\text{MN m}^{-3/2}$ )
$K_c$	fracture toughness (critical stress intensity factor) ( $\text{MN m}^{-3/2}$ )
$\Delta K$	$K$ range in fatigue cycle ( $\text{MN m}^{-3/2}$ )
$m$	constant in fatigue Crack Growth Law (dimensionless)
$n$	creep exponent in $\dot{\epsilon}_{ss} = A\sigma^n e^{-Q/RT}$
$N$	number of fatigue cycles
$N_A$	Avogadro's number ( $\text{mol}^{-1}$ )
$N_f$	number of fatigue cycles leading to failure (dimensionless)
$\bar{p}$	price of material (UK£ or US\$ $\text{tonne}^{-1}$ )
$Q$	activation energy per mole ( $\text{kJ mol}^{-1}$ )
$r_0$	equilibrium interatomic distance (nm)
$\bar{R}$	universal gas constant ( $\text{J K}^{-1} \text{mol}^{-1}$ )
$S_0$	bond stiffness ( $\text{N m}^{-1}$ )
$t_f$	time-to-failure (s)
$T$	line tension of dislocation (N)
$T$	absolute temperature (K)

<i>Symbol</i>	<i>Meaning (units)</i>
$T_M$	absolute melting temperature (K)
$U^{el}$	elastic strain energy (J)
$\gamma$	(true) engineering shear strain (dimensionless)
$\Delta$	dilatation (dimensionless)
$\epsilon$	true (logarithmic) strain (dimensionless)
$\epsilon_f$	(nominal) strain after fracture; tensile ductility (dimensionless)
$\epsilon_n$	nominal (linear) strain (dimensionless)
$\epsilon_0$	permittivity of free space ( $F\ m^{-1}$ )
$\epsilon_{ss}$	steady-state tensile strain-rate in creep ( $s^{-1}$ )
$\Delta\epsilon^{pl}$	plastic strain range in fatigue (dimensionless)
$\mu_k$	coefficient of kinetic friction (dimensionless)
$\mu_s$	coefficient of static friction (dimensionless)
$\nu$	Poisson's ratio (dimensionless)
$\rho$	density ( $Mg\ m^{-3}$ )
$\sigma$	true stress ( $MN\ m^{-2}$ )
$\sigma_n$	nominal stress ( $MN\ m^{-2}$ )
$\sigma_{TS}$	(nominal) tensile strength ( $MN\ m^{-2}$ )
$\sigma_y$	(nominal) yield strength ( $MN\ m^{-2}$ )
$\bar{\sigma}$	ideal strength ( $GN\ m^{-2}$ )
$\Delta\sigma$	stress range in fatigue ( $MN\ m^{-2}$ )
$\tau$	shear stress ( $MN\ m^{-2}$ )

### Summary of principal formulae and of magnitudes

#### Chapter 2: Exponential Growth

$$\frac{dC}{dt} = \frac{rC}{100}$$

$C$  = consumption rate ( $\text{tonne year}^{-1}$ );  $r$  = fractional growth rate ( $\% \text{ year}^{-1}$ );  $t$  = time.

#### Chapter 3: Definition of Stress, Strain, Poisson's Ratio, Elastic Moduli

$$\sigma = \frac{F}{A} \quad \tau = \frac{F_s}{A} \quad p = -\frac{F}{A} \quad \nu = -\frac{\text{lateral strain}}{\text{tensile strain}}$$

$$\epsilon_n = \frac{u}{l} \quad \gamma = \frac{w}{l} \quad \Delta = \frac{\Delta V}{V}$$

$$\sigma = E\epsilon_n \quad \tau = G\gamma \quad p = -K\Delta$$

$F(F_s)$  = normal (shear) component of force;  $A$  = area;  $u(w)$  = normal (shear) component of displacement;  $\sigma(\epsilon_n)$  = true tensile stress (nominal tensile strain);  $\tau(\gamma)$  = true shear stress (true engineering shear strain);  $p(\Delta)$  = external pressure (dilatation);  $\nu$  = Poisson's ratio;  $E$  = Young's modulus;  $G$  = shear modulus;  $K$  = bulk modulus.

**Chapter 8: Nominal and True Stress and Strain, Energy of Deformation**

$$\sigma_n = \frac{F}{A_0}; \quad \sigma = \frac{F}{A}; \quad \epsilon_n = \frac{u}{l_0} = \frac{l - l_0}{l_0}; \quad \epsilon = \int_{l_0}^l \frac{dl}{l} = \ln \left( \frac{l}{l_0} \right),$$

$A_0 l_0 = Al$  for plastic deformation; or for elastic or elastic/plastic deformation when  $\nu = 0.5$ . Hence

$$\sigma = \sigma_n (1 + \epsilon_n).$$

Also

$$\epsilon = \ln (1 + \epsilon_n).$$

Work of deformation, per unit volume:

$$U = \int_{\epsilon_{n1}}^{\epsilon_{n2}} \sigma_n d\epsilon_n = \int_{\epsilon_1}^{\epsilon_2} \sigma d\epsilon.$$

For linear-elastic deformation *only*

$$U = \frac{\sigma_n^2}{2E}.$$

Hardness,

$$H = F/A,$$

$\sigma_n$  = nominal stress,  $A_0(l_0)$  = initial area (length),  $A(l)$  = current area (length);  $\epsilon$  = true strain.

**Chapters 9 and 10: Dislocations**

The dislocation yield-strength,

$$\tau_y = \frac{\tilde{c}T}{bL}$$

$$\sigma_y = 3\tau_y,$$

$T$  = line tension (about  $Gb^2/2$ );  $b$  = Burgers vector;  $L$  = obstacle spacing;  $\tilde{c}$  = constant ( $\tilde{c} = 2$  for strong obstacles;  $\tilde{c} < 2$  for weak obstacles);  $\sigma_y$  = yield strength.

**Chapter 11: Plasticity**

Shear yield stress,

$$k = \sigma_y / 2.$$

Hardness,

$$H \approx 3\sigma_y.$$

Necking starts when

$$\frac{d\sigma}{d\epsilon} = \sigma.$$

**Chapter 13 and 14: Fast Fracture**

The stress intensity

$$K = Y\sigma \sqrt{\pi a}; Y \approx 1.$$

Fast fracture occurs when

$$K = K_c = \sqrt{EG_c},$$

$a$  = crack length;  $Y$  = dimensionless constant;  $K_c$  = critical stress intensity or fracture toughness;  $G$  = critical strain energy release rate or toughness.

**Chapter 15: Fatigue**

No pre-cracks

Basquin's Law (high cycle)

$$\Delta\sigma N_f^q = C_1.$$

Coffin–Manson Law (low cycle)

$$\Delta\epsilon^{Pl} N_f^b = C_2.$$

Goodman's Rule

$$\Delta\sigma \text{ (for } \sigma_m = \sigma_m) = \Delta\sigma \text{ (for } \sigma_m = 0) \left\{ 1 - \frac{\sigma_m}{\sigma_{TS}} \right\}.$$

Miner's Rule for cumulative damage

$$\sum_i \frac{N_i}{N_{fi}} = 1.$$

For pre-cracked materials

Crack Growth Law

$$\frac{da}{dN} = A\Delta K^m.$$

Failure by crack growth

$$N_f = \int_{a_0}^{a_f} \frac{da}{A\Delta K^m},$$

$\Delta\sigma$  = tensile stress range;  $\Delta\epsilon^{pl}$  = plastic strain range;  $\Delta K$  = stress intensity range;  $N$  = cycles;  $N_f$  = cycles to failure;  $C_1, C_2, a, b, A, m$  = constants;  $\sigma_m$  = tensile mean stress;  $\sigma_{TS}$  = tensile strength;  $a$  = crack length.

**Chapter 17: Creep and Creep Fracture**

$$\dot{\epsilon}_{ss} = A\sigma^n e^{-Q/\bar{R}T},$$

$\dot{\epsilon}_{ss}$  = steady-state tensile strain-rate;  $Q$  = activation energy;  $\bar{R}$  = universal gas constant;  $T$  = absolute temperature;  $A, n$  = constants.

**Chapter 18: Kinetic Theory of Diffusion**

Fick's Law

$$J = -D \frac{dc}{dx}.$$

Arrhenius's Law

$$\text{Rate} \propto e^{-Q/\bar{R}T}.$$

Diffusion coefficient

$$D = D_0 e^{-Q/\bar{R}T},$$

$J$  = diffusive flux;  $D$  = diffusion coefficient;  $c$  = concentration;  $x$  = distance;  $D_0$  = pre-exponential exponential factor.

**Chapter 21: Oxidation**

## Linear Growth Law

$$\Delta m = k_L t; \quad k_L = A_L e^{-Q/\overline{RT}}$$

## Parabolic Growth Law

$$\Delta m^2 = k_P t; \quad k_P = A_P e^{-Q/\overline{RT}}$$

$\Delta m$  = mass gain per unit area;  $k_L$ ,  $k_P$ ,  $A_L$ ,  $A_P$  = constants.

**Chapter 25: Friction and Wear**

## True contact area

$$a \approx P/\sigma_y$$

$P$  = contact force.

**Magnitudes of properties**

The listed properties lie, for most structural materials, in the range shown.

Moduli of elasticity, $E$	2 to 200 GN m <sup>-2</sup>
Densities, $\rho$	1 to 10 Mg m <sup>-3</sup>
Yield strengths, $\sigma_y$	20 to 200 MN m <sup>-2</sup>
Toughnesses, $G_c$	0.2 to 200 kJ m <sup>-2</sup>
Fracture toughnesses, $K_{Ic}$	0.2 to 200 MN m <sup>-3/2</sup>

# INDEX

---

- Abundance of elements 19
- Aids and demonstrations 290
- Alkali halides 37, 52
  - properties *see* Data
- Alumina 206, 217, 222
  - properties *see* Data
- Aluminium and alloys 69, 125, 160, 212, 222, 229, 235, 263
  - properties *see* Data
- Amorphous structures 54
- Anelasticity 78, 256
- Arrhenius's Law 179
- Availability of materials 15, 18, 20
  
- Basquin's Law 148
- Bearings 250
- Biaxial tension 28
- Body-centred cubic structure 51
- Bond stiffness 43, 58, 60
- Bonding 36
- Boundary diffusion 186, 189, 190
- Bulk diffusion 179, 185, 188, 190, 191
- Bulk modulus 32
  
- Case studies
  - car design 261
  - corrosion 232
  - creep 197
  - fatigue 160, 162
  - fracture 155
  - friction 250
  - moduli 66
  - oxidation 219
  - wear 250
  - yield 119
- Cast iron, properties *see* Data
- Ceramics 5, 93, 104, 143, 171, 192, 206, 244, 245, 254
  - properties *see* Data
- CFRP 62, 69, 123, 125, 144, 194
  - properties *see* Data
- Cleavage 142, 156
- Close-packed hexagonal structure 46, 48
- Close-packed planes, directions 45
- Coffin–Manson Law 148
- Composites 5, 62, 69, 194, 205, 264
  - fracture 144
  - properties *see* Data
- Composition of earth's crust 18
  
- Compression test 80
- Condensed states of matter 42
- Copper alloys, properties *see* Data
- Core diffusion 186, 190, 191
- Corrosion 225
  - case studies 232
  - cracking 156, 229
  - data 227, 229
  - fatigue 230
  - mechanisms 226
  - protection 232
  - rates 229
  - voltage 227, 228
- Covalent bond 37, 39
- Cracks 131, 140, 150, 155, 229
- Creep 169
  - case studies 197
  - damage 176, 191, 201
  - fracture 176, 191
  - mechanisms 187
  - of ceramics 187
  - of metals 187
  - of polymers 193
  - resistant materials 177, 192, 194, 197
  - testing 173
- Crystal structure 45
- Crystallography 47
- Cumulative damage 149
  
- Data for
  - coefficient of friction 245
  - corrosion 227, 229
  - density 55
  - diffusion 184, 185
  - ductility 86
  - energy content of materials 22
  - fracture toughness 136, 137, 138
  - melting temperatures 169, 170
  - normalised yield strength 94
  - oxidation 212, 213, 215
  - prices 16
  - softening temperatures 169, 170
  - tensile strength 86
  - toughness 136, 138
  - yield strength 85, 86
  - Young's modulus 34, 35
- Deformation–mechanism diagrams 190, 191
- Density 57
  - data 55, 56
  - properties *see* Data

- Diamond 40, 61, 249
- Diffusion 179
  - boundary 186, 189, 190
  - core 186, 190, 191
  - data 184, 185
  - Fick's Law 180, 216
  - interstitial 185
  - mechanisms 185
  - substitutional 185
- Diffusional creep 189
- Dilatation 30
- Direction indices 50
- Directional solidification 201, 205
- Dislocations 93
  - climb 188
  - core 186
  - creep 187
  - edge 95
  - energy 102
  - force on 101
  - line tension 102
  - screw 98
  - yield strength 104, 107
- Dispersion strengthening 105
- Doubling time for consumption 19
- Drawing of polymers 117
- DS alloys 201
- DS eutectics 205
- Ductile tearing 140
- Ductile-to-brittle transition 143
- Ductility 77, 91
  - data 86
  
- Edge dislocation 95
- Elastic limit 77, 91
- Elastic moduli *see* Moduli
- Embrittlement 144
- Energy
  - content of materials 22
  - expended in deformation 90
  - in car design 261
  - of a dislocation 102
  - of atomic bonds 38
- Examples 273
- Exponential growth 19
  - doubling time 19
  - law 19
- Extrapolation of creep data 192
  
- Face-centred cubic structure 46, 48
- Fast fracture 131
  - case studies 155
  - mechanisms 140
- Fatigue 146
  - case studies 160, 162
  - crack growth 150
  - high cycle 148
  - low cycle 148
  - mechanisms 151
  
- Filled polymers 62, 64, 144, 195
- Foamed polymers 69
  - properties *see* Data
- Force on a dislocation 101
- Forming
  - of metals 125, 200, 201, 202, 269
  - of polymers 269
- Fracture 131
  - case studies 155
  - data 86, 136, 137, 138
  - mechanisms 140
- Fracture toughness 131
  - data 136, 137, 138
  - of adhesives 132
  - of ceramics 136, 137, 138, 140, 142
  - of composites 136, 137, 138, 140, 144
  - of metals 136, 137, 138, 140, 143
  - of polymers 136, 137, 138, 140, 143
- Friction 241
  - case studies 250
  - data 245
  - mechanisms 241
  - of ceramics 244, 245, 254
  - of metals 244, 245, 250
  - of polymers 244, 245, 255
  - of rubber 244, 245, 255
  
- Galvanising 234
- Glass 55, 66, 123
  - properties *see* Data
  - transition temperature 61
- GFRP 62, 69, 125, 144, 194, 264
  - properties *see* Data
- Goodman's Rule 149
- Grain boundaries 108
  - diffusion 186, 189, 190
  
- Hardness 77, 113, 247, 251
  - relation to yield 87, 113
  - test 87
- High cycle fatigue 148
- Hooke's Law 31
- Hydrogen bond 37, 42
- Hydrostatic compression 28
- Hysteresis 256
  
- Ice 42
  - friction 254
  - properties *see* Data
  - structure 42
- Ideal strength 93
- Intergranular attack 156, 212, 219
- Intrinsic strength 104
- Ionic bond 37
  
- KFRP 62
- Kinetic friction 241
- Kinetic theory 179

- Leathery state of polymers 62
- Line tension of dislocations 102
- Linear elasticity 31, 77, 80
- Low cycle fatigue 148
- Lubrication 246, 250, 254
- Lüders bands 118
  
- Magnitude of properties 302
- Material data *see* Data
- Material-efficient design 22
- Material prices 15
  - data 16
- Material properties *see* Data
- Melting temperature 169, 170
- Metal properties *see* Data
- Metallic bond 37, 40
- Miller indices 49
- Miner's rule 149
- Moduli 31, 58
  - calculation of 58
  - case studies 66
  - data 34, 35
  - measurement 32
  - of composites 62
  - of rubbers 61
  
- Necking 114
- Nickel alloys, properties *see* Data
- Nimonic 199, 206
  - properties *see* Data
- Nominal stress and strain 30, 83, 88, 89
- Non-crystalline solids 52
- Non-destructive testing 87
- Non-linear elasticity 78, 256
- Normalised yield strength 94
  
- Oxidation 211
  - case studies 219
  - data 212, 213, 215
  - measurement 213
  - mechanisms 215
  - of ceramics 211
  - of metals 211
  - of polymers 211
  - protection 219
  - rates 212
- Oxides, properties *see* Data
- Oxygen 18, 211, 215, 226, 232
  
- Packing of atoms 45
- Plastic flow 81, 111, 125
  - instability 114
  - work 83, 90
  - zone 141
- Poisson's ratio 30
- Polycrystals 108
  - creep 189
  - yield strength 109, 112
  
- Polyethylene 52, 117, 232
  - properties *see* Data
- Polymers 51, 60, 62, 123, 144, 193, 244, 255
  - properties *see* Data
  - rheology 193
- Polystyrene 53
  - properties *see* Data
- Power-law creep 173
  - mechanism 187
- Precipitation strengthening 105, 200
- Prices of materials 15
  - data 16
  - turbine blades 200, 202
- Primary bonds 37
- Proof stress 84, 91
- Properties of materials *see* Data
- Protection
  - against corrosion 232
  - against oxidation 219
- PTFE 244, 245, 246, 255
- Pure shear 30
  
- Recycling 23
- Reserves of materials 20
- Resources and resource base 20
- Rubber 61, 78
  - friction 244, 245, 255
  - moduli 61
  - properties *see* Data
  - structure 53
  
- Sacrificial protection 232, 234
- Screw dislocation 98
- Selection of materials (*see also* Data)
  - car design 261
  - corrosion-limited 225, 232
  - creep-limited 195, 197
  - density-limited 66, 124, 261
  - fast-fracture-limited 155
  - fatigue-limited 162
  - friction-limited 250
  - modulus-limited 66
  - oxidation-limited 219
  - price-limited 72, 125
  - wear-limited 250
  - yield-limited 119
- Shear modulus 32
- Shear stress 28, 96, 99, 102, 109, 112
- Shear yield strength 111
- Silicon carbide 206
  - properties *see* Data
- Silicon nitride 206
  - properties *see* Data
- Sodium chloride 37, 52
- Solid solution strengthening 105
- Stainless alloys 219
- Stainless steels 237
  - properties *see* Data
- Steels, properties *see* Data

- Stiffness of atomic bonds 43, 58, 60
- Strain 30, 81, 83, 84, 89
- Strain hardening 79, 91, 107, 116, 121
- Strengthening mechanisms 104
- Stress 27, 81, 83, 84, 88
  - concentration factor 141, 142
  - corrosion 156, 229
  - intensity factor 135
  - relaxation 175
  - states 29
- Substitution 22
- Substitutional solid solution 105
- Symbols and formulae 297
  
- Taylor factor 109
- Tensile strength 84
  - data 86
- Tensile test 79, 83, 91
- Thermal fatigue 198
- Toughness 131
  - data 136, 138
  - measurement 132, 136
- True stress and strain 81, 83, 88, 89
- Turbine materials 197, 220
  
- Uranium dioxide 52
- Uses of materials 17
  
- Van der Waals bonds 37, 41, 61
  
- Wear 241
  - case studies 250
  - mechanisms 246
- Weld decay 237
- Wood 62, 69, 72, 254, 264
  - fracture 144
  - properties *see* Data
- Work hardening 79, 91, 107, 116, 121
  
- Yield strength 77, 84, 91, 109
  - case studies 119
  - data 85, 86
  - of ceramics 93
  - of metals 77, 111
  - of polycrystals 109, 112
  - of polymers 87, 118
- Young's modulus 31, 58
  - calculation 58
  - case studies 66
  - data 34, 35
  - measurement 32
  - of composites 62













This book gives a broad introduction to the properties of materials used in engineering applications and is intended to provide a course in engineering materials for students with no previous background in the subject. Engineering disasters are frequently caused by the misuse of materials and so it is vital that every engineer should understand the properties of materials, their limitations and how to select materials which best fit the demands of the design.

The chapters are arranged in groups, each group describing a particular class of properties: the Elastic Moduli; the Fracture Toughness; Resistance to Corrosion; and so forth. Each group of chapters starts by defining the property, describing how it is measured, and providing a table of data for solving problems involving the selection and use of materials. Then the basic science underlying each property is examined to provide the knowledge with which to design materials with better properties. Each chapter group ends with a case study of a practical application and each chapter ends with a list of books for further reading. To further aid the student, there are sets of examples (with answers) at the end of the book intended to consolidate or develop a particular point covered in the text. There is also a list of useful aids and demonstrations (including how to prepare them) in order to facilitate teaching of the material.

**CONTENTS:** General Introduction: Engineering Materials and their Properties • Part A - The Price and Availability of Materials • Part B - The Elastic Moduli • Bonding Between Atoms • Packing of Atoms in Solids • The Physical Basis of Young's Modulus • Case Studies of Modulus-limited Design • Part C - Yield Strength, Tensile Strength, Hardness and Ductility • Dislocations and Yielding in Crystals • Strengthening Methods and Plasticity of Polycrystals • Continuum Aspects of Plastic Flow • Case Studies in Yield-limited Design • Part D - Fast Fracture, Toughness and Fatigue • Fast Fracture and Toughness • Micromechanisms of Fast Fracture • Fatigue Failure • Case Studies in Fast Fracture and Fatigue Failure • Part E - Creep Deformation and Fracture • Creep and Creep Failure • Kinetic Theory of Diffusion • Mechanisms of Creep and Creep-resistant Materials • The Turbine Blade - a Case Study in Creep-limited Design • Part F - Oxidation and Corrosion • Oxidation of Materials • Case Studies in Dry Oxidation • Wet Corrosion of Materials • Case Studies in Wet Corrosion • Part G - Friction, Abrasion and Wear • Case Studies in Friction and Wear • Final Case Study - Materials and Energy in Car Design • Appendix 1 - Example Questions with Answers • Appendix 2 - Teaching Aids and Demonstrations • Appendix 3 - Symbols and Formulae • Index.

**B**UTTERWORTH  
**H**EINEMANN

An imprint of Elsevier Science  
www.bh.com

ISBN 0-7506-3081-7



9 780750 630818